



**Agreement No. CE 30/2018 (EP)  
Environmental Team for Kai Tak Sports Park –  
Design and Construction**

Monthly EM&A Report for September 2024

October 2024



Culture, Sports and Tourism  
Bureau & Recreation Branch  
Kai Tak Sports Park Section  
Room 2307-2310, 23/F, Skyline  
Tower, 39 Wang Kwong Road,  
Kowloon Bay Kai Tak, Kowloon

**Agreement No. CE 30/2018 (EP)**  
**Environmental Team for Kai Tak Sports Park –**  
**Design and Construction**

Monthly EM&A Report for September 2024

October 2024





## Environmental Permit No. EP-544/2017

### Kai Tak Sports Park - Investigation

### Independent Environmental Checker Verification

#### Reference Document/Plan

Document/ <del>Plan</del> to be <del>Certified</del> / Verified:	Monthly EM&A Report No. 66 (September 2024)
Date of Report:	10 October 2024
Date received by IEC:	10 October 2024

#### Reference EP Condition

Environmental Permit Condition: 3.4

Three hard copies and one electronic copy of the monthly EM&A Report shall be submitted to the Director within 10 working days after the end of each reporting month. The monthly EM&A Reports shall include a summary of all non-compliance with the recommendations in the approved EIA Report (Register No. AEIAR-204/2017) or this Permit. The submissions shall be certified by the ET Leader and verified by the IEC as complying with the requirements as set out in the EM&A Manual before submission to the Director. Additional copies of submission shall be provided upon request by the Director.

#### IEC Verification

I hereby verify that the above referenced document/~~plan~~ complies with the above referenced condition of EP-544/2017.

Ms Mandy To

Date: 10 October 2024

Independent Environmental Checker



**Culture, Sports and Tourism Bureau**  
The Government of the Hong Kong Special Administrative Region  
of the People's Republic of China



**Environmental Permit No. EP- 544/2017**

**Kai Tak Sports Park – Investigation**

**Environmental Team Leader Certification**

**Reference Document /Plan**

Document/ <del>Plan</del> to be Certified:	Monthly EM&A Report for September 2024
Date of Report:	10 October 2024
Date received by ETL:	10 October 2024

**Reference EP Condition**

Environmental Permit Condition:	3.4
---------------------------------	-----

Three hard copies and one electronic copy of the monthly EM&A Report shall be submitted to the Director within 10 working days after the end of each reporting month. The monthly EM&A Reports shall include a summary of all non-compliance with the recommendations in the approved EIA Report (Register No. AEIAR-204/2017) or this Permit. The submissions shall be certified by the ET Leader and verified by the IEC as complying with the requirements as set out in the EM&A Manual before submission to the Director. Additional copies of submission shall be provided upon request by the Director.

**ETL Certification**

I hereby certify that the above reference document complies with the above referenced condition of EP-544/2017.

Mr Sunny Chan  
Environmental Team Leader

Date: 10 October 2024

# Contents

Executive summary	1
<b>1 Introduction</b>	<b>5</b>
1.1 Background	5
1.2 Project Organisation	6
1.3 Works Area and Construction Programme	6
1.4 Construction Works undertaken during the Reporting Period	7
<b>2 Air Quality Monitoring</b>	<b>8</b>
2.1 Introduction	8
2.2 Monitoring Parameters, Frequency and Duration	8
2.3 Monitoring Locations	8
2.4 Monitoring Action and Limit Levels	9
2.5 Monitoring Schedule for the Reporting Period	9
2.6 Monitoring Equipment	10
2.7 Monitoring Methodology	10
2.8 Monitoring Results	10
2.9 Wind Data	11
<b>3 Noise Monitoring</b>	<b>12</b>
3.1 Introduction	12
3.2 Monitoring Parameters, Frequency and Duration	12
3.3 Monitoring Locations	12
3.4 Action and Limit Levels	13
3.5 Monitoring Schedule for the Reporting Period	13
3.6 Monitoring Equipment	14
3.7 Monitoring Methodology	14
3.8 Monitoring Results	15
<b>4 Environmental Site and Audit</b>	<b>16</b>
4.1 Site Inspection	16
4.2 Advice on the Solid and Liquid Waste Management Status	18
4.3 Environmental Licenses and Permits	18
4.4 Implementation Status of Environmental Mitigation Measures	18
4.5 Summary of Exceedance of the Environmental Quality Performance Limit	19
4.6 Summary of Complaints, Notification of Summons and Successful Prosecution	19
<b>5 Future Key Issues</b>	<b>21</b>
5.1 Construction Programme for the Coming Months	21

6	Conclusions	22
6.1	Conclusions	22

## Figures

Figure 2.1: Location of Air Quality Monitoring Stations

Figure 3.1: Location of Noise Monitoring Stations

## Appendices

Appendix A. Project Organization for Environmental Works

Appendix B. Location of Works Areas

Appendix C. Construction Programme

Appendix D. Event and Action Plan

Appendix E. Environmental Site Inspection and Monitoring Schedule

Appendix F. Calibration Certificates

Appendix G. Monitoring Data and Graphical Plots (Air Quality and Noise)

Appendix H. Wind Data

Appendix I. Waste Flow Table

Appendix J. Environmental Licences and Permits

Appendix K. Environmental Mitigation Measures Implementation Status

Appendix L. Statistics on Environmental Complaints, Notification of Summons and Successful Prosecutions

Appendix M. Exceedance Investigation Report

Appendix N. Complaint Investigation Report

## Tables

Table 1.1: Contact Information of Key Personnel	6
Table 2.1: Air Quality Monitoring Parameters, Frequency and Duration	8
Table 2.2: Construction Dust Monitoring Locations	8
Table 2.3: Temporary Construction Dust Monitoring Location	9
Table 2.4: Action and Limit Levels for 1-hour TSP	9
Table 2.5: 1-hour TSP Monitoring Equipment	10
Table 2.6: Summary of 1-hour TSP Monitoring Results During the Reporting Period	10
Table 3.1: Noise Monitoring Parameters, Frequency and Duration	12
Table 3.2: Construction Noise Monitoring Locations	12
Table 3.3: Temporary Construction Noise Monitoring Location	13
Table 3.4: Action and Limit Level for Construction Noise	13
Table 3.5: Noise Monitoring Equipment	14
Table 3.6: Summary of Construction Noise Monitoring Results During the Reporting Period	15



Table 4.1: Summary of Site Inspections and Recommendations	17
Table 4.2: Summary of Complaints in the Reporting Month	19
Table 5.1: Construction Activities for the Next Reporting Period	21
Table D.1: Event and Action Plan for Construction Air Quality (Action Level)	
Table D.2: Event and Action Plan for Construction Air Quality (Limit Level)	
Table D.3: Event and Action Plan for Construction Noise	
Table E.1: Site Inspection and Monitoring Schedule for September 2024	
Table E.2: Tentative Site Inspection and Monitoring Schedule for October 2024	
Table J.1: Summary of Environmental Licences and Permits Status (KTSP)	
Table J.2: Summary of Environmental Licences and Permits Status (H/O Development)	
Table L.1: Statistics on Environmental Complaints, Notifications of Summons and Successful Prosecutions	

# Executive summary

The Project – hereby meaning the Designated Project (Items O.6 and O.7 Part I, Schedule 2 of the Environmental Impact Assessment Ordinance (EIAO)), comprising the “Kai Tak Sports Park” (KTSP) project and the Hotel and Office (H/O) Development of NKIL 6607 adjoining the KTSP – is located in the Kai Tak Development (KTD) area in Kowloon.

An EIA Report for the Project (Register No. AEIAR-204/2017) was approved by the Environmental Protection Department (EPD) on 6 January 2017. The current Environmental Permit (EP) for the Project, namely No. EP-544/2017, was issued on 8 September 2017. These documents are available through the EIA Ordinance Register. The Project construction works commenced on 8 April 2019.

In February 2019, Mott MacDonald Hong Kong Limited was appointed by the Home Affairs Bureau (HAB), as the Environmental Team (ET) to implement the Environmental Monitoring & Audit (EM&A) programme for the construction phase and first year of operation of the Project in accordance with the approved EM&A Manual.

In July 2022, Home Affairs Bureau (HAB) has been reorganized as Culture, Sports and Tourism Bureau (CSTB).

This is the 66<sup>th</sup> Monthly EM&A Report for the construction phase of the Project which summarizes findings of the EM&A programme during the reporting period from 1 to 30 September 2024.

## Key Construction Works in the Reporting Period

A summary of construction activities undertaken during the reporting period is presented below:

### KTSP

- Mobilization and lifting;
- Concreting;
- Excavation; and
- Landscape work.

### H/O Development

- Excavation;
- Concreting; and
- Landscape work.

## Environmental Monitoring and Audit Progress

The monthly EM&A programme was undertaken by ET in accordance with the approved EM&A Manual. A summary of the monitoring activities during the reporting period is presented below:

Activity	Monitoring Locations	Date
Air Quality Monitoring (1-hour TSP)	AMS1-T2*, AMS2, AMS4	4, 10, 16, 20, 26 Sep 2024
Noise Monitoring (L <sub>eq</sub> (30 min))	NMS1-T2*, NMS2, NMS4	4, 10, 16, 26 Sep 2024
Weekly environmental site inspections	-	4, 11, 19, 24 Sep 2024
Landscape and visual site inspections	-	4, 19 Sep 2024

\*Note:

During the reporting period, temporary impact monitoring stations, AMS1-T and NMS1-T, were no longer accessible from 13 August 2024, due to the relocation of the Agriculture, Fisheries and Conservation Department Kowloon Animal Management Centre. Alternative temporary air quality and noise impact monitoring stations, AMS1-T2 and NMS1-T2, were proposed by ET and agreed by IEC on 9 August 2024 and further approved by EPD on 28 August 2024 for conducting impact monitoring during the reporting period. The details of temporary monitoring stations are described in Section 2 and Section 3 respectively.

## Breaches of Action and Limit Levels

### Air Quality

There was no breach of Action or Limit Levels for air quality (1-hr TSP) during the reporting month.

### Noise

One noise-related complaint was recorded during the reporting month. One Action Level exceedance for noise was triggered during the reporting month.

Three Limit Levels exceedance for noise levels were recorded at NMS1-T2 and one Limit Level exceedance for noise level was recorded at NMS4 during the reporting month. Exceedance investigations were conducted and summarised in **Appendix M**.

## Complaint Log

There was one complaint in relation to the environmental impact received during the reporting month. Complaint investigation was conducted and summarised in **Appendix N**.

## Summary of Complaints in the Reporting Month

Date of Notification from EPD	Date of Complaint	Description of Complaint	Recommendations / Actions	Close-Out Date / Status
2 Sep 2024	16 Aug 2024	- Complaint of noise nuisance from the construction site Kai Tak Sports Park at night. - Please be advised to	1. Power Mechanical Equipment with Quality Power Mechanical Equipment (QPME) labels	4 Oct 2024

Date of Notification from EPD	Date of Complaint	Description of Complaint	Recommendations / Actions	Close-Out Date / Status
		implement practicable mitigation measures at your construction site to minimize the environmental nuisance arising from the construction work.	were used at site to lower the noise nuisance to the nearby residents. 2. Subcontractors had been reminded to observe the Construction Noise Permit for working at night during regular subcontractor meetings. 3. A memo to all subcontractors has been issued in August 2024 with the latest Construction Noise Permit attached. 4. Night time inspections were conducted to ensure all Power Mechanical Equipment were switched off. 5. Implementation of construction noise mitigation measures recommended in EIA's Environmental Mitigation Implementation Schedule.	

### **Notifications of Summons and Successful Prosecutions**

There were no notifications of summons or prosecutions received during this reporting period.

### **Reporting Changes**

There was no reporting change during the reporting period.

### **Future Key Issues**

The future key issues to be undertaken in the upcoming month are:

#### **KTSP**

- Mobilization and lifting;
- Concreting;
- Excavation; and
- Landscape work.

#### **H/O Development**

- Nil\*\*

**\*\*Note:**

According to the Project Architect and Contractor of the Hotel and Office Development, the construction works at Hotel and Office Development area have been substantially completed and the Hotel area has been handed over to the developer on 25 September 2024.

Termination of EM&A site inspection at Hotel and Office Development area was proposed by ET and IEC and pending approval from EPD.

# 1 Introduction

## 1.1 Background

The Project – hereby meaning the Designated Project (Items O.6 and O.7 Part I, Schedule 2 of the Environmental Impact Assessment Ordinance (EIAO)), comprising the “Kai Tak Sports Park” (KTSP) project and the Hotel and Office (H/O) Development of NKIL 6607 adjoining the KTSP – is located in the Kai Tak Development (KTD) area in Kowloon.

The key construction works of the Project include:

### (i) KTSP project

- a. a multi-purpose Main Stadium with a spectator capacity of around 50,000;
- b. a Public Sports Ground, with a spectator capacity of around 5,000;
- c. an Indoor Sports Centre with a multi-purpose main arena with a seating capacity of up to 10,000 and an ancillary sports hall with a seating capacity of 500;
- d. retail and dining outlets with a gross floor area (GFA) of about 57,000 square metres (m<sup>2</sup>), a bowling centre with 40 lanes and a health and wellness centre with about 2,500 m<sup>2</sup> GFA;
- e. more than 8 hectares of public open space including landscaped deck structures across Shing Kai Road, passive amenities and park features, outdoor ball courts; and
- f. ancillary facilities such as car parks, toilets, changing rooms, etc.

### (ii) H/O Development

- g. an office development;
- h. a 300-room hotel with a GFA of about 16,000 m<sup>2</sup>; and
- i. ancillary facilities such as retails, car parks, etc.

In February 2019, Mott MacDonald Hong Kong Limited (MMHK) was commissioned by the Home Affairs Bureau (HAB) under Agreement No. CE 30/2018 (EP) to undertake the Environmental Team (ET) services for carrying out the Environmental Monitoring & Audit (EM&A) programme during the construction phase and first year of operation of the Project in accordance with the approved Environmental Impact Assessment (EIA) Report (Register No.: AEIAR-204/2017), EM&A Manual (including any subsequent amendments) and EP (including any subsequent variations of it and/or any further environmental permit issued under the EIAO). The current EP (No. EP-544/2017) was issued by EPD on 8 September 2017.

In July 2022, Home Affairs Bureau (HAB) has been reorganized as Culture, Sports and Tourism Bureau (CSTB).

This is the 66<sup>th</sup> Monthly EM&A Report summarising the key findings of the construction phase EM&A programme from 1 to 30 September 2024 (the “reporting period”) and is submitted to fulfil Condition 3.4 of the EP.

## 1.2 Project Organisation

The organisation chart and lines of communication with respect to the on-site environmental management structure of the key personnel are shown in **Appendix A**. The key personnel contact names and numbers are summarized in **Table 1.1**.

**Table 1.1: Contact Information of Key Personnel**

Party	Position	Name	Telephone	Fax
Project Proponent (Culture, Sports and Tourism Bureau)	Project Director (Sports Park)	Lilian Cheung	3586 3403	3586 0591
Supervising Officer's Representative (Culture, Sports and Tourism Bureau)	Senior Engineer	Keith Man	3586 3149	3586 0591
Environmental Team (Mott MacDonald Hong Kong Limited)	Environmental Team Leader	Sunny Chan	2828 5962	2827 1823
	Deputy Environmental Team Leader	Ken Wong	2828 5757	2827 1823
Independent Environmental Checker (ERM Hong Kong Limited)	Independent Environmental Checker	Mandy To	2271 3000	3015 8052
Contracted Party (Kai Tak Sports Park Limited)	Assistant Contract Manager	Eric Chung	3552 5003	2845 9295
	Environmental Officer	Gary Yim	3552 5013	3552 5099
<b>Hotel and Office Development</b>				
Project Manager (Sanon Limited)	Senior Group Project Director	David Lee	2910 8368	2815 9949
	Project Manager	William Chan	2910 8363	2815 9949
Project Architect (P&T Architects & Engineers Limited)	Project Architect	Patrick Chan	2832 7205	-
Contractor (Hip Hing Construction Co., Ltd.)	Project Manager	Michael Wong	9671 9952	-
24-hour Community Liaison Hotline	-	-	5587 6112	-

## 1.3 Works Area and Construction Programme

The construction works commenced on 8 April 2019. The works area of the Project is shown in **Appendix B**. The Construction Works Programme of the Project is provided in **Appendix C**.

## 1.4 Construction Works undertaken during the Reporting Period

A summary of construction activities undertaken during this reporting period is presented below:

### **KTSP**

- Mobilization and lifting;
- Concreting;
- Excavation; and
- Landscape work.

### **H/O Development**

- Excavation;
- Concreting; and
- Landscape work.



## 2 Air Quality Monitoring

### 2.1 Introduction

In accordance with the EM&A Manual of the Project, baseline 1-hour Total Suspended Particulates (TSP) levels at air quality monitoring stations AMS1 and AMS2 were established. Impact 1-hour TSP monitoring was conducted for at least three times every 6 days.

### 2.2 Monitoring Parameters, Frequency and Duration

**Table 2.1** summarises the monitoring parameters, frequency and duration of impact air quality monitoring.

**Table 2.1: Air Quality Monitoring Parameters, Frequency and Duration**

Parameter	Frequency and Duration
1-hour TSP	3 times every six-days

### 2.3 Monitoring Locations

According to the EM&A Manual, a total of five air quality monitoring stations are identified for impact monitoring. Of these, two air sensitive receivers (AMS3 and AMS5) are planned residential use and were not available for baseline monitoring; the same two are also currently not available for impact monitoring.

**Table 2.2** describes the impact air quality monitoring stations and **Figure 2.1** shows their locations.

**Table 2.2: Construction Dust Monitoring Locations**

Monitoring Station	Location	Status
AMS1	Hong Kong Society for the Blind Workshop, Roof Floor	Existing Air Sensitive Receiver (not accessible from 1 September 2022)
AMS2	Sky Tower, Podium of Tower 7	Existing Air Sensitive Receiver
AMS4	Retail Building in front of The Henley, Rooftop	Existing Air Sensitive Receiver
AMS3	Kai Tak Area 2B Site 4 (2B4) (residential use)	Planned Air Sensitive Receiver
AMS5	Kai Tak Area 1L Site 3 (1L3) (residential use)	Planned Air Sensitive Receiver

During the reporting period, monitoring locations AMS2 and AMS4 were set up at the proposed locations for impact monitoring.

Permission on setting up and carrying out impact monitoring works at AMS3 and AMS5 will be sought once each respective development is completed and occupied.

The impact monitoring station AMS1 was no longer open for impact monitoring from 1 September 2022, due to relocation of the Hong Kong Society for the Blind Workshop.

Temporary air quality monitoring station, AMS1-T, was used to conduct dust monitoring during the reporting period. Details of temporary alternative monitoring location was presented in

Temporary Alternative Proposal for Monitoring Station as proposed by ET and agreed by IEC dated 6 January 2021.

During the reporting period, temporary monitoring station AMS1-T, was no longer accessible from 13 August 2024, due to the relocation of the Agriculture, Fisheries and Conservation Department Kowloon Animal Management Centre. Alternative temporary air quality monitoring station, AMS1-T2 was proposed by ET and agreed by IEC on 9 August 2024 and further approved by EPD on 28 August 2024 for conducting impact monitoring during the reporting period.

The details of temporary monitoring stations are described in **Table 2.3** and the location of temporary monitoring station is shown in **Figure 2.1**.

**Table 2.3: Temporary Construction Dust Monitoring Location**

Monitoring Station	Location	Status
AMS1-T	Agriculture, Fisheries and Conservation Department Kowloon Animal Management Centre, 102 Sung Wong Toi Road	Existing Air Sensitive Receiver (not accessible from 13 August 2024)
AMS1-T2	Shing Kai Road Garden	Existing Air Sensitive Receiver (from 13 August 2024)

## 2.4 Monitoring Action and Limit Levels

The Action and Limit Levels for 1-hr TSP are provided in **Table 2.4**.

**Table 2.4: Action and Limit Levels for 1-hour TSP**

Monitoring Station	Action Level, $\mu\text{g}/\text{m}^3$	Limit Level, $\mu\text{g}/\text{m}^3$
AMS1 – Hong Kong Society for the Blind Workshop, Roof Floor	283	500
AMS2 – Sky Tower, Podium of Tower 7	280	500
AMS3 - Kai Tak Area 2B Site 4 (2B4) (residential use)	287*	500
AMS4 - Kai Tak Area 1K Site 3 (1K3) (residential use)	287*	500
AMS5 - Kai Tak Area 1L Site 3 (1L3) (residential use)	287*	500

\*Remarks: the Action Level for AMS3, AMS4 and AMS5 were derived from an alternative monitoring station AMS3-4-5 during the baseline monitoring.

The event and action plan is provided in **Appendix D**.

If exceedance(s) at these stations is/are recorded by the ET of the Project, it will carry out an investigation and findings will be reported in the monthly EM&A Report.

## 2.5 Monitoring Schedule for the Reporting Period

The schedule for air quality monitoring at AMS1-T2, AMS2 and AMS4 in the reporting period is presented in **Appendix E**.

## 2.6 Monitoring Equipment

Portable direct reading dust meters were used to carry out the 1-hour TSP monitoring. The brand(s) and model(s) of the equipment used for air quality monitoring stations AMS1-T, AMS2 and AMS4 under this Project are given in **Table 2.5**.

**Table 2.5: 1-hour TSP Monitoring Equipment**

Equipment	Brand	Model No.
Portable direct reading dust meter	Sibata Digital Dust Monitor	LD-3B (S/N: 235780, 235786, 6Z7784)

## 2.7 Monitoring Methodology

### Field Monitoring

The measuring procedures of the 1-hour TSP dust meter are in accordance with the Manufacturer’s Instruction Manual as follows:

- Turn the power on.
- Close the air collecting opening cover.
- Push the “TIME SETTING” switch to [BG].
- Push “START/STOP” switch to perform background measurement for 6 seconds.
- Turn the knob at SENSI ADJ position to insert the light scattering plate.
- Leave the equipment for 1 minute upon “SPAN CHECK” is indicated in the display.
- Push “START/STOP” switch to perform automatic sensitivity adjustment. This measurement takes 1 minute.
- Pull out the knob and return it to MEASURE position.
- Setting time period of 1 hour for the 1-hour TSP measurement.
- Push “START/STOP” to start the 1-hour TSP measurement.
- Regular checking of the time period setting to ensure monitoring time of 1 hour.

### Maintenance and Calibration

- The 1-hour dust meter would be checked at 3-month intervals and calibrated at 1-year intervals throughout all stages of the air quality monitoring.
- Calibration records for direct dust meters are given in **Appendix F**.

## 2.8 Monitoring Results

The monitoring results for 1-hour TSP at AMS1-T2, AMS2 and AMS4 are summarized in **Table 2.6**. Detailed impact air quality monitoring results are presented in **Appendix G**.

**Table 2.6: Summary of 1-hour TSP Monitoring Results During the Reporting Period**

Monitoring Station	Average, $\mu\text{g}/\text{m}^3$	Min, $\mu\text{g}/\text{m}^3$	Max, $\mu\text{g}/\text{m}^3$	Action Level, $\mu\text{g}/\text{m}^3$	Limit Level, $\mu\text{g}/\text{m}^3$
AMS1-T2	41	28	52	283	500
AMS2	42	26	57	280	500
AMS4	37	26	50	287	500

There was no Action and Limit Level exceedance of 1-hr TSP level recorded at station AMS1-T2, AMS2 and AMS4 by the ET during the reporting period.

## 2.9 Wind Data

Wind data at Kai Tak automatic weather station collected from the Hong Kong Observatory (HKO) were used for the air quality monitoring and they are shown in **Appendix H**. It is considered that the wind data obtained at the existing Kai Tak wind station are representative of the Project area and could be used for undertaking the construction phase baseline and impact air quality monitoring programme for the Project.

The proposed use of the existing wind data from Kai Tak automatic weather station collected from HKO for wind data collection instead of setting up wind monitoring equipment near the monitoring stations was proposed by ET and agreed by IEC in accordance with the requirements as stated in Section 3.4.7 of the EM&A Manual of the Project.

## 3 Noise Monitoring

### 3.1 Introduction

In accordance with the EM&A Manual, impact noise monitoring was conducted at least once per week for each noise monitoring location during the construction phase of the Project.

### 3.2 Monitoring Parameters, Frequency and Duration

**Table 3.1** summarises the monitoring parameters, frequency and duration of impact noise monitoring.

**Table 3.1: Noise Monitoring Parameters, Frequency and Duration**

Parameter	Frequency and Duration
30-minutes measurement at each monitoring station between 0700 and 1900 on normal weekdays (Monday to Saturday). L <sub>eq</sub> , L <sub>10</sub> and L <sub>90</sub> would be recorded.	At least once per week

### 3.3 Monitoring Locations

According to the approved EM&A Manual, a total of seven noise monitoring stations were identified for the impact monitoring locations. Of these, four noise sensitive receivers are planned residential use (NMS1A, NMS2A, NMS3 and NMS5). **Table 3.2** describes the details of the monitoring stations and **Figure 3.1** shows the locations of noise monitoring stations.

**Table 3.2: Construction Noise Monitoring Locations**

Monitoring Station	Location Description	Status
NMS1	Hong Kong Society for the Blind Workshop, Roof Floor	Existing Noise Sensitive Receiver (not accessible from 1 September 2022)
NMS2	Sky Tower, Podium of Tower 7	Existing Noise Sensitive Receiver
NMS4	Retail Building in front of The Henley, Rooftop	Existing Noise Sensitive Receiver
NMS1A	Sung Wong Toi Road Public Housing Site	Planned Noise Sensitive Receiver
NMS2A	Sung Wong Toi Road CDA Site (mixed use)	Planned Noise Sensitive Receiver
NMS3	Kai Tak Area 2B Site 4 (2B4) (residential use)	Planned Noise Sensitive Receiver
NMS5	Kai Tak Area 1L Site 3 (1L3) (residential use)	Planned Noise Sensitive Receiver

During the reporting period, monitoring locations NMS2 and NMS4 were set up at the proposed locations for impact monitoring.

Since NMS1A & NMS2A are planned (i.e. not existing) noise sensitive receivers, noise monitoring should be carried out initially at NMS1 and NMS2 respectively before the population intake of the planned developments. Once the planned developments are completed and occupied, NMS1A shall replace NMS1, while NMS2A shall replace NMS2. It is proposed that

the baseline noise level and Limit Level at NMS1A and NMS2A will be the same as those derived from the baseline monitoring data recorded at NMS1 and NMS2 respectively.

Permission on setting up and carrying out impact monitoring works at NMS3 and NMS5 will be sought once each respective development is completed and occupied.

During the reporting period, monitoring station NMS1 was no longer open for impact monitoring from 1 September 2022, due to relocation of the Hong Kong Society for the Blind Workshop. Temporary noise monitoring station, NMS1-T, was used to conduct noise monitoring during the reporting period. Details of temporary alternative monitoring locations are presented in Temporary Alternative Proposal for Monitoring Station as proposed by ET and agreed by IEC dated 6 January 2021.

During the reporting period, temporary monitoring station NMS1-T, was no longer accessible from 13 August 2024, due to the relocation of the Agriculture, Fisheries and Conservation Department Kowloon Animal Management Centre. Alternative temporary noise monitoring station, NMS1-T2 was proposed by ET and agreed by IEC on 9 August 2024 and further approved by EPD on 28 August 2024 for conducting impact monitoring during the reporting period.

The details of temporary monitoring station are described in **Table 3.3** and the location of noise monitoring station is shown in **Figure 3.1**

**Table 3.3: Temporary Construction Noise Monitoring Location**

Monitoring Station	Location Description	Status	Type of Measurement
NMS1-T	Agriculture, Fisheries and Conservation Department Kowloon Animal Management Centre, 102 Sung Wong Toi Road	Exiting Noise Sensitive Receiver (not accessible from 13 August 2024)	Façade
NMS1-T2	138 To Kwa Wan Road	Exiting Noise Sensitive Receiver (from 13 August 2024)	Façade

### 3.4 Action and Limit Levels

The Action and Limit Levels for construction noise are defined in **Table 3.4**.

**Table 3.4: Action and Limit Level for Construction Noise**

Monitoring Station	Time Period	Action Level	Limit Level
NMS1-T2 NMS2 NMS4	0700 – 1900 hours on normal weekdays	When one documented complaint is received	75 dB(A)

The event and action plan is provided in **Appendix D**.

If exceedance(s) at these stations is/are recorded by the ET of the Project, it will carry out an investigation and findings will be reported in the monthly EM&A Report.

### 3.5 Monitoring Schedule for the Reporting Period

The schedule for noise monitoring in the reporting period is presented in **Appendix E**.

### 3.6 Monitoring Equipment

Noise monitoring was performed using sound level meters at each designed monitoring station. The sound level meters deployed comply with the International Electrotechnical Commission Publications (IEC) 651:1979 (Type 1) and 804:1985 (Type 1) specifications. Acoustic calibrator was deployed to check the sound level meters at a known sound pressure level. Brand and model of the equipment used for noise monitoring under this Project is given in **Table 3.5**

**Table 3.5: Noise Monitoring Equipment**

Equipment	Brand	Model No.
Integrated Sound Level Meter	Rion	NL-52 (S/N 00175561)
Acoustic Calibrator	LARSON DAVIS	CAL200 (S/N 11334)

### 3.7 Monitoring Methodology

- Façade and Free Field measurements were made at the monitoring locations.
- For Façade measurement, the microphone head of the sound level meter was positioned 1m exterior of the noise sensitive façade and lowered sufficiently so that the building’s external wall acts as a reflecting surface.
- For free field, the microphone of the Sound Level Meter was set at least 1.2 m above the ground.
- A correction of +3dB(A) was made for free field measurement.
- The battery condition was checked to ensure the correct functioning of the meter.
- Parameters such as frequency weighting, the time weighting and the measurement time were set as follows:
  - frequency weighting: A
  - time weighting: Fast
  - time measurement: 30-minute intervals (between 0700-1900 on normal weekdays)
- Prior to and after each noise measurement, the meter was calibrated using a Calibrator for 94 dB at 1 kHz. If the difference in the calibration level before and after measurement was more than 1 dB, the measurement would be considered invalid and repeated after the re-calibration or repair of the equipment.
- During the monitoring period, the  $L_{eq}$ ,  $L_{10}$  and  $L_{90}$  were recorded. In addition, any site observations and noise sources were recorded on a standard record sheet.
- Noise measurements were not made in presence of fog, rain, wind with a steady speed exceeding 5m/s or wind with gusts exceeding 10m/s.

#### Maintenance and Calibration

- The microphone head of the sound level meter and calibrator is cleaned with soft cloth at quarterly intervals.
- The sound level meter and calibrator are sent to the supplier or HOKLAS laboratory to check and calibrate at yearly intervals.
- Calibration records are shown in **Appendix F**.

### 3.8 Monitoring Results

The monitoring results for construction noise are summarized in **Table 3.6**. Detailed impact noise monitoring results and relevant graphical plots are presented in **Appendix G**.

**Table 3.6: Summary of Construction Noise Monitoring Results During the Reporting Period**

Monitoring Station	Measured Noise Level $L_{eq}$ (30 mins), dB(A)			Limit Level
	Average	Min	Max	
NMS1-T2	75	75	75	75
NMS2	70	69	70	75
NMS4	71	65	77	75

No noise exceedances were recorded at stations NMS2 by ET during the reporting period.

Three Limit Level exceedances for noise levels were recorded at station NMS1-T2 and one Limit Level exceedance for noise level was recorded at station NMS4. during the reporting period. Exceedance investigations were conducted and the detail was shown in **Appendix M**.



## 4 Environmental Site and Audit

### 4.1 Site Inspection

Site inspections were carried out by ET on a weekly basis to monitor the implementation of proper environmental pollution control mitigation measures for the Project. Key observations were recorded in the site inspection checklist and passed to the Contracted Party together with the appropriate recommended mitigation measures where necessary. During the reporting period, site inspections were carried out on 4, 11, 19 and 24 September 2024. Joint IEC site inspections were carried out on 11 and 24 September 2024.

Bi-weekly landscape and visual site audit was carried out on 4 and 19 September 2024. The landscape and visual audit have been audited by Registered Landscape Architect (RLA). No major observations of landscape and visual impact were identified. The result findings were summarised in **Appendix K**.

Key observations during the site inspections are described in **Table 4.1**.

**Table 4.1: Summary of Site Inspections and Recommendations**

Inspection Date	Key Observations	Recommendations / Actions	Close-Out Date / Status
<b>Kai Tak Sports Park</b>			
4 Sep 2024	Accumulation of stockpile without covering was observed at southern site.	The contractor was reminded to provide cover for the stockpile.	11 Sep 2024
4 Sep 2024	No NRMM label was observed for generator at southern site	The contractor was reminded to display NRMM label for the generator.	11 Sep 2024
11 Sep 2024	Accumulation of general refuse was observed at northern site	The contractor was reminded to clear the general refuse regularly.	19 Sep 2024
11 Sep 2024	Accumulation of general refuse on floor was observed at northern site	The contractor was reminded to dispose of the general refuse properly.	19 Sep 2024
11 Sep 2024	Dust emission was observed at haul road at northern site	The contractor was reminded to provide regular water spraying for haul road.	19 Sep 2024
11 Sep 2024	Chemical container without drip tray was observed at northern site	The contractor was reminded to provide drip tray for the chemical container.	19 Sep 2024
11 Sep 2024	An excavator without NRMM label was observed at northern site.	The contractor was reminded to display the NRMM label for the excavator.	19 Sep 2024
19 Sep 2024	Accumulation of stockpile without cover was observed at southern site	The contractor was reminded to provide covering for the stockpile.	24 Sep 2024
19 Sep 2024	A forklift without NRMM label was observed at southern site	The contractor was reminded to display new NRMM label for the forklift.	24 Sep 2024
24 Sep 2024	Chemical containers without drip trays were observed at northern site.	The contractor was reminded to provide drip trays for the chemical containers.	2 Oct 2024
24 Sep 2024	Accumulation of stagnant water was observed at northern site.	The contractor was reminded to provide temporary water pump to clear the stagnant water.	2 Oct 2024

Inspection Date	Key Observations	Recommendations / Actions	Close-Out Date / Status
<b>Hotel and Office Development</b>			
4 Sep 2024	Nil	N/A	N/A
11 Sep 2024	Accumulation of general refuse was observed on site.	The contractor was reminded to clear the general refuse regularly.	19 Sep 2024
11 Sep 2024	A skid steer loader with damaged NRMM label was observed.	The contractor was reminded to display new NRMM label for the skid steer loader.	19 Sep 2024
19 Sep 2024	Nil	N/A	N/A
24 Sep 2024	Nil	N/A	N/A

## 4.2 Advice on the Solid and Liquid Waste Management Status

### KTSP

The Contracted Party was registered as a chemical waste producer for the Project. Construction and demolition (C&D) material sorting was carried out on site. Sufficient numbers of receptacles were provided for general refuse collection and sorting. Excavated inert C&D materials were reused to minimise the disposal of C&D waste to public fill.

The Contracted Party was reminded to maintain on site waste sorting and recording system and maximize reuse / recycling of C&D wastes, whenever these are generated.

### H/O Development

Construction and demolition (C&D) material sorting was carried out on site. Sufficient numbers of receptacles were provided for general refuse collection and sorting. Excavated inert C&D materials were designated for on temporary site storage and collected for the disposal to public fill.

The Contractor was reminded to maintain on site waste sorting and maximize reuse / recycling of C&D wastes, whenever these are generated.

The monthly summary of waste flow table is detailed in **Appendix I**.

## 4.3 Environmental Licenses and Permits

The valid environmental licenses and permits for the Project during the reporting period are summarized in **Appendix J**.

## 4.4 Implementation Status of Environmental Mitigation Measures

In response to the site audit findings, the Contracted Party carried out corrective actions.

A summary of the environmental mitigation measures implementation status is presented in **Appendix K**. Most of the necessary mitigation measures were implemented properly.

## 4.5 Summary of Exceedance of the Environmental Quality Performance Limit

### Air Quality

No Action and Limit Level exceedances of 1-hour TSP level was recorded at AMS1-T2, AMS2 and AMS4 during the reporting period.

### Noise

One noise-related complaint was received during the reporting month. One Action Level exceedance for noise was triggered during the reporting month.

Three Limit Levels exceedance for noise levels were recorded at NMS1-T2 and one Limit Level exceedance for noise level was recorded at NMS4 during the reporting month. Exceedance investigations were conducted and summarised in **Appendix M**.

## 4.6 Summary of Complaints, Notification of Summons and Successful Prosecution

### Complaints

There was one complaint received in relation to the environmental impact during the reporting month. Complaint investigation was conducted and summarised in **Appendix N**.

**Table 4.2: Summary of Complaints in the Reporting Month**

Date of Notification from EPD	Date of Complaint	Description of Complaint	Recommendations / Actions	Close-Out Date / Status
2 Sep 2024	16 Aug 2024	- Complaint of noise nuisance from the construction site Kai Tak Sports Park at night. - Please be advised to implement practicable mitigation measures at your construction site to minimize the environmental nuisance arising from the construction work.	1. Power Mechanical Equipment with Quality Power Mechanical Equipment (QPME) labels were used at site to lower the noise nuisance to the nearby residents. 2. Subcontractors had been reminded to observe the Construction Noise Permit for working at night during regular subcontractor meetings. 3. A memo to all subcontractors has been issued in August 2024 with the latest Construction	4 Oct 2024

Date of Notification from EPD	Date of Complaint	Description of Complaint	Recommendations / Actions	Close-Out Date / Status
			Noise Permit attached. 4. Night time inspections were conducted to ensure all Power Mechanical Equipment were switched off. 5. Implementation of construction noise mitigation measures recommended in EIA's Environmental Mitigation Implementation Schedule.	

**Notification of Summons and Successful Prosecution**

No notification of summons or prosecutions was received during the reporting period.

Statistics on notifications of summons and successful prosecutions are summarized in **Appendix L**.

## 5 Future Key Issues

### 5.1 Construction Programme for the Coming Months

As informed by the Contracted Party, the major construction activities for the next reporting period (October 2024) are summarized in **Table 5.1**.

**Table 5.1: Construction Activities for the Next Reporting Period**

Site Area	Description of Activities
● Kai Tak Sports Park	<ul style="list-style-type: none"><li>● Mobilization and lifting;</li><li>● Concreting;</li><li>● Excavation;</li><li>● Landscape work</li></ul>
● Hotel and Office Development	● N/A**

\*\*Note:

According to the Project Architect and Contractor of the Hotel and Office Development, the construction works at Hotel and Office Development area have been substantially completed and the Hotel area has been handed over to the developer on 25 September 2024.

Termination of EM&A site inspection at Hotel and Office Development area was proposed by ET and IEC and pending approval from EPD.

The tentative schedule for weekly site inspection and monitoring for air quality and noise for the next reporting period is provided in **Appendix E**.

## 6 Conclusions

### 6.1 Conclusions

#### General

The construction works for the Project commenced on 8 April 2019.

The ET of the Project has implemented the air quality and noise environmental impact monitoring under the construction phase EM&A programme during the reporting period.

#### Breaches of Action and Limit Levels

##### *Air Quality*

No Action or Limit Level exceedances of 1-hour TSP level was recorded during the reporting period.

##### *Noise*

One noise-related complaint was recorded during the reporting month. One Action Level exceedance for noise was triggered during the reporting month.

Three Limit Levels exceedance for noise levels were recorded at NMS1-T2 and one Limit Level exceedance for noise level was recorded at NMS4 during the reporting month. Exceedance investigations were conducted and summarised in **Appendix M**.

#### Environmental Site Inspections

Environmental site inspections were carried out four times during the reporting period. Recommendations on remedial actions were given to the Contracted Party for the deficiencies identified during the site inspections.

#### Complaints


There was one complaint received in relation to the environmental impact during the reporting period. Complaint investigation was conducted and summarised in **Appendix N**.

#### Notifications of Summons and Successful Prosecutions

There were no notifications of summons or prosecutions received during the reporting period.

# Figures



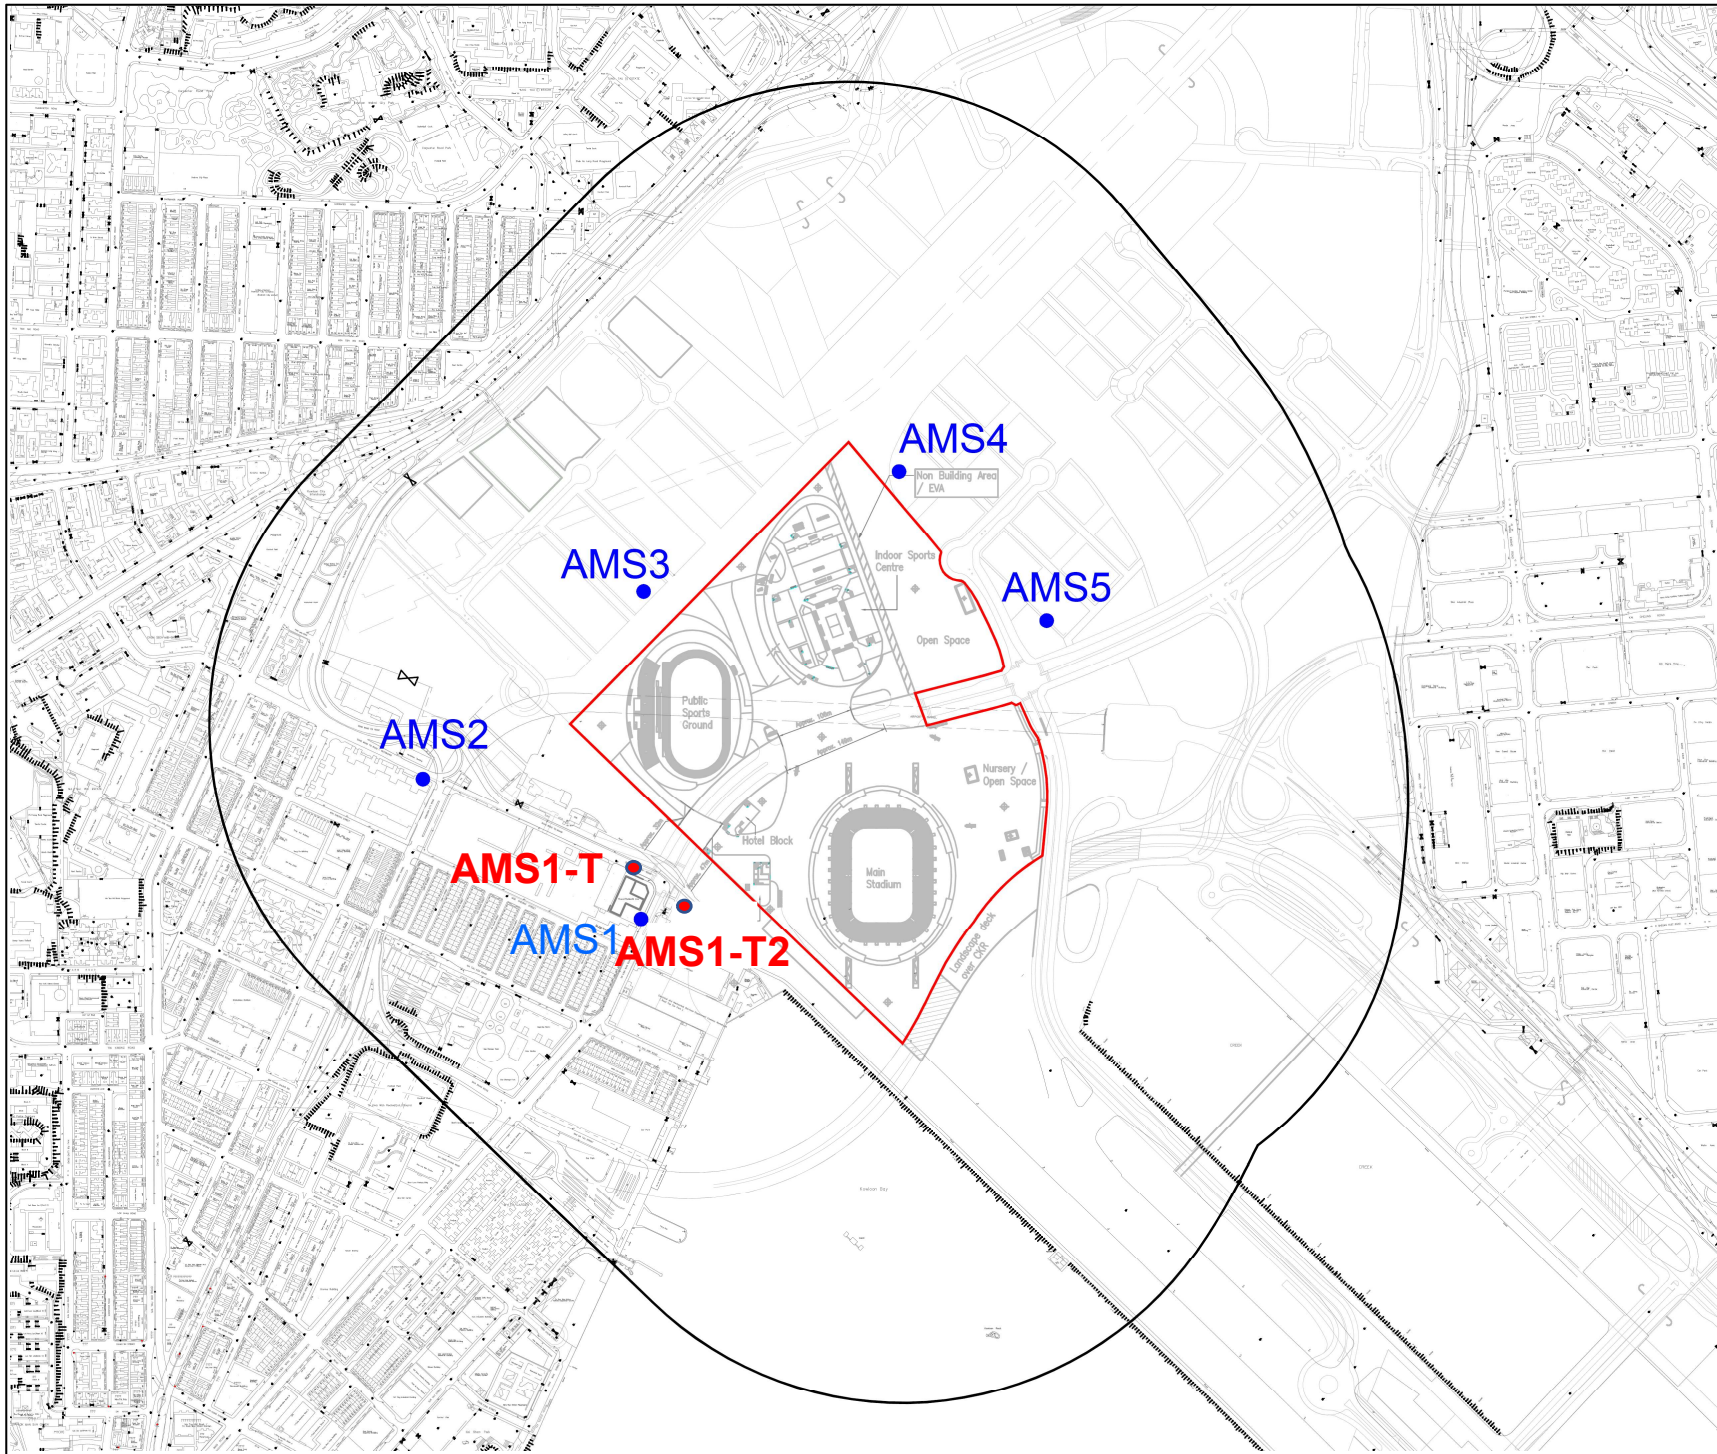

Key Plan

Notes:

1. ALL LEVELS ARE METRES TO PRINCIPAL DATUM (PD) UNLESS NOTED OTHERWISE.
2. ALL CO-ORDINATES REFER TO HONG KONG 1980 METRIC GRID CO-ORDINATE SYSTEM.
3. PIPE AND BOX CULVERT SIZES ARE SHOWN IN MILLIMETERS

Key to symbols:

**LEGEND:**

- Project Site
- 500m from Site Boundary
- AMS1 Air Monitoring Station 1
- AMS1-T Temporary Air Monitoring Station

Rev	Date	Drawn	Description	Chk'd	App'd

**M M**  
**MOTT MACDONALD**

3/F, Mapletree Bay Point  
348 Kowloon Tong Road  
Kowloon, Kowloon  
Hong Kong  
T +852 2828 5757  
F +852 2827 1824  
W mottmac.com


Client

Project

Title

**Figure 2.1  
Location of Air Quality  
Monitoring Stations**

Designed		Eng check	
Drawn		Coordination	
Dwg check		Approved	
Scale at A3	Status	Rev	
Drawing Number			

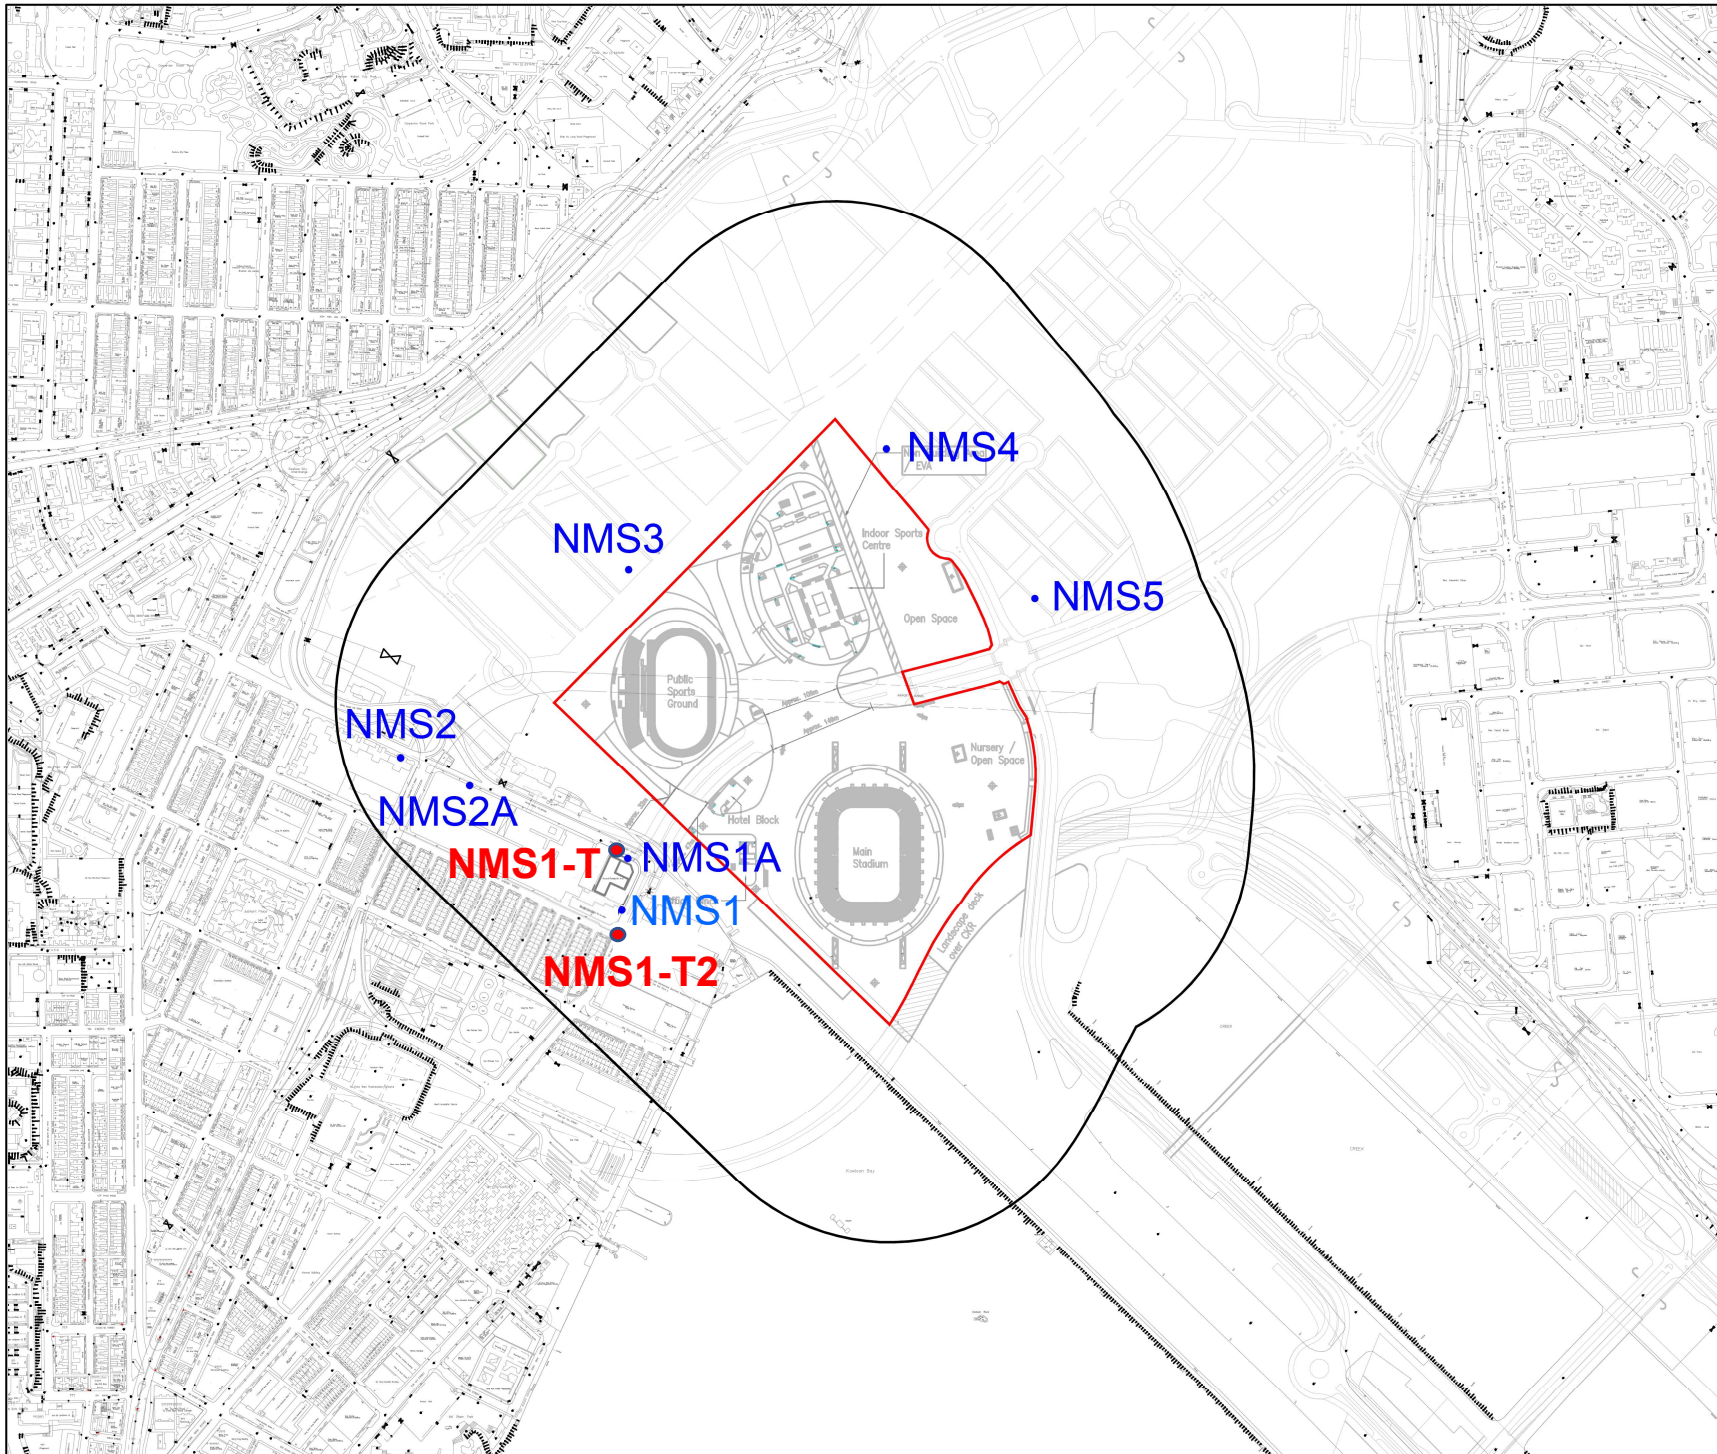

Key Plan

Notes:

1. ALL LEVELS ARE METRES TO PRINCIPAL DATUM (PD) UNLESS NOTED OTHERWISE.
2. ALL CO-ORDINATES REFER TO HONG KONG (1980) METRIC GRID CO-ORDINATES SYSTEM.
3. PIPE AND BOX CULVERT SIZES ARE SHOWN IN MILLIMETERS

Key to symbols:

**LEGEND:**

- Project Site
- 300m from Site Boundary
- **NMS1** Construction Noise Monitoring Station 1
- **NMS1-T** Temporary Noise Monitoring Station

Rev	Date	Drawn	Description	Chk'd	App'd

**M M**  
**MOTT MACDONALD**

3/F Mapletree Bay Point  
348 Kwan Tong Road  
Kowloon  
Hong Kong  
T +852 2828 5757  
F +852 2827 1828  
W mottmac.com

Client

Project


Title  
**Figure 3.1  
Location of Noise Monitoring Stations**

Designed		Eng check	
Drawn		Consultation	
Dwg check		Approved	
Scale at A3	Status	Rev	
Drawing Number			

# Appendix A. Project Organization for Environmental Works



## Appendix B. Location of Works Areas

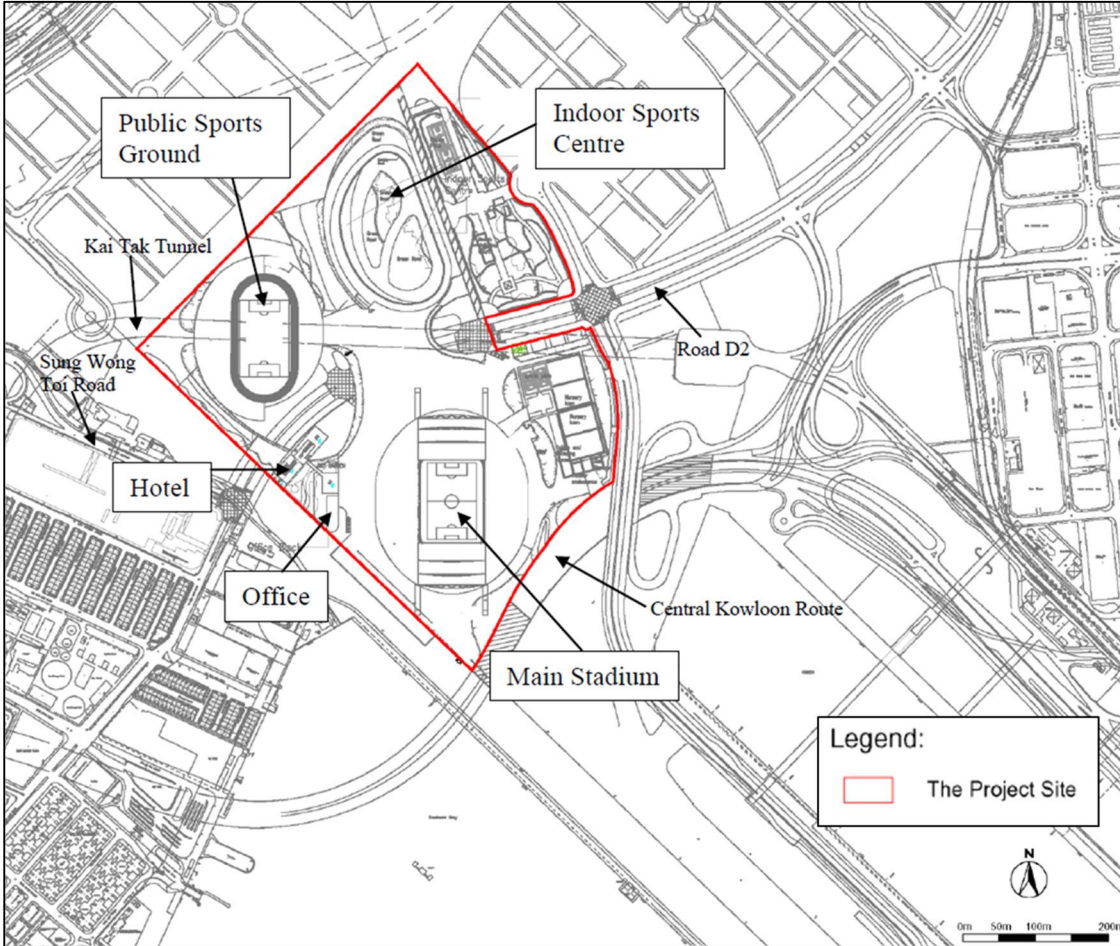

## Appendix C. Construction Programme



# Appendix D. Event and Action Plan

Should non-compliance of the air quality criteria occur, actions in accordance with the Event and Action Plan in **Table D.1** and **Table D.2** shall be carried out.

**Table D.1: Event and Action Plan for Construction Air Quality (Action Level)**

Event	Action			
	ET	IEC	SOR	Contracted Party
<b>Action Level</b>				
Exceedance for one sample	1. Inform IEC, SOR and Contracted Party; 2. Identify source, investigate the causes of exceedance and propose remedial measures; 3. Repeat measurement to confirm finding.	1. Check monitoring data submitted by ET; 2. Check Contracted Party's working method.	1. Notify Contracted Party.	1. Rectify any unacceptable practice; 2. Amend working methods if appropriate.
Exceedance for two or more consecutive samples	1. Inform IEC, SOR and Contracted Party; 2. Identify source; 3. Advise the SOR on the effectiveness of the proposed remedial measures; 4. Repeat measurements to confirm findings; 5. Increase monitoring frequency to daily; 6. Discuss with IEC, SOR and Contracted Party on remedial actions required; 7. If exceedance continues, arrange meeting with IEC and SOR; 8. If exceedance stops, cease additional monitoring.	1. Check monitoring data submitted by ET; 2. Check Contracted Party's working method; 3. Discuss with ET and Contracted Party on possible remedial measures; 4. Advise the ET/SOR on the effectiveness of the proposed remedial measures; 5. Supervise Implementation of remedial measures.	1. Confirm receipt of notification of failure in writing; 2. Notify Contracted Party; 3. Ensure remedial measures properly implemented.	1. Submit proposals for remedial to SOR and IEC within 3 working days of notification; 2. Implement the agreed proposals; 3. Amend proposal if appropriate.



**Table D.2: Event and Action Plan for Construction Air Quality (Limit Level)**

Event	Action			
	ET	IEC	SOR	Contracted Party
<b>Limit Level</b>				
Exceedance for one sample	<ol style="list-style-type: none"> <li>1. Inform IEC, SOR, Contracted Party and EPD;</li> <li>2. Identify source, investigate the causes of exceedance and propose remedial measures;</li> <li>3. Repeat measurement to confirm finding;</li> <li>4. Increase monitoring frequency to daily;</li> <li>5. Assess effectiveness of Contracted Party's remedial actions and keep IEC, EPD and SOR informed of the results.</li> </ol>	<ol style="list-style-type: none"> <li>1. Check monitoring data submitted by ET;</li> <li>2. Check Contracted Party's working method;</li> <li>3. Discuss with ET and Contracted Party on possible remedial measures;</li> <li>4. Advise the SOR on the effectiveness of the proposed remedial measures;</li> <li>5. Supervise implementation of remedial measures.</li> </ol>	<ol style="list-style-type: none"> <li>1. Confirm receipt of notification of failure in writing;</li> <li>2. Notify Contracted Party;</li> <li>3. Ensure remedial measures properly implemented.</li> </ol>	<ol style="list-style-type: none"> <li>1. Take immediate action to avoid further exceedance;</li> <li>2. Discuss with ET and IEC on remedial actions;</li> <li>3. Submit proposals for remedial actions to IEC within 3 working days of notification;</li> <li>4. Implement the agreed proposals;</li> <li>5. Amend proposal if appropriate.</li> </ol>
Exceedance for two or more consecutive samples	<ol style="list-style-type: none"> <li>1. Notify IEC, SOR, Contracted Party and EPD;</li> <li>2. Identify source;</li> <li>3. Repeat measurement to confirm findings;</li> <li>4. Increase monitoring frequency to daily;</li> <li>5. Carry out analysis of Contracted Party's working procedures to determine possible mitigation to be implemented;</li> <li>6. Arrange meeting with IEC and SOR and Contracted Party to discuss the remedial actions to be taken;</li> <li>7. Assess effectiveness of Contracted Party's remedial actions and keep IEC, EPD and SOR informed of the results;</li> <li>8. If exceedance stops, cease additional monitoring.</li> </ol>	<ol style="list-style-type: none"> <li>1. Check monitoring data submitted by ET;</li> <li>2. Check Contracted Party's working method;</li> <li>3. Discuss amongst SOR, ET, and Contracted Party on the potential remedial actions;</li> <li>4. Review Contracted Party's remedial actions whenever necessary to assure their effectiveness and advise the SOR accordingly;</li> <li>5. Supervise the implementation of remedial measures.</li> </ol>	<ol style="list-style-type: none"> <li>1. Confirm receipt of notification of failure in writing;</li> <li>2. Notify Contracted Party; 3. In consultation with the IEC, agree with the Contracted Party on the remedial measures to be implemented;</li> <li>4. Ensure remedial measures properly implemented;</li> <li>5. If exceedance continues, consider what portion of the work is responsible and instruct the Contracted Party to terminate that portion of work until the exceedance ceases.</li> </ol>	<ol style="list-style-type: none"> <li>1. Take immediate action to avoid further exceedance;</li> <li>2. Discuss with ET and IEC on remedial actions;</li> <li>3. Submit proposals for remedial actions to SOR and IEC within 3 working days of notification;</li> <li>4. Implement the agreed proposals;</li> <li>5. Resubmit proposals if problem still not under control;</li> <li>6. Stop the relevant portion of works as determined by the SOR until the exceedance ceases.</li> </ol>

Should non-compliance of the noise criteria occur, actions in accordance with the Event and Action Plan in **Table D.3** shall be carried out.

**Table D.3: Event and Action Plan for Construction Noise**

Event	Action			
	ET	IEC	SOR	Contracted Party
<b>Action Level</b>	1. Notify IEC, SOR and Contracted Party of exceedance; 2. Identify source; 3. Investigate the causes of exceedance and propose remedial measures; 4. Report the results of investigation to the IEC, SOR and Contracted Party; 5. Discuss with the IEC, SOR and Contracted Party and formulate remedial measures; 6. Increase monitoring frequency to check mitigation effectiveness.	1. Review the analysed results submitted by the ET; 2. Review the proposed remedial measures by the Contracted Party and advise the SOR accordingly; 3. Supervise the implementation of remedial measures.	1. Confirm receipt of notification of failure in writing; 2. Notify Contracted Party; 3. Require Contracted Party to propose remedial measures for the analysed noise problem; 4. Ensure remedial measures are properly implemented	1. Submit noise mitigation proposals to SOR with copy to ET and IEC; 2. Implement noise mitigation proposals.
<b>Limit Level</b>	1. Inform IEC, SOR, EPD and Contracted Party; 2. Identify source; 3. Repeat measurements to confirm findings; 4. Increase monitoring frequency; 5. Carry out analysis of Contracted Party's working procedures to determine possible mitigation to be implemented; 6. Inform IEC, SOR and EPD the causes and actions taken for the exceedances; 7. Assess effectiveness of Contracted Party's remedial actions and keep IEC, EPD and SOR informed of the results; 8. If exceedance stops, cease additional monitoring.	1. Discuss amongst SOR, ET, and Contracted Party on the potential remedial actions; 2. Review Contracted Party's remedial actions whenever necessary to assure their effectiveness and advise the SOR accordingly; 3. Supervise the implementation of remedial measures.	1. Confirm receipt of notification of failure in writing; 2. Notify Contracted Party; 3. Require Contracted Party to propose remedial measures for the analysed noise problem; 4. Ensure remedial measures are properly implemented; 5. If exceedance continues, investigate what portion of the work is responsible and instruct the Contracted Party to terminate that portion of work until the exceedance ceases.	1. Take immediate action to avoid further exceedance; 2. Submit proposals for remedial actions to SOR with copy to ET and IEC within 3 working days of notification; 3. Implement the agreed proposals; 4. Resubmit proposals if problem still not under control; 5. Terminate the relevant portion of works as determined by the SOR until the exceedance ceases.

# Appendix E. Environmental Site Inspection and Monitoring Schedule

**Table E.1: Site Inspection and Monitoring Schedule for September 2024**

**Impact Environmental Monitoring Schedule for September 2024**

Sun	Mon	Tue	Wed	Thu	Fri	Sat
1	2	3	4 site inspection landscape and visual audit AMS1-T2, AMS2, AMS4 NMS1-T2, NMS2, NMS4	5	6	7
8	9	10 AMS1-T2, AMS2, AMS4 NMS1-T2, NMS2, NMS4	11 site inspection	12	13	14
15	16 AMS1-T2, AMS2, AMS4 NMS1-T2, NMS2, NMS4	17	18 The day following the Chinese Mid-Autumn Festival	19 site inspection landscape and visual audit	20 AMS1-T2, AMS2, AMS4	21
22	23	24 site inspection	25	26 AMS1-T2, AMS2, AMS4 NMS1-T2, NMS2, NMS4	27	28
29	30					

 Air Quality/Noise Monitoring

Remark: Joint site walk with IEC on 11 and 24 September 2024.

**Table E.2: Tentative Site Inspection and Monitoring Schedule for October 2024**

**Tentative Impact Environmental Monitoring Schedule for October 2024**

Sun	Mon	Tue	Wed	Thu	Fri	Sat
		1 National Day	2 site inspection AMS1-T2, AMS2, AMS4 NMS1-T2, NMS2, NMS4	3	4	5
6	7	8 AMS1-T2, AMS2, AMS4 NMS1-T2, NMS2, NMS4	9 site inspection landscape and visual audit	10	11 Chung Yeung Festival	12
13	14 AMS1-T2, AMS2, AMS4 NMS1-T2, NMS2, NMS4	15	16 site inspection	17	18 AMS1-T2, AMS2, AMS4	19
20	21	22	23 site inspection landscape and visual audit	24 AMS1-T2, AMS2, AMS4 NMS1-T2, NMS2, NMS4	25	26
27	28	29	30 site inspection AMS1-T2, AMS2, AMS4 NMS1-T2, NMS2, NMS4	31		

 Air Quality/Noise Monitoring

Remark: The schedule is subject to change due to unforeseeable circumstances (e.g. adverse weather, etc)

## Appendix F. Calibration Certificates



### SUB-CONTRACTING REPORT

CONTACT	: MR MAGNUM FAN	WORK ORDER	: HK2351432
CLIENT	: ENVIROTECH SERVICES CO.		
ADDRESS	: RM 712, 7/F, MY LOFT 9 HOI WING ROAD, TUEN MUN, N.T. HK	SUB-BATCH	: 1
		DATE RECEIVED	: 18-DEC-2023
		DATE OF ISSUE	: 27-DEC-2023
PROJECT	: ----	NO. OF SAMPLES	: 1
		CLIENT ORDER	: ----

#### General Comments

- Sample information (Project name, Sample ID, Sampling date/time, etc.) is provided by client.
- Result(s) of sample(s) is/are reported on as received basis, unless otherwise specified. The result(s) is/are related only to the item(s) tested.
- Calibration was subcontracted to Envirotech Services Company.
- Sample(s) was/ were submitted by client. Sample(s) arrived laboratory in ambient condition.

#### Signatories

This document has been signed by those names that appear on this report and are the authorised signatories

Signatories

Position

Richard Fung

Managing Director

This report supersedes any previous report(s) with the same work order number.

All pages of this report have been checked and approved for release.

**ALS Technichem (HK) Pty Ltd**  
Part of the **ALS Laboratory Group**

11/F, Chung Shun Knitting Centre 1 - 3 Wing Yip Street Kwai Chung N.T. Hong Kong  
Tel. +852 2610 1044 Fax +852 2610 2021 www.alsglobal.com

WORK ORDER : HK2351432  
SUB-BATCH : 1  
CLIENT : ENVIROTECH SERVICES CO.  
PROJECT : ----



ALS Lab ID	Client's Sample ID	Sample Type	Sample Date	External Lab Report No.
HK2351432-001	Sibata LD-3B (235780)	Equipments	09-Dec-2023	S/N: 235780



Equipment Verification Report (TSP)

Equipment Calibrated:

Type: Laser Dust Monitor  
Manufacturer: Sibata LD-3B  
Serial No.: 235780  
Equipment Ref.: N/A  
ALS Job Order: HK2349963

Standard Equipment

Standard Equipment: High Volume Sampler (TSP)  
Location: Envirotech Room (Calibration Room)  
Equipment Ref.: HVS 8162  
Last Calibration Date: 13-Oct-2023


Equipment Verification Results:

Verification Date: 9-Dec-2023

Hour	Time	Mean Temp °C	Mean Pressure (hpa)	Concentration in µg/m³ (Standard Equipment) Y( axis)	Concentration in µg/m³ (Calibrated Equipment) x( axis)
1hr 00mins	1010-1110	26.5	1016.0	112	88
2hr 00mins	1300-1500	26.2	1015.5	165	135
3hr 00mins	1505-1805	26.2	1015.5	300	215

Linear Regression of Y or X

Slope (K-factor): 1.3803(µg/m³)/CPM  
Correlation Coefficient (R): 0.9960  
Date of Issue: 15-Dec-2023

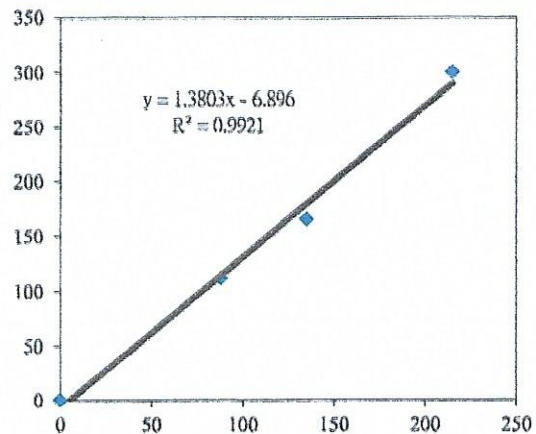

Remarks:

- 1. Strong Correlation (>0.8)
- 2. Factor 1.3803 (µg/m³)/CPM should be applied for TSP monitoring

\*If R<0.5, repair or verification is required for the equipment

Operator: P.F.Yeung Signature *PfY* Date: 15 December 2023

QC Reviewer: K.F.Ho Signature *KfH* Date: 15 December 2023





---

### SUB-CONTRACTING REPORT

---

CONTACT	: MR MAGNUM FAN	WORK ORDER	: HK2419604
CLIENT	: ENVIROTECH SERVICES CO.		
ADDRESS	: RM 712, 7/F, MY LOFT 9 HOI WING ROAD, TUEN MUN, N.T. HK	SUB-BATCH	: 1
		DATE RECEIVED	: 20-MAY-2024
		DATE OF ISSUE	: 24-MAY-2024
PROJECT	: ----	NO. OF SAMPLES	: 1
		CLIENT ORDER	: ----

---

#### General Comments

- Sample Information (Project name, Sample ID, Sampling date/time, etc.) is provided by client.
  - Result(s) of sample(s) is/are reported on as received basis, unless otherwise specified. The result(s) is/are related only to the item(s) tested.
  - Sample(s) was/ were submitted by client. Sample(s) arrived laboratory in ambient condition.
  - Calibration was subcontracted to Envirotech Services Company.
- 

#### Signatories

This document has been signed by those names that appear on this report and are the authorised signatories

Signatories

Position

Richard Fung

Managing Director

---

---

This report supersedes any previous report(s) with the same work order number.

All pages of this report have been checked and approved for release.

**ALS Technichem (HK) Pty Ltd**  
Part of the **ALS Laboratory Group**

11/F, Chung Shun Knitting Centre 1 - 3 Wing Yip Street Kwai Chung N.T. Hong Kong  
Tel. +852 2610 1044 Fax +852 2610 2021 www.alsglobal.com

WORK ORDER : HK2419604  
SUB-BATCH : 1  
CLIENT : ENVIROTECH SERVICES CO.  
PROJECT : ----



ALS Lab ID	Client's Sample ID	Sample Type	Sample Date	External Lab Report No.
HK2419604-001	Sibata LD-3B (235786)	Equipments	11-May-2024	S/N: 235786

----- END OF REPORT -----



Equipment Verification Report (TSP)

Equipment Calibrated:

Type: Laser Dust Monitor  
Manufacturer: Sibata LD-3B  
Serial No.: 235786  
Equipment Ref.: N/A  
ALS Job Order: HK2418944

Standard Equipment

Standard Equipment: High Volume Sampler (TSP)  
Location: Envirotech Room (Calibration Room)  
Equipment Ref.: HVS 8162  
Last Calibration Date: 25-Mar-2024


Equipment Verification Results:

Verification Date: 11-May-2024

Hour	Time	Mean Temp °C	Mean Pressure (hpa)	Concentration in µg/m³ (Standard Equipment) (Y-Axis)	Concentration in µg/m³ (Calibrated Equipment) (X-Axis)
1hr 00mins	0830-0930	26.8	1015	34	28
2hr 00mins	0935-1135	28.5	1015	53	48
3hr 00mins	1310-1610	29.5	1016	133	105

Linear Regression of Y or X

Slope (K-factor): 1.2673(µg/m³)/CPM  
Correlation Coefficient (R): 0.9978  
Date of Issue: 19-May-2024

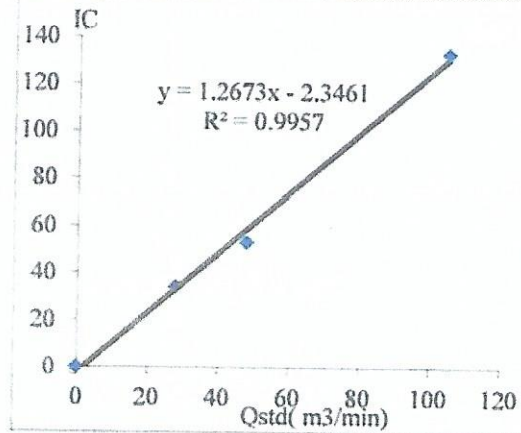

Remarks:

- 1. Strong Correlation (>0.8)
- 2. Factor 1.2673(µg/m³)/CPM should be applied for TSP monitoring

\*If R<0.5, repair or verification is required for the equipment

Operator: P.F.Yeung Signature Tai Date: 19 May 2024

QC Reviewer: K.F.Ho Signature Ho Date: 19 May 2024



---

### SUB-CONTRACTING REPORT

---

CONTACT	: MR MAGNUM FAN	WORK ORDER	: HK2412745
CLIENT	: ENVIROTECH SERVICES CO.		
ADDRESS	: RM 712, 7/F, MY LOFT 9 HOI WING ROAD, TUEN MUN, N.T. HK	SUB-BATCH	: 1
		DATE RECEIVED	: 5-APR-2024
		DATE OF ISSUE	: 12-APR-2024
PROJECT	: ----	NO. OF SAMPLES	: 1
		CLIENT ORDER	: ----

---

#### General Comments

- Sample Information (Project name, Sample ID, Sampling date/time, etc.) is provided by client.
  - Result(s) of sample(s) is/are reported on as received basis, unless otherwise specified. The result(s) is/are related only to the item(s) tested.
  - Sample(s) was/ were submitted by client. Sample(s) arrived laboratory in ambient condition.
  - Calibration was subcontracted to Envirotech Services Company.
- 

#### Signatories

This document has been signed by those names that appear on this report and are the authorised signatories

Signatories

Position

Richard Fung

Managing Director

---

---

This report supersedes any previous report(s) with the same work order number.

All pages of this report have been checked and approved for release.

**ALS Technichem (HK) Pty Ltd**  
Part of the **ALS Laboratory Group**

11/F, Chung Shun Knitting Centre 1 - 3 Wing Yip Street Kwai Chung N.T. Hong Kong  
Tel. +852 2610 1044 Fax +852 2610 2021 www.alsglobal.com

WORK ORDER : HK2412745  
SUB-BATCH : 1  
CLIENT : ENVIROTECH SERVICES CO.  
PROJECT : ---



ALS Lab ID	Client's Sample ID	Sample Type	Sample Date	External Lab Report No.
HK2412745-001	Sibata LD-3B (6Z7784)	Equipments	25-Mar-2024	S/N: 6Z7784



Equipment Verification Report (TSP)

Equipment Calibrated:

Type: Laser Dust Monitor  
Manufacturer: Sibata LD-3B  
Serial No.: 6Z7784  
Equipment Ref.: N/A  
ALS Job Order: HK2411837

Standard Equipment

Standard Equipment: High Volume Sampler (TSP)  
Location: Envirotech Room (Calibration Room)  
Equipment Ref.: HVS 8162  
Last Calibration Date: 25-Mar-2024


Equipment Verification Results:

Verification Date: 25-Mar-2024

Hour	Time	Mean Temp °C	Mean Pressure (hpa)	Concentration in µg/m³ (Standard Equipment) (Y-Axis)	Concentration in µg/m³ (Calibrated Equipment) (X-Axis)
1hr 00mins	0900-1000	24.5	1016	94	62
2hr 00mins	1005-1205	26.2	1017	119	122
3hr 00mins	1315-1615	29.0	1014	244	216

Linear Regression of Y or X

Slope (K-factor): 1.0775(µg/m³)/CPM  
Correlation Coefficient (R): 0.9859  
Date of Issue: 5-Apr-2024

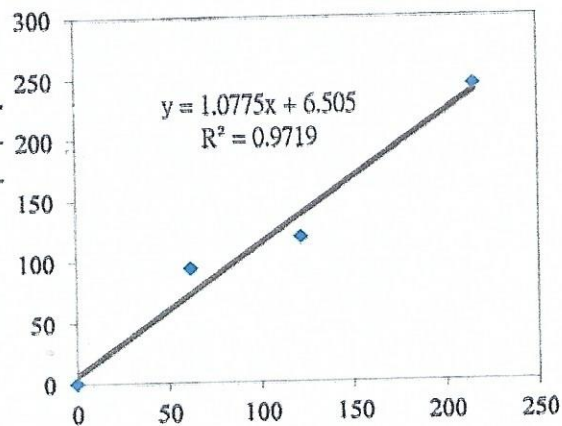

Remarks:

1. Strong Correlation (>0.8)
2. Factor 1.0775 (µg/m³)/CPM should be applied for TSP monitoring

\*If R<0.5, repair or verification is required for the equipment

Operator: P.F.Yeung Signature Fai Date: 05 April 2024

QC Reviewer: K.F.Ho Signature ab Date: 05 April 2024



# Certificate of Calibration 校正證書

Certificate No. : C242738  
證書編號

ITEM TESTED / 送檢項目 (Job No. / 序引編號 : IC24-0781)

Date of Receipt / 收件日期 : 3 May 2024

Description / 儀器名稱 : Precision Acoustic Calibrator  
Manufacturer / 製造商 : LARSON DAVIS  
Model No. / 型號 : CAL200  
Serial No. / 編號 : 11334  
Supplied By / 委託者 : Envirotech Services Co.  
Room 712, 7/F, My Loft, 9 Hoi Wing Road, Tuen Mun,  
New Territories, Hong Kong

## TEST CONDITIONS / 測試條件

Temperature / 溫度 :  $(23 \pm 2)^{\circ}\text{C}$   
Line Voltage / 電壓 : ---

Relative Humidity / 相對濕度 :  $(50 \pm 25)\%$

## TEST SPECIFICATIONS / 測試規範


Calibration check

DATE OF TEST / 測試日期 : 19 May 2024

## TEST RESULTS / 測試結果

The results apply to the particular unit-under-test only.  
The results do not exceed specified limits.  
These limits refer to manufacturer's published or user's specified tolerances as requested by the customer.  
The results are detailed in the subsequent page(s).


The test equipment used for calibration are traceable to National Standards via :  
- The Government of The Hong Kong Special Administrative Region Standard & Calibration Laboratory  
- Hottinger Brüel & Kjær Calibration Laboratory, Denmark  
- Agilent Technologies / Keysight Technologies  
- Fluke Everett Service Center, USA

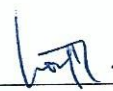Tested By :   
測試 : H T Wong  
Assistant Engineer

Certified By :   
核證 : K C Lee  
Engineer

Date of Issue : 20 May 2024  
簽發日期

The test equipment used for calibration is traceable to the National Standards as specified in this certificate. This certificate shall not be reproduced except in full, without the prior written approval of this laboratory.  
本證書所載校正用之測試器材均可溯源至國際標準。局部複印本證書需先獲本實驗室書面批准。

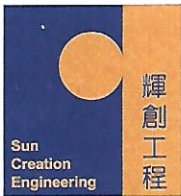

# Certificate of Calibration

## 校正證書

Certificate No. : C242738  
證書編號

- The unit-under-test (UUT) was allowed to stabilize in the laboratory for over 12 hours before the commencement of the test.
- The results presented are the mean of 3 measurements at each calibration point.
- Test equipment :

<u>Equipment ID</u>	<u>Description</u>	<u>Certificate No.</u>
CL130	Universal Counter	C233799
CL281	Multifunction Acoustic Calibrator	CDK2302738
TST150A	Measuring Amplifier	C241879

- Test procedure : MA100N.

- Results :

### 5.1 Sound Level Accuracy

UUT Nominal Value	Measured Value (dB)	User's Limit (dB)	Uncertainty of Measured Value (dB)
94 dB, 1 kHz	93.60	± 0.5	± 0.20
114 dB, 1 kHz	113.60		

### 5.2 Frequency Accuracy

UUT Nominal Value (kHz)	Measured Value (kHz)	Mfr's Limit	Uncertainty of Measured Value (Hz)
1	1.000	1 kHz ± 1 %	± 1

Remarks : - The user's limit is a customer pre-defined operating tolerance of the UUT, suitable for one's own intended use.

- The uncertainties are for a confidence probability of not less than 95 %.

Note :


Only the original copy or the laboratory's certified true copy is valid.

The values given in this Certificate only relate to the values measured at the time of the test and any uncertainties quoted will not include allowance for the equipment long term drift, variations with environment changes, vibration and shock during transportation, overloading, mis-handling, or the capability of any other laboratory to repeat the measurement. Sun Creation Engineering Limited shall not be liable for any loss or damage resulting from the use of the equipment.

The test equipment used for calibration is traceable to the National Standards as specified in this certificate. This certificate shall not be reproduced except in full, without the prior written approval of this laboratory.

本證書所載校正用之測試器材均可溯源至國際標準。局部複印本證書需先獲本實驗室書面批准。



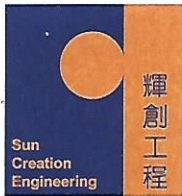

# Certificate of Calibration

## 校正證書

Certificate No. : C237046  
證書編號

ITEM TESTED / 送檢項目 (Job No. / 序引編號 : IC23-2316) Date of Receipt / 收件日期 : 15 November 2023

Description / 儀器名稱 : Sound Level Meter  
Manufacturer / 製造商 : Rion  
Model No. / 型號 : NL-52  
Serial No. / 編號 : 00175561  
Supplied By / 委託者 : Envirotech Services Co.  
Room 712, 7/F, My Loft, 9 Hoi Wing Road, Tuen Mun,  
New Territories, Hong Kong

### TEST CONDITIONS / 測試條件

Temperature / 溫度 :  $(23 \pm 2)^{\circ}\text{C}$  Relative Humidity / 相對濕度 :  $(50 \pm 25)\%$   
Line Voltage / 電壓 : ---

### TEST SPECIFICATIONS / 測試規範


Calibration check

DATE OF TEST / 測試日期 : 6 December 2023

### TEST RESULTS / 測試結果

The results apply to the particular unit-under-test only.  
The results do not exceed specified limits.  
These limits refer to manufacturer's published tolerances as requested by the customer.  
The results are detailed in the subsequent page(s).

The test equipment used for calibration are traceable to National Standards via :  
- The Government of The Hong Kong Special Administrative Region Standard & Calibration Laboratory  
- Hottinger Brüel & Kjær Calibration Laboratory, Denmark  
- Agilent Technologies / Keysight Technologies  
- Fluke Everett Service Center, USA

Tested By :   
測試 : C K Lo  
Project Engineer

Certified By :   
核證 : K Q Lee  
Engineer

Date of Issue : 6 December 2023  
簽發日期

The test equipment used for calibration is traceable to the National Standards as specified in this certificate. This certificate shall not be reproduced except in full, without the prior written approval of this laboratory.

本證書所載校正用之測試器材均可溯源至國際標準。局部複印本證書需先獲本實驗所書面批准。

# Certificate of Calibration

## 校正證書

Certificate No. : C237046  
證書編號

- The unit-under-test (UUT) was allowed to stabilize in the laboratory for over 12 hours, and switched on to warm up for over 10 minutes before the commencement of the test.
- Self-calibration was performed before the test.
- The results presented are the mean of 3 measurements at each calibration point.
- Test equipment :

Equipment ID	Description	Certificate No.
CL280	40 MHz Arbitrary Waveform Generator	C230306
CL281	Multifunction Acoustic Calibrator	CDK2302738

- Test procedure : MA101N.

- Results :

### 6.1 Sound Pressure Level

#### 6.1.1 Reference Sound Pressure Level

UUT Setting				Applied Value		UUT Reading (dB)	IEC 61672 Class 1 Limit (dB)
Range (dB)	Function	Frequency Weighting	Time Weighting	Level (dB)	Freq. (kHz)		
30 - 130	L <sub>A</sub>	A	Fast	94.00	1	93.2	± 1.1

#### 6.1.2 Linearity

UUT Setting				Applied Value		UUT Reading (dB)
Range (dB)	Function	Frequency Weighting	Time Weighting	Level (dB)	Freq. (kHz)	
30 - 130	L <sub>A</sub>	A	Fast	94.00	1	93.2 (Ref.)
				104.00		103.3
				114.00		113.4

IEC 61672 Class 1 Limit : ± 0.6 dB per 10 dB step and ± 1.1 dB for overall different.

### 6.2 Time Weighting

UUT Setting				Applied Value		UUT Reading (dB)	IEC 61672 Class 1 Limit (dB)
Range (dB)	Function	Frequency Weighting	Time Weighting	Level (dB)	Freq. (kHz)		
30 - 130	L <sub>A</sub>	A	Fast	94.00	1	93.2	Ref.
			Slow			93.2	± 0.3

The test equipment used for calibration is traceable to the National Standards as specified in this certificate. This certificate shall not be reproduced except in full, without the prior written approval of this laboratory.

本證書所載校正用之測試器材均可溯源至國際標準。局部複印本證書需先獲本實驗所書面批准。

# Certificate of Calibration

## 校正證書

Certificate No. : C237046  
證書編號

### 6.3 Frequency Weighting

#### 6.3.1 A-Weighting

UUT Setting				Applied Value		UUT Reading (dB)	IEC 61672 Class 1 Limit (dB)
Range (dB)	Function	Frequency Weighting	Time Weighting	Level (dB)	Freq.		
30 - 130	L <sub>A</sub>	A	Fast	94.00	63 Hz	66.9	-26.2 ± 1.5
					125 Hz	77.0	-16.1 ± 1.5
					250 Hz	84.5	-8.6 ± 1.4
					500 Hz	89.9	-3.2 ± 1.4
					1 kHz	93.2	Ref.
					2 kHz	94.4	+1.2 ± 1.6
					4 kHz	94.2	+1.0 ± 1.6
					8 kHz	92.1	-1.1 (+2.1 ; -3.1)
					16 kHz	85.2	-6.6 (+3.5 ; -17.0)

#### 6.3.2 C-Weighting

UUT Setting				Applied Value		UUT Reading (dB)	IEC 61672 Class 1 Limit (dB)
Range (dB)	Function	Frequency Weighting	Time Weighting	Level (dB)	Freq.		
30 - 130	L <sub>C</sub>	C	Fast	94.00	63 Hz	92.3	-0.8 ± 1.5
					125 Hz	93.0	-0.2 ± 1.5
					250 Hz	93.2	0.0 ± 1.4
					500 Hz	93.2	0.0 ± 1.4
					1 kHz	93.2	Ref.
					2 kHz	93.0	-0.2 ± 1.6
					4 kHz	92.4	-0.8 ± 1.6
					8 kHz	90.2	-3.0 (+2.1 ; -3.1)
					16 kHz	83.3	-8.5 (+3.5 ; -17.0)

The test equipment used for calibration is traceable to the National Standards as specified in this certificate. This certificate shall not be reproduced except in full, without the prior written approval of this laboratory.

本證書所載校正用之測試器材均可溯源至國際標準。局部複印本證書需先獲本實驗室所書面批准。



# Certificate of Calibration

## 校正證書

Certificate No. : C237046  
證書編號

Remarks : - UUT Microphone Model No. : UC-59 & S/N : 16651

- Mfr's Limit : IEC 61672 Class 1

- Uncertainties of Applied Value :

94 dB	: 63 Hz - 125 Hz	: ± 0.35 dB
	250 Hz - 500 Hz	: ± 0.30 dB
	1 kHz	: ± 0.20 dB
	2 kHz - 4 kHz	: ± 0.35 dB
	8 kHz	: ± 0.45 dB
	16 kHz	: ± 0.70 dB
104 dB	: 1 kHz	: ± 0.10 dB (Ref. 94 dB)
114 dB	: 1 kHz	: ± 0.10 dB (Ref. 94 dB)

- The uncertainties are for a confidence probability of not less than 95 %.

Note :

Only the original copy or the laboratory's certified true copy is valid.

The values given in this Certificate only relate to the values measured at the time of the test and any uncertainties quoted will not include allowance for the equipment long term drift, variations with environment changes, vibration and shock during transportation, overloading, mis-handling, or the capability of any other laboratory to repeat the measurement. Sun Creation Engineering Limited shall not be liable for any loss or damage resulting from the use of the equipment.

The test equipment used for calibration is traceable to the National Standards as specified in this certificate. This certificate shall not be reproduced except in full, without the prior written approval of this laboratory.

本證書所載校正用之測試器材均可溯源至國際標準。局部複印本證書需先獲本實驗室書面批准。

## **Appendix G. Monitoring Data and Graphical Plots (Air Quality and Noise)**

## Data for 1-hour TSP Monitoring at Station AMS1-T/AMS1-T2 during the Reporting Month


	Date	Start Time	Finish Time	Weather	Wind Speed (m/s)	Wind Direction (deg)	1-hour TSP ( $\mu\text{g}/\text{m}^3$ )
#	04-Sep-24	8:47	9:47	Fine	1.1	variable	44
#	04-Sep-24	9:47	10:47	Fine	0.8	253	51
#	04-Sep-24	10:47	11:47	Fine	1.4	282	52
#	10-Sep-24	8:35	9:35	Sunny	1.7	135	35
#	10-Sep-24	9:35	10:35	Sunny	3.1	129	31
#	10-Sep-24	10:35	11:35	Sunny	3.3	110	29
#	16-Sep-24	8:35	9:35	Fine	2.5	115	51
#	16-Sep-24	9:35	10:35	Fine	2.5	25	48
#	16-Sep-24	10:35	11:35	Fine	3.3	128	47
#	20-Sep-24	8:52	9:52	Fine	3.1	115	44
#	20-Sep-24	9:52	10:52	Fine	2.5	110	49
#	20-Sep-24	10:52	11:52	Fine	3.3	161	51
#	26-Sep-24	9:52	10:52	Fine	1.4	273	34
#	26-Sep-24	10:52	11:52	Fine	1.4	255	29
#	26-Sep-24	11:52	12:52	Fine	3.3	275	27

Note:

# Impact Monitoring at Station AMS1-T2.

During the reporting period, temporary monitoring station AMS1-T, was no longer accessible from 13 August 2024, due to the relocation of the Agriculture, Fisheries and Conservation Department Kowloon Animal Management Centre. Alternative temporary air quality monitoring station, AMS1-T2 was proposed by ET and agreed by IEC on 9 August 2024 and further approved by EPD on 28 August 2024 for conducting impact monitoring during the reporting period.


## Graphical Presentation for 1-hour TSP Monitoring at AMS1-T/AMS1-T2

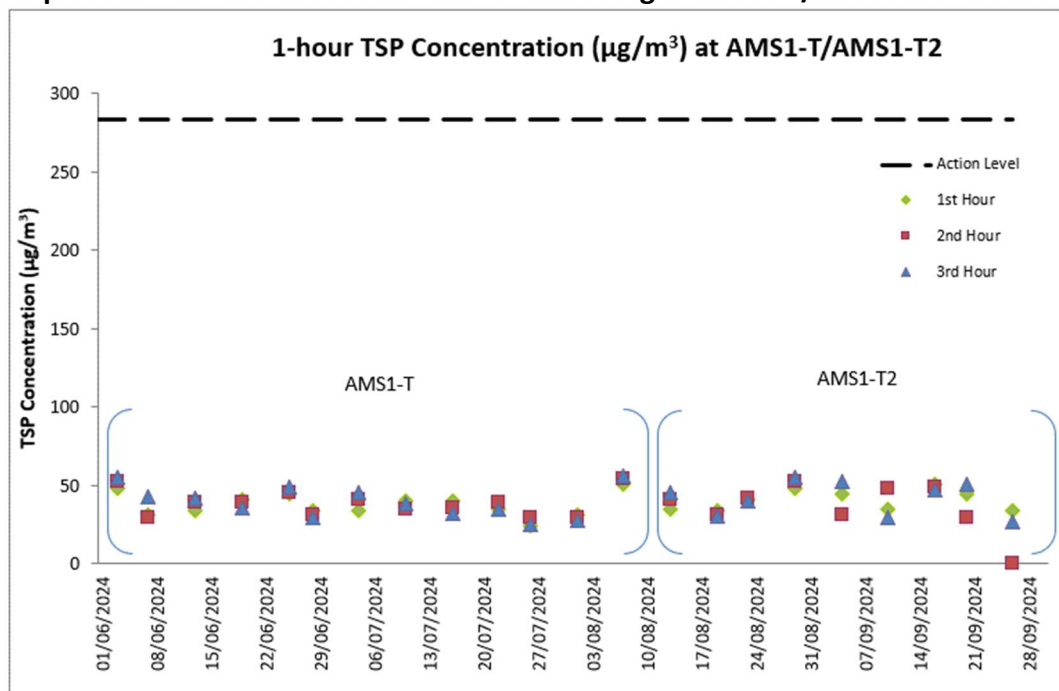

## Data for 1-hour TSP Monitoring at Station AMS2 during the Reporting Month

Date	Start Time	Finish Time	Weather	Wind Speed (m/s)	Wind Direction (deg)	1-hour TSP ( $\mu\text{g}/\text{m}^3$ )
04-Sep-24	9:32	10:32	Fine	1.4	235	45
04-Sep-24	10:32	11:32	Fine	1.4	259	49
04-Sep-24	11:32	12:32	Fine	2.2	248	51
10-Sep-24	9:21	10:21	Sunny	3.3	116	30
10-Sep-24	10:21	11:21	Sunny	3.3	124	26
10-Sep-24	11:21	12:21	Sunny	4.2	120	27
16-Sep-24	9:20	10:20	Fine	2.8	110	50
16-Sep-24	10:20	11:20	Fine	1.1	variable	42
16-Sep-24	11:20	12:20	Fine	3.3	variable	45
20-Sep-24	8:40	9:40	Fine	2.8	117	57
20-Sep-24	9:40	10:40	Fine	2.8	29	50
20-Sep-24	10:40	11:40	Fine	2.5	149	49
26-Sep-24	9:08	10:08	Fine	2.2	311	41
26-Sep-24	10:08	11:08	Fine	1.4	253	35
26-Sep-24	11:08	12:08	Fine	2.2	276	33


## Graphical Presentation for 1-hour TSP Monitoring at AMS2

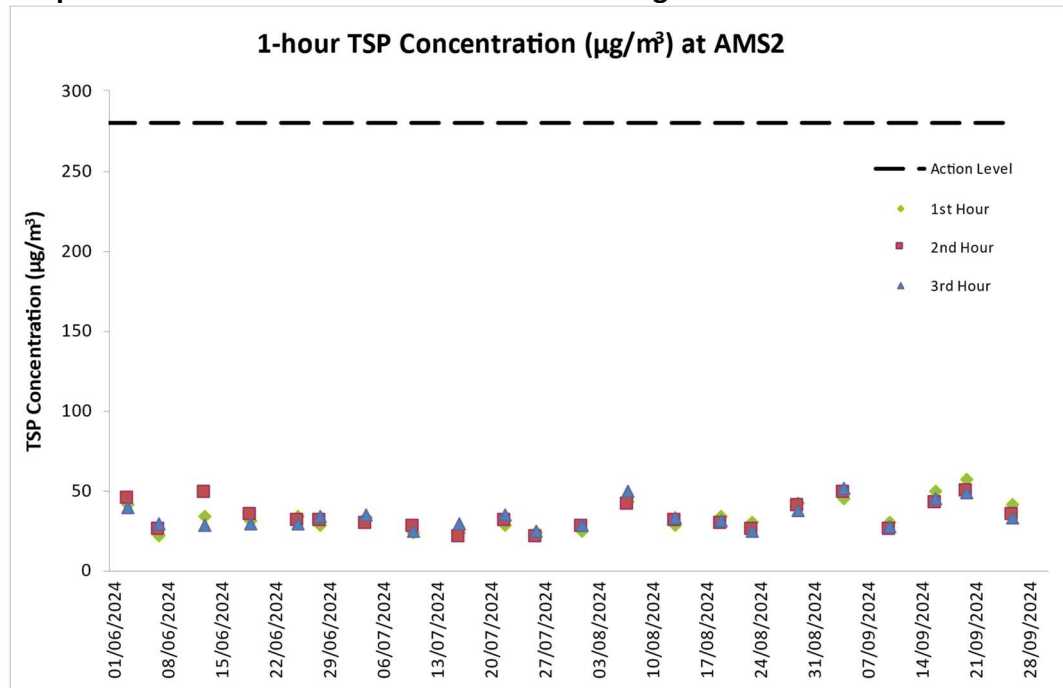

### Data for 1-hour TSP Monitoring at Station AMS4 during the Reporting Month

Date	Start Time	Finish Time	Weather	Wind Speed (m/s)	Wind Direction (deg)	1-hour TSP ( $\mu\text{g}/\text{m}^3$ )
04-Sep-24	10:37	11:37	Fine	1.7	279	42
04-Sep-24	11:37	12:37	Fine	2.5	253	43
04-Sep-24	12:37	13:37	Fine	1.7	244	38
10-Sep-24	10:25	11:25	Sunny	3.3	118	29
10-Sep-24	11:25	12:25	Sunny	4.2	117	27
10-Sep-24	12:25	13:25	Sunny	2.8	109	26
16-Sep-24	10:25	11:25	Fine	1.4	119	39
16-Sep-24	11:25	12:25	Fine	3.1	65	44
16-Sep-24	12:25	13:25	Fine	2.5	141	41
20-Sep-24	9:13	10:13	Fine	3.3	133	50
20-Sep-24	10:13	11:13	Fine	3.3	127	48
20-Sep-24	11:13	12:13	Fine	3.9	122	47
26-Sep-24	10:50	11:50	Fine	1.4	261	29
26-Sep-24	11:50	12:50	Fine	3.3	273	31
26-Sep-24	12:50	13:50	Fine	3.6	281	27

### Graphical Presentation for 1-hour TSP Monitoring at AMS4

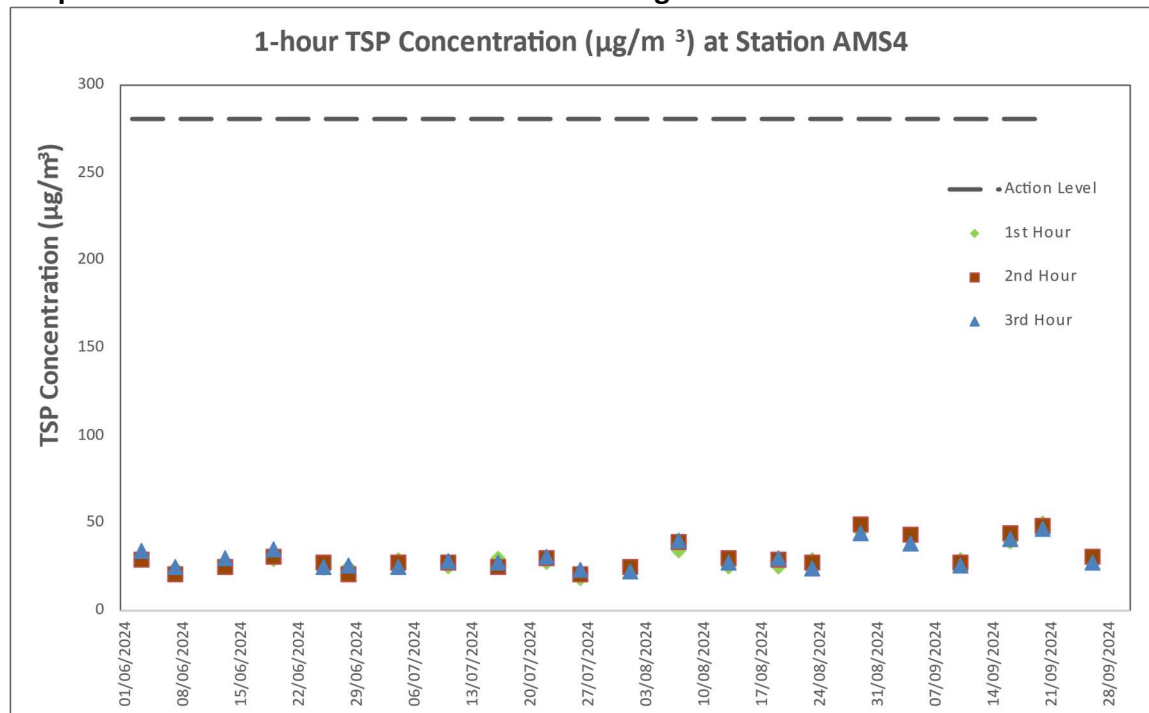



### Data for Noise Monitoring at Station NMS1-T/NMS1-T2 during the Reporting Month


	Date	Time	Weather	L <sub>eq</sub> (5min)	L <sub>10</sub>	L <sub>90</sub>	Measured L <sub>eq</sub> (30min)
#	04-Sep-24	08:50	Fine	74.8	77.4	69.7	
#	04-Sep-24	08:55	Fine	75.5	78.6	70.3	
#	04-Sep-24	09:00	Fine	74.9	77.2	69.0	74.7
#	04-Sep-24	09:05	Fine	73.1	76.9	68.9	
#	04-Sep-24	09:10	Fine	74.6	77.0	69.6	
#	04-Sep-24	09:15	Fine	75.0	78.4	70.2	
#	10-Sep-24	08:38	Sunny	74.3	77.4	69.2	
#	10-Sep-24	08:43	Sunny	75.7	78.6	70.5	
#	10-Sep-24	08:48	Sunny	75.1	78.7	70.0	75.1
#	10-Sep-24	08:53	Sunny	74.9	77.0	69.6	
#	10-Sep-24	08:58	Sunny	75.6	78.8	70.9	
#	10-Sep-24	09:03	Sunny	75.0	78.1	70.5	
#	16-Sep-24	08:38	Fine	74.0	77.1	68.4	
#	16-Sep-24	08:43	Fine	74.2	77.4	68.3	
#	16-Sep-24	08:48	Fine	75.1	78.5	69.6	75.2
#	16-Sep-24	08:53	Fine	74.4	77.0	68.9	
#	16-Sep-24	08:58	Fine	76.7	79.8	70.2	
#	16-Sep-24	09:03	Fine	75.9	78.7	69.0	
#	26-Sep-24	09:55	Fine	75.4	79.3	67.2	
#	26-Sep-24	10:00	Fine	75.9	79.5	67.8	
#	26-Sep-24	10:05	Fine	75.0	78.6	66.0	75.2
#	26-Sep-24	10:10	Fine	75.3	78.9	67.4	
#	26-Sep-24	10:15	Fine	75.4	78.8	65.8	
#	26-Sep-24	10:20	Fine	74.3	77.4	66.4	

Note:

# Impact Monitoring at Station NMS1-T2.

During the reporting period, temporary monitoring station NMS1-T, was no longer accessible from 13 August 2024, due to the relocation of the Agriculture, Fisheries and Conservation Department Kowloon Animal Management Centre. Alternative temporary noise monitoring station, NMS1-T2 was proposed by ET and agreed by IEC on 9 August 2024 and further approved by EPD on 28 August 2024 for conducting impact monitoring during the reporting period.


### Graphical Presentation for Noise Monitoring at NMS1-T/NMS1-T2

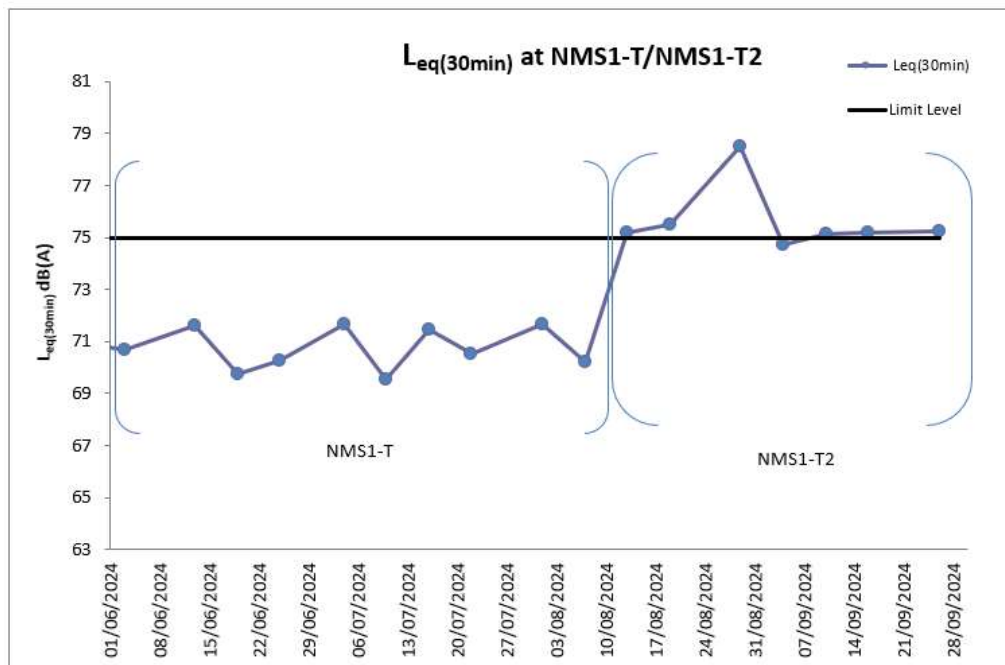

### Data for Noise Monitoring at Station NMS2 during the Reporting Month

Date	Time	Weather	L <sub>eq</sub> (5min)	L <sub>10</sub>	L <sub>90</sub>	Measured L <sub>eq</sub> (30min)
04-Sep-24	09:35	Fine	70.1	73.7	66.3	69.9
04-Sep-24	09:40	Fine	69.2	72.0	65.9	
04-Sep-24	09:45	Fine	68.7	71.8	64.6	
04-Sep-24	09:50	Fine	69.4	72.5	65.7	
04-Sep-24	09:55	Fine	71.0	74.2	66.5	
04-Sep-24	10:00	Fine	70.7	73.6	66.0	69.2
10-Sep-24	09:24	Sunny	68.9	71.0	64.5	
10-Sep-24	09:29	Sunny	70.6	73.4	66.8	
10-Sep-24	09:34	Sunny	69.3	72.7	65.0	
10-Sep-24	09:39	Sunny	68.7	71.9	64.2	
10-Sep-24	09:44	Sunny	69.1	72.6	65.4	
10-Sep-24	09:49	Sunny	68.0	71.0	64.9	69.8
16-Sep-24	09:23	Fine	68.0	71.2	64.3	
16-Sep-24	09:28	Fine	69.7	72.0	65.8	
16-Sep-24	09:33	Fine	70.1	73.4	66.0	
16-Sep-24	09:38	Fine	69.4	72.5	65.9	
16-Sep-24	09:43	Fine	70.8	73.7	66.6	
16-Sep-24	09:48	Fine	70.5	73.9	66.1	69.4
26-Sep-24	09:06	Fine	68.3	71.0	63.3	
26-Sep-24	09:11	Fine	69.6	72.2	64.9	
26-Sep-24	09:16	Fine	68.7	70.3	65.9	
26-Sep-24	09:21	Fine	69.1	71.9	64.9	
26-Sep-24	09:26	Fine	70.3	72.3	66.2	
26-Sep-24	09:31	Fine	70.0	71.8	68.2	


### Graphical Presentation for Noise Monitoring at NMS2

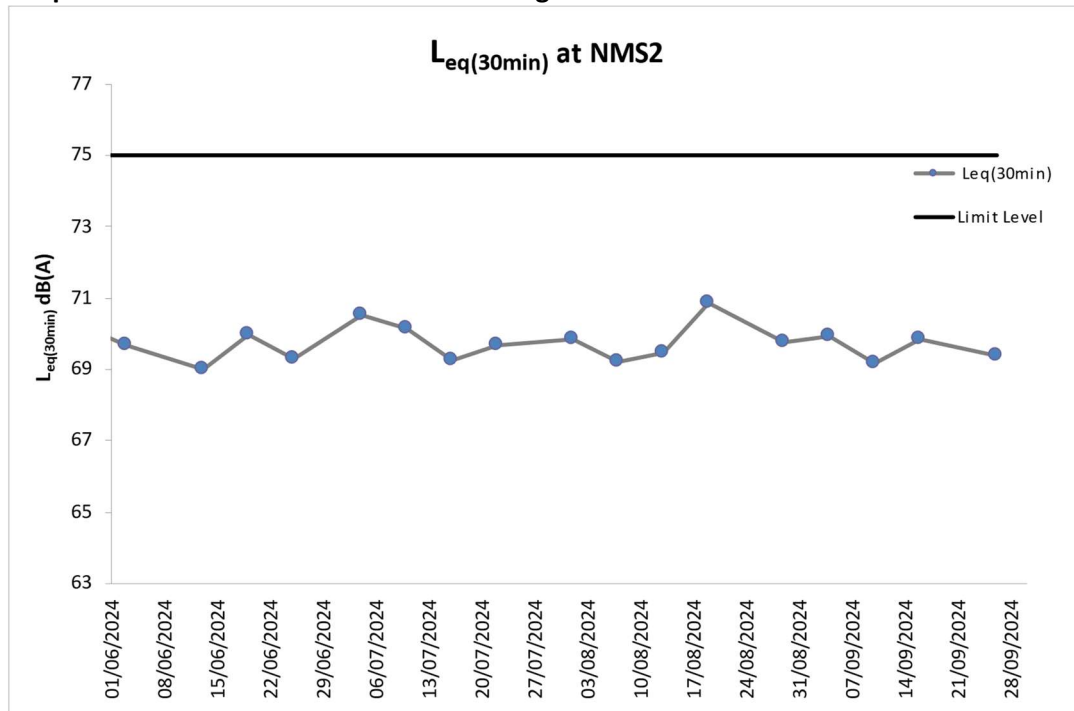

### Data for Noise Monitoring at Station NMS4 during the Reporting Month


Date	Time	Weather	L <sub>eq(5min)</sub>	L <sub>10</sub>	L <sub>90</sub>	Measured L <sub>eq(30min)</sub>
04-Sep-24	09:35	Fine	65.1	67.9	63.2	
04-Sep-24	09:40	Fine	64.9	66.0	62.5	
04-Sep-24	09:45	Fine	66.3	68.4	64.8	65.5
04-Sep-24	09:50	Fine	66.6	68.7	64.7	
04-Sep-24	09:55	Fine	64.0	66.5	62.6	
04-Sep-24	10:00	Fine	65.5	67.4	63.0	
10-Sep-24	09:24	Sunny	65.0	67.7	63.8	
10-Sep-24	09:29	Sunny	66.3	68.4	64.5	
10-Sep-24	09:34	Sunny	64.6	66.9	62.2	65.4
10-Sep-24	09:39	Sunny	65.9	67.6	63.0	
10-Sep-24	09:44	Sunny	64.1	66.0	62.1	
10-Sep-24	09:49	Sunny	65.8	67.2	63.7	
16-Sep-24	09:23	Fine	64.1	66.5	62.3	
16-Sep-24	09:28	Fine	65.9	67.0	63.6	
16-Sep-24	09:33	Fine	65.7	67.2	63.6	65.2
16-Sep-24	09:38	Fine	66.4	68.1	64.0	
16-Sep-24	09:43	Fine	64.6	66.7	62.9	
16-Sep-24	09:48	Fine	64.0	66.8	62.5	
26-Sep-24	09:06	Fine	74.6	77.5	63.8	
26-Sep-24	09:11	Fine	78.7	83.6	64.9	
26-Sep-24	09:16	Fine	78.4	83.2	63.2	77.2
26-Sep-24	09:21	Fine	65.3	67.3	62.1	
26-Sep-24	09:26	Fine	76.7	82.4	62.9	
26-Sep-24	09:31	Fine	79.8	84.2	65.1	

### Graphical Presentation for Noise Monitoring at NMS4


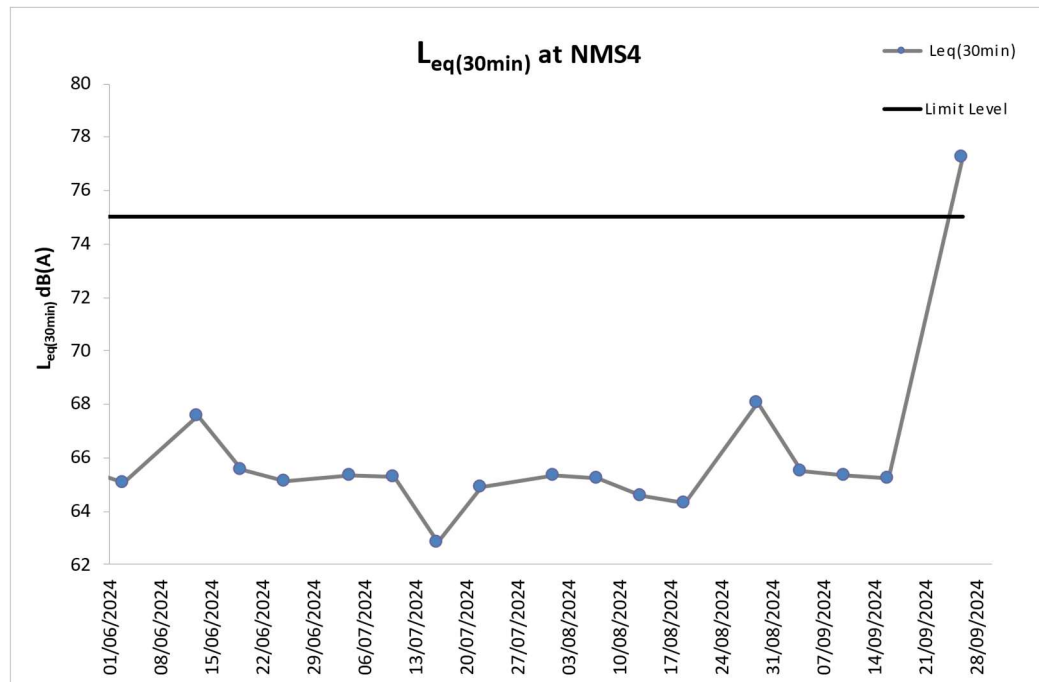


## Appendix H. Wind Data



4 September 2024

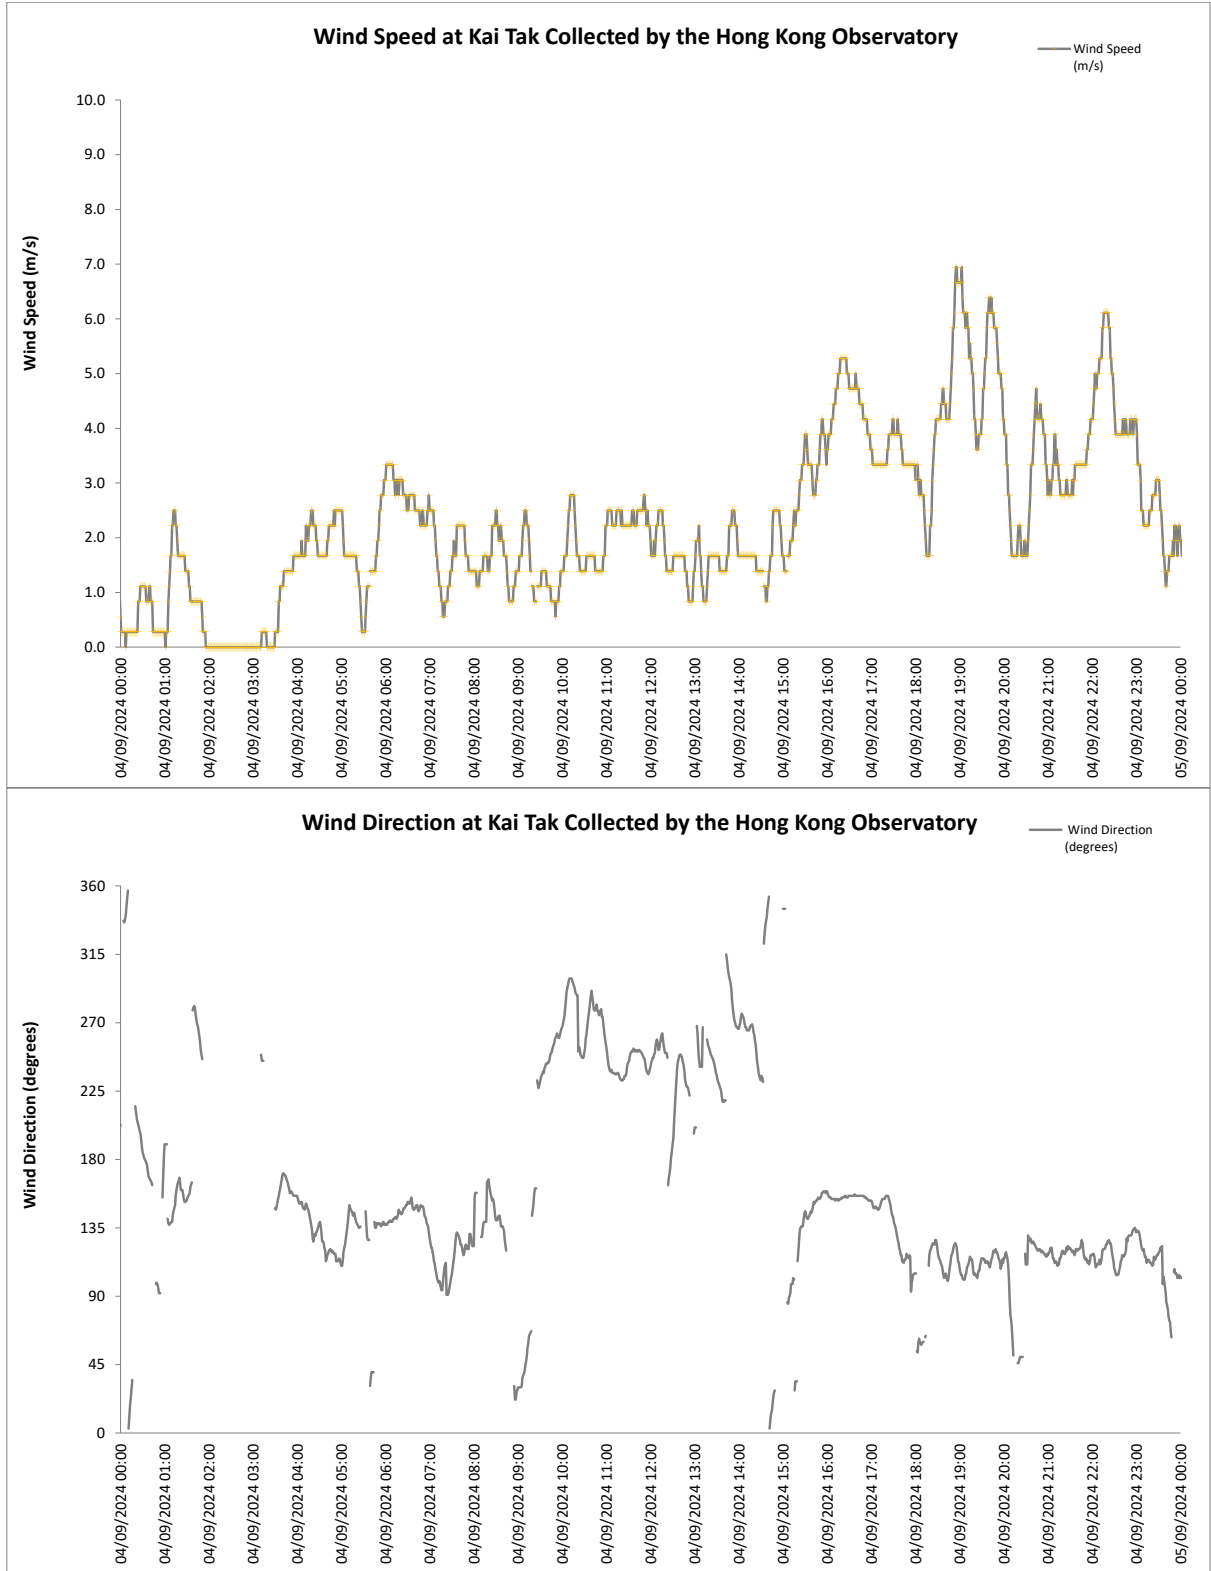



10 September 2024

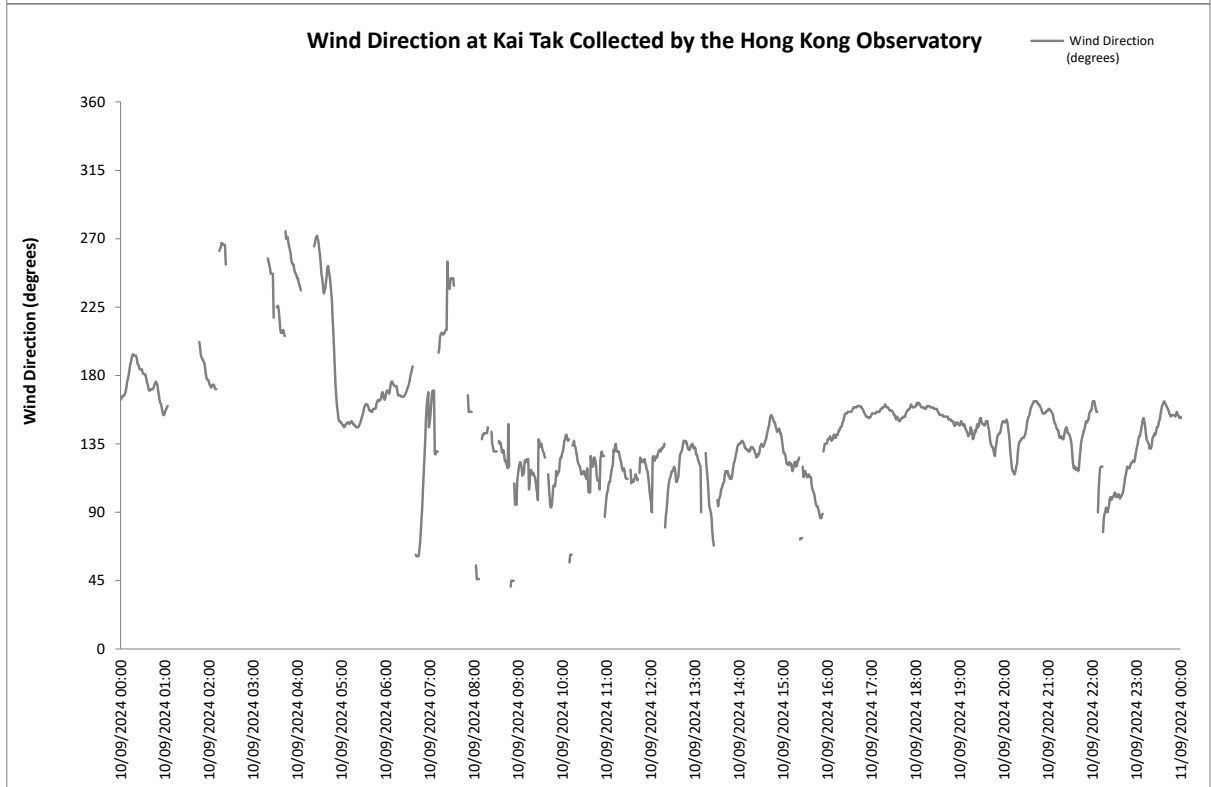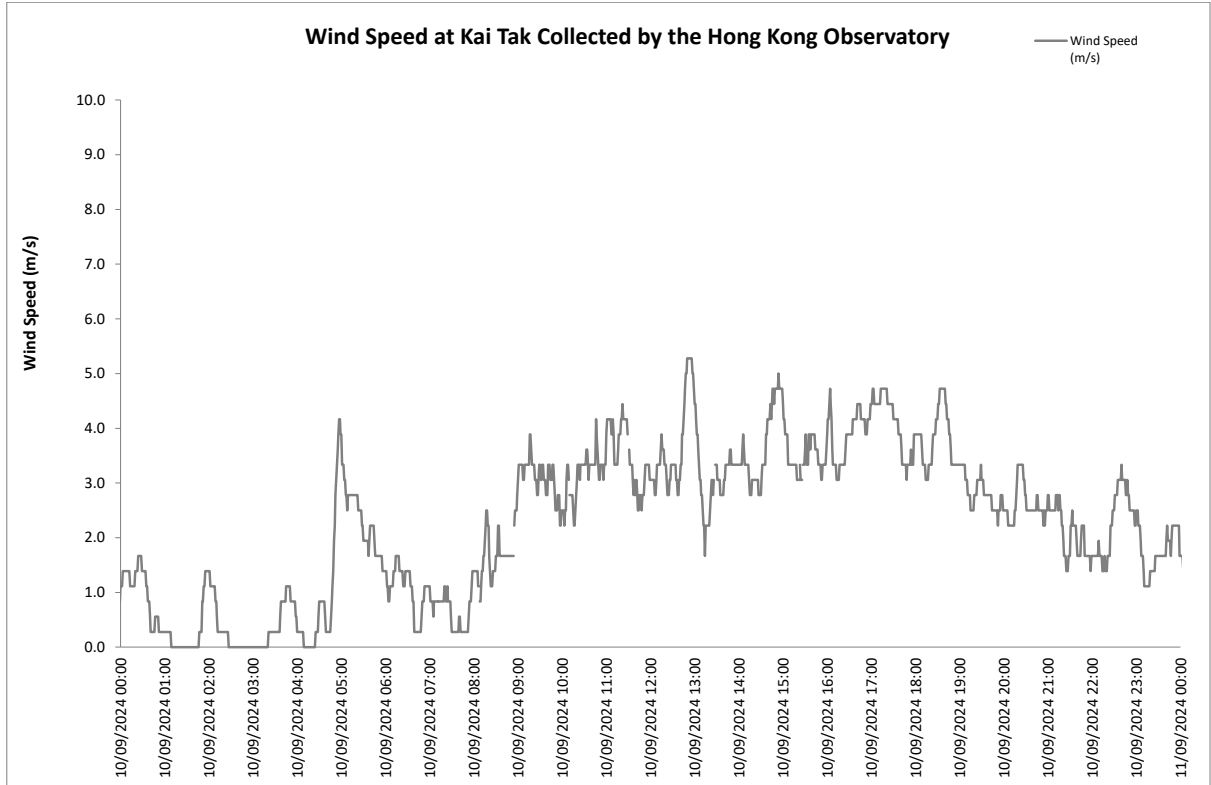

16 September 2024

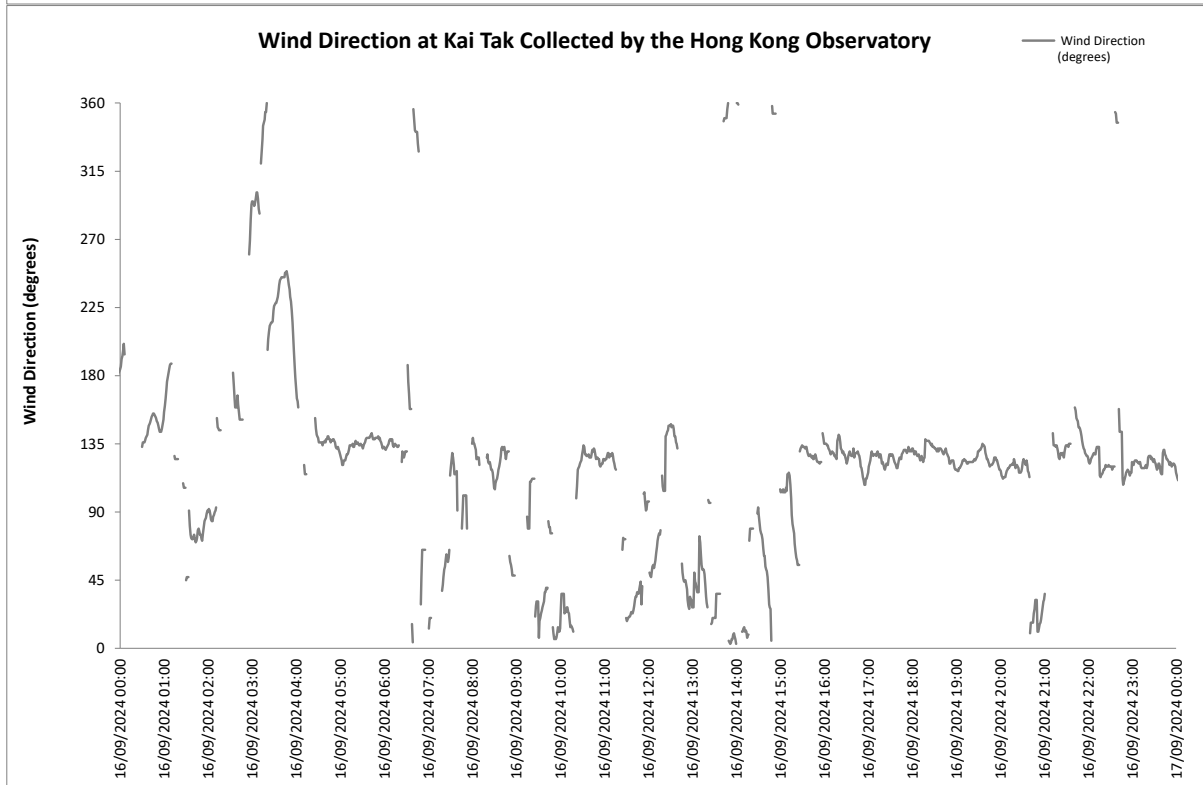
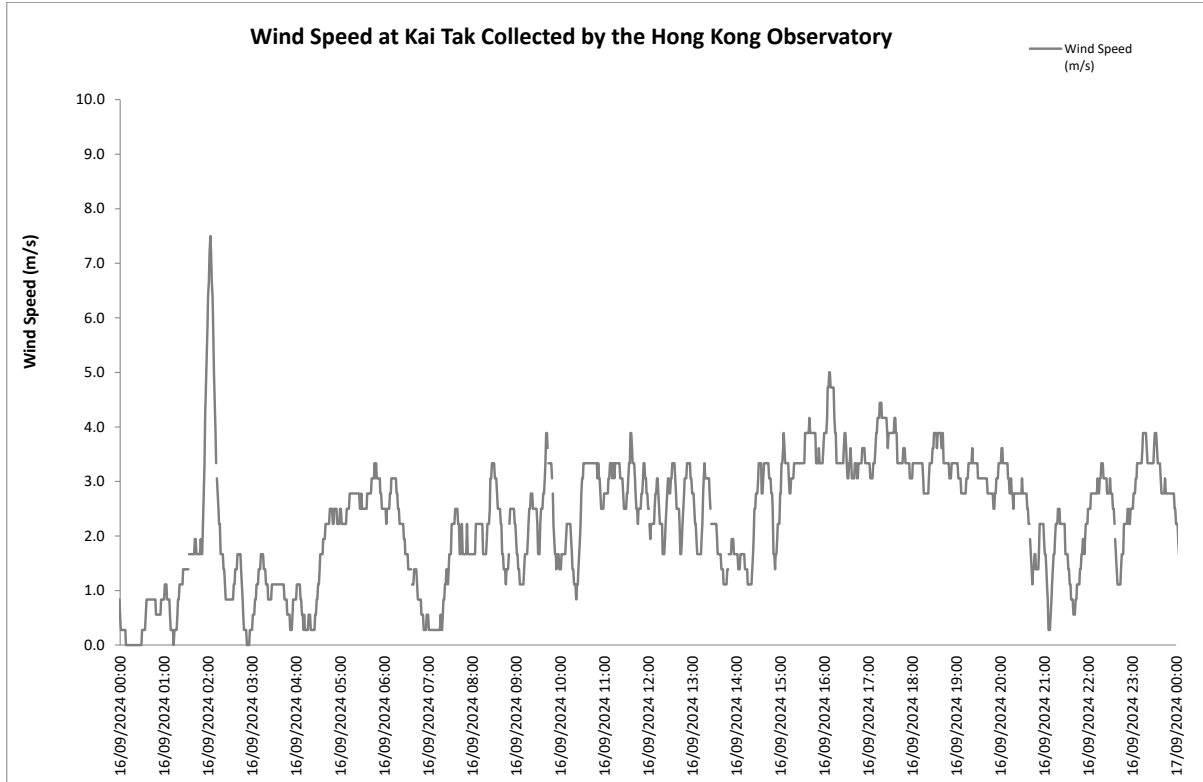


20 September 2024

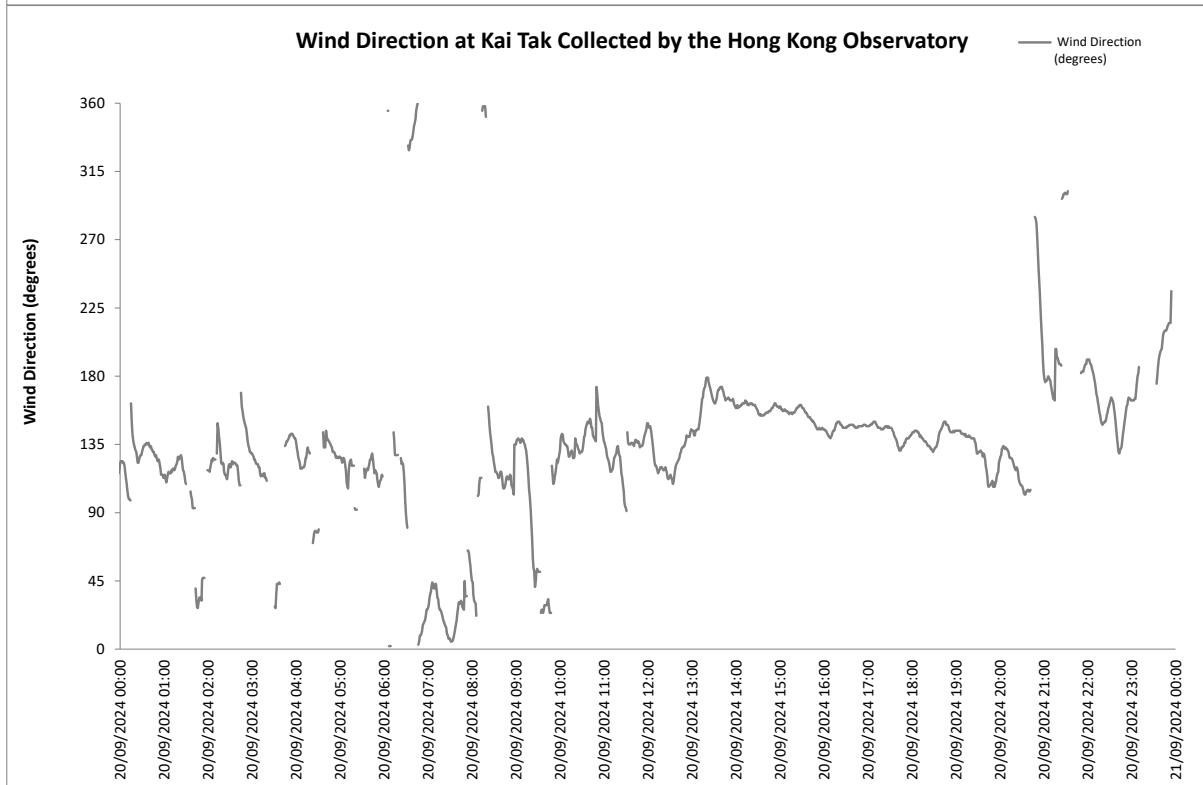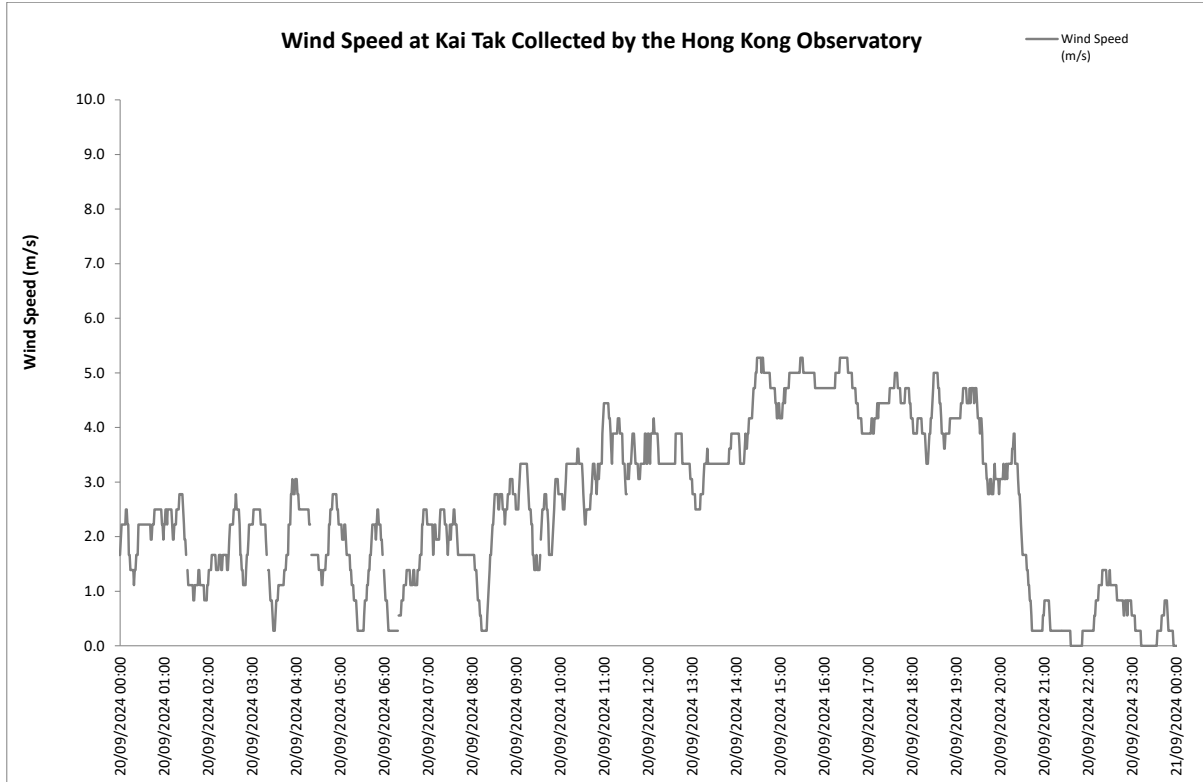



26 September 2024

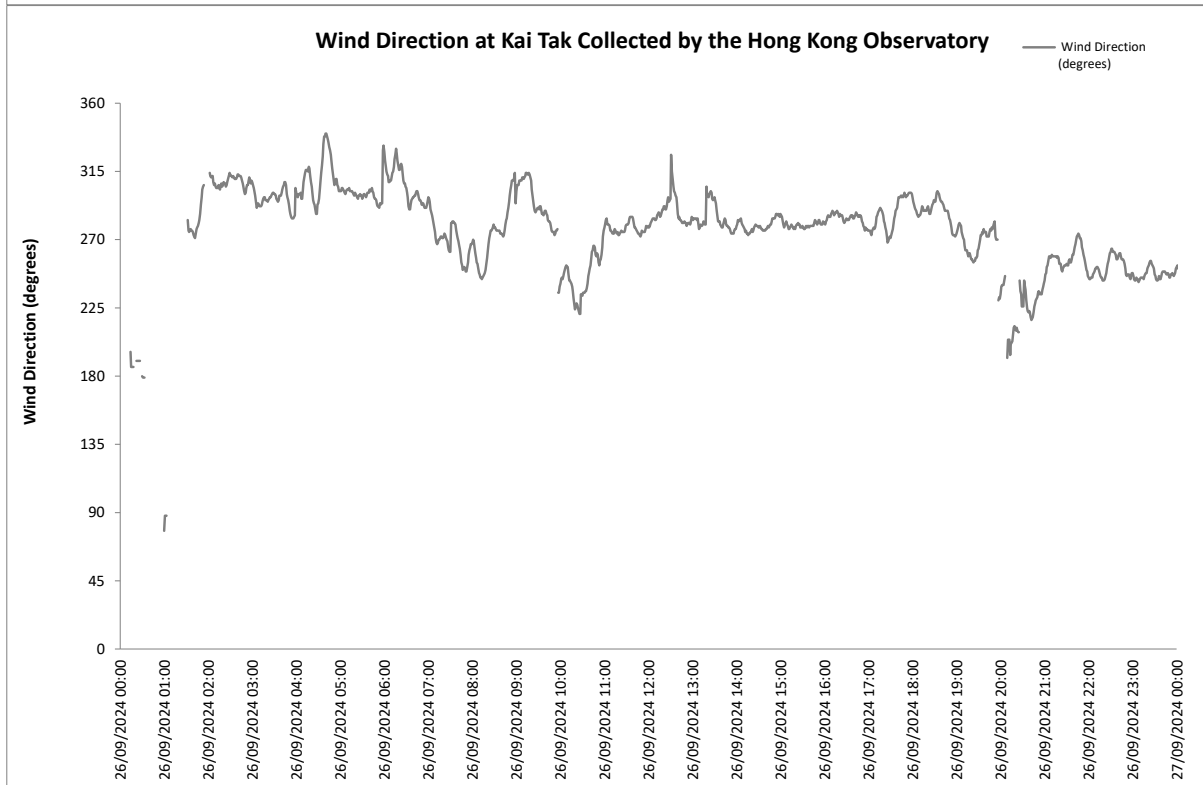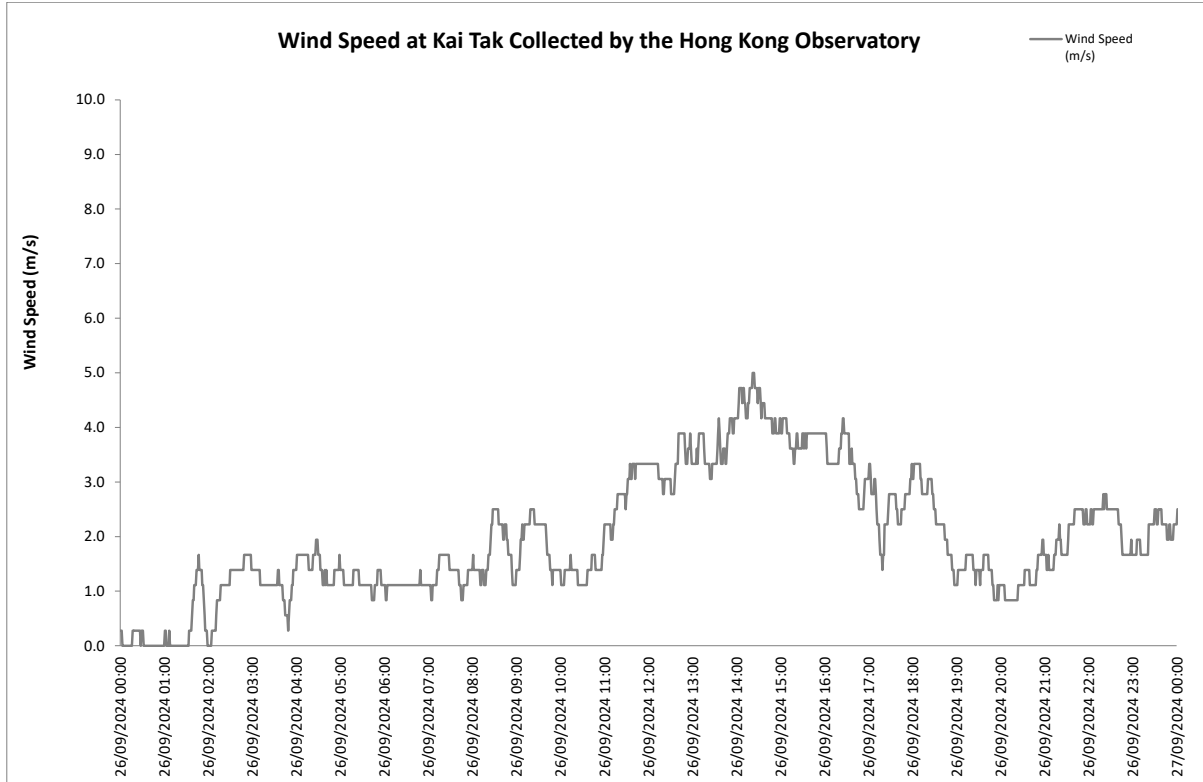

## Appendix I. Waste Flow Table



Project: Proposed Composite Development at NKIL 6607, Shing Kai Road, Kai Tak, Kowloon

Company: Hip Hing Construction Co., Ltd.

Monthly Summary Waste Flow Table

Month	Total Quantities Generated	Total Quantities Generated (excluded excavated material)	Accumulated Quantities of Inert C&D Materials Generated					Accumulated Quantities of Non-inert C&D Wastes Generated							
			(a)	(b)	(c)	(d)	(e)	(f)	(g)	(h)	(i)	(j)	(k)	(l)	
			Broken Concrete Recycled	Broken Concrete Diverted to Public Fill	Excavated Materials Reused in this Project	Excavated Materials Reused in other Projects	Excavated Materials Disposed as Public Fill	Mixed Wastes Diverted to Sorting Facility	Metals Recycled	Paper/ Cardboard Packaging Recycled	Timber/Wood Pallet Recycled	Plastics Recycled	Chemical Waste Collected	Others, e.g. General Refuse Disposed at Landfill	
(in'000 kg)	(in'000 kg)	(in'000 kg)	(in'000 kg)	(in'000 kg)	(in'000 kg)	(in'000 kg)	(in'000 kg)	(in'000 kg)	(in'000 kg)	(in'000 kg)	(in'000 kg)	(in'000 kg)			
Aug-21	0	0	0	0	0	0	0	0	0	0	0	0	0	0.00	
Sep-21	1550.68	0.00	0	0	0	1550.68	0.00	0.00	0.00	0.00	0	0	0	0.00	
Oct-21	3691.90	28.13	0	0	0	3663.77	0.00	0.00	13.17	0.00	0	0	0	14.96	
Nov-21	5447.65	68.57	0	0	0	5309.20	69.88	6.05	32.40	0.00	0	0	0	30.12	
Dec-21	400.90	180.45	0	0	0	63.20	157.25	0.00	138.58	0.00	0	0	0	41.87	
Jan-22	1454.58	288.36	0	0	0	493.40	672.82	27.52	245.57	0.00	0	0	0	15.27	
Feb-22	241.23	207.42	0	0	0	0.00	33.81	4.65	177.65	0.05	0	0	0	25.07	
Mar-22	1717.06	373.58	0	0	0	0.00	1343.48	89.56	265.79	0.00	0	0	0	18.23	
Apr-22	1657.01	788.84	0	0	0	0.00	868.17	87.83	684.33	0.00	0	0	0	16.68	
May-22	1260.80	124.46	0	0	0	0.00	1136.34	102.49	21.97	0.00	0	0	0	0.00	
Jun-22	464.11	77.27	0	0	0	0.00	386.84	55.75	21.43	0.09	0	0	0	0.00	
Jul-22	813.76	98.52	0	0	0	0.00	715.24	58.30	32.29	0.00	0	0	0	7.93	
Aug-22	442.84	55.11	0	0	0	0.00	387.73	54.95	0.00	0.16	0	0	0	0.00	
Sep-22	786.99	91.80	0	0	0	0.00	695.19	91.80	0.00	0.00	0	0	0	0.00	
Oct-22	1428.67	157.88	0	0	0	0.00	1270.79	154.05	0.00	0.00	0	0	0	3.83	
Nov-22	2134.86	174.01	0	0	0	0.00	1960.85	147.07	0.00	0.63	0	0	0	26.31	
Dec-22	864.13	212.59	0	0	0	0.00	651.54	198.44	0.00	0.00	0	0	0	14.15	
Jan-23	885.60	135.88	0	0	0	0.00	749.72	133.59	0.00	0.00	0	0	0	2.29	
Feb-23	1286.59	225.50	0	0	0	0.00	1061.09	181.53	24.35	0.52	0	0	0	19.10	
Mar-23	691.22	253.47	0	0	0	0.00	437.75	149.17	71.86	0.16	0	0	0	32.28	
Apr-23	3744.20	56.11	0	0	0	0.00	3688.09	30.39	0.00	0.28	0	0	0	25.44	
May-23	2344.73	127.50	0	0	0	0.00	2217.23	121.58	0.00	0.00	0	0	0	5.92	
Jun-23	184.99	84.02	0	0	0	0.00	100.97	82.67	0.00	0.00	0	0	0	1.35	
Jul-23	465.69	79.17	0	0	0	0.00	386.52	74.46	0.00	0.00	0	0	0	4.71	
Aug-23	92.13	92.13	0	0	0	0.00	0.00	83.60	0.00	0.00	0	0	0	8.53	
Sep-23	114.83	101.37	0	0	0	0.00	13.46	94.65	0.00	0.20	0	0	0	6.52	
Oct-23	143.00	121.62	0	0	0	0.00	21.38	112.81	0.00	0.16	0	0	0	8.65	
Nov-23	106.87	106.87	0	0	0	0.00	0.00	98.35	0.00	0.00	0	0	0	8.52	
Dec-23	169.09	43.68	0	0	0	0.00	125.41	42.12	0.00	0.00	0	0	0	1.56	
Jan-24	339.23	24.43	0	0	0	0.00	314.80	22.15	0.00	0.00	0	0	0	2.28	
Feb-24	16.43	16.43	0	0	0	0.00	0.00	10.25	0.00	0.00	0	0	0	6.18	
Mar-24	42.68	22.19	0	0	0	0.00	20.49	17.77	0.00	0.00	0	0	0	4.42	
Apr-24	20.41	15.13	0	0	0	0.00	5.28	5.70	0.00	0.00	0	0	0	9.43	
May-24	36.80	36.80	0	0	0	0.00	0.00	0.00	0.00	0.00	0	0	0	36.80	
Jun-24	42.54	42.54	0	0	0	0.00	0.00	0.00	0.00	0.00	0	0	0	42.54	
Jul-24	52.35	52.35	0	0	0	0.00	0.00	0.00	0.00	0.00	0	0	0	52.35	
Aug-24	44.12	44.12	0	0	0	0.00	0.00	0.00	0.00	0.00	0	0	0	44.12	
Sep-24	30.70	30.70	0	0	0	0.00	0.00	0.00	0.00	0.00	0	0	0	30.70	
<b>Total</b>	<b>35211.37</b>	<b>4639.00</b>	<b>0</b>	<b>0</b>	<b>0</b>	<b>11080.25</b>	<b>19492.12</b>	<b>2339.25</b>	<b>1729.39</b>	<b>2.24</b>	<b>0.00</b>	<b>0.00</b>	<b>0.00</b>	<b>568.11</b>	

Total C&D Waste generated 35211.37 Tons  
 Total C&D waste generated (Excluded excavated materials) 4639.00 Tons  
 Total C&D waste recycled 1731.64 Tons

$$\text{Waste Recycling Rate} = \frac{(a) + (g) + (h) + (i) + (j)}{(a) + (b) + (f) + (g) + (h) + (i) + (j) + (l)} \times 100\% = 37.33\%$$

Note:

For BEAM Plus certification scheme, excavated materials are excluded from the calculation of the waste reduction rate Record with Underlined indicated updated content

# Appendix J. Environmental Licences and Permits

**Table J.1: Summary of Environmental Licences and Permits Status (KTSP)**

Item No.	Type of Permit / Licence	Reference No.	Application Date	Valid from	Valid until	Remark
1	Environmental Permit under EIAO	EP-544/2017	21 Aug 2017	8 Sep 2017	N/A	Issued
2	Construction Dust Notification under APCO	441733	25 Jan 2019	29 Jan 2019	N/A	N/A
3	Construction Waste Disposal Account (Main)	7033182	12 Feb 2019	12 Feb 2019	N/A	N/A
4	Registration as a Chemical Waste Producer	WPN5213-286-H3906-02	29 Jan 2019	12 Feb 2019	N/A	N/A
5	Discharge Licence under WPCO	WT10002906-2024	7 Feb 2024	1 Jul 2024	30 Jun 2029	Issued
6	Construction Noise Permit (Construction Works, Southern Site)	GW-RE0912-24	17 Jul 2024	20 Aug 2024	19 Feb 2025	Issued
7	Construction Noise Permit (Construction Works, Northern Site)	GW-RE1008-24	5 Aug 2024	30 Aug 2024	28 Feb 2025	Issued
8	Construction Noise Permit (Special Shing Kai Road)	GW-RE1102-24	26 Aug 2024	2 Sep 2024	31 Oct 2024	Issued

**Table J.2: Summary of Environmental Licences and Permits Status (H/O Development)**

Item No.	Type of Permit / Licence	Reference No.	Application Date	Valid from	Valid until	Remark
1	Environmental Permit under EIAO	EP-544/2017	21 Aug 2017	8 Sep 2017	N/A	Issued
2	Construction Dust Notification under APCO	458255	17 Jul 2020	17 Jul 2020	N/A	N/A
		470045	29 Jul 2021	29 Jul 2021	N/A	N/A
3	Construction Waste Disposal Account (Main)	7041267	29 Jul 2021	11 Aug 2021	N/A	Issued
4	Registration as a Chemical Waste Producer	WPN5211-286-H1103-23	29 Jul 2021	24 Aug 2021	N/A	Issued
5	Discharge Licence under WPCO	WT00039490-2021	6 Aug 2021	9 Nov 2021	30 Nov 2026	Issued

# Appendix K. Environmental Mitigation Measures Implementation Status

## Air Quality – Recommended Mitigation Measures

Air Quality Mitigation Measures during construction	Implementation Status	
	KTSP	H/O
• Good housekeeping to minimize dust generation, e.g. by properly handling and storing dusty materials	✓	✓
• Store cement in shelter with 3 sides and the top covered by impervious materials if the stack exceeds 20 bags	✓	✓
• Cement delivered in bulk should be stored in a closed silo fitted with an audible high level alarm which is interlocked with the material filling line and no overfilling is allowed	N/A	N/A
• Loading, unloading, transfer, handling or storage of bulk cement should be carried out in a totally enclosed system or facility, and any vent or exhaust should be fitted with an effective fabric filter or equivalent air pollution control system	✓	✓
• Dusty materials (e.g. debris) should be wetted by misting / water-spraying before any loading, unloading, transfer or transport operation	✓	✓
• Any skip hoist for material transport should be fully enclosed by impervious sheeting	✓	✓
• Surfaces where any pneumatic or power-driven drilling, cutting, polishing or other mechanical breaking operation takes place should be sprayed with water or a dust suppression chemical continuously	✓	✓
• Any area that involves demolition activities should be sprayed with water or a dust suppression chemical immediately prior to, during and immediately after the activities to maintain the entire surface wet	✓	✓
• Excavation area should be minimized as far as possible	✓	✓
• Stockpile of dusty materials should not be extended beyond the pedestrian barriers, fencing or traffic cones	✓	✓
• Excavated or stockpile of dusty material should be covered entirely by impervious sheeting or sprayed with water to maintain the entire surface wet, and then removed, backfilled or reinstated where practicable within 24 hours of the excavation or unloading	P	✓
• Dusty materials remaining after a stockpile is removed should be wetted with water and cleared from the surface of roads	✓	✓
• Properly fitted side and tail boards are necessary for any vehicle with open load area	✓	✓
• While transporting materials that potentially create dust (e.g. debris), materials should not be loaded higher than side and tail boards, and should be fully covered by tarpaulin or similar materials which extend at least 300 mm over the edges of the side and tail boards to prevent leakage.	✓	✓
• Limit the maximum vehicle speed within the site to 10km/hr	✓	✓
• Haulage and delivery vehicles should be confined to designated roads	✓	✓
• Every main haul road should either be 1.) paved with concrete and kept clear of dusty materials, or 2.) sprayed or watered to maintain the entire road surface wet	P	✓
• All on-site unpaved roads should be compacted and kept free of loose materials as possible	✓	✓
• Provide vehicle washing (e.g. wheel washing bay & high pressure water jet where practicable) at every vehicle exit point for cleaning vehicle body and wheels	✓	✓
• The vehicle washing area and the road between washing area and site exit should be paved with concrete, bituminous or other hardcores	✓	✓
• The portion of any road leading only to construction site that is within 30m of a vehicle entrance or exit should be kept clear of dusty materials.	✓	✓
• Dusty materials on every vehicle's body and wheels should be removed in washing area before leaving the site	✓	✓

Air Quality Mitigation Measures during construction	Implementation Status	
	KTSP	H/O
• Regular maintenance of all plant equipment	✓	✓
• Throttle down or switch off unused machines or machine in intermittent use	✓	✓
• If the site is adjacent to area where accessible to the public (e.g. road and service lane etc.), hoarding of not less than 2.4 m high from ground level should be erected along the adjoining the entire length of that portion of the site boundary, except for a site entrance or exit. The hoarding should be well maintained throughout the construction period.	✓	N/A
• Where a scaffolding is erected around the perimeter of a building under construction, effective dust screens, sheeting or netting should be provided to enclose the scaffolding from the ground floor level of the building, or a canopy should be provided from the first floor level up to the highest level of the scaffolding	✓	N/A
• Exposed earth should be properly treated by compaction, turfing, hydroseeding, vegetation planting or sealing with latex, vinyl, bitumen, shortcrete or other suitable surface stabiliser within six months after the last construction activity on the construction site or part of the construction site where the exposed earth lies	✓	✓
• Carry out air quality monitoring throughout the construction period	✓	✓
• Carry out weekly site inspection to audit the implementation of mitigation measures	✓	✓
• Regular watering once per hour on exposed worksites and haul road with an equivalent intensity of not less than 1.3L/m <sup>3</sup> to achieve 91.7% dust removal efficiency.	✓	✓
• Provision of electrical vehicle (EV) charging facilities in at least one-third of the car parking spaces for private cars. Provision of EV charging enabling facilities in all car parking spaces provided for private cars.	✓	✓
Non-Road Mobile Machinery (NRMMS)		
• All NRMMS operated on-site are approved or exempted (as the case may be) and affixed with the requisite approval/exemption labels under the Air Pollution Control (Non-road Mobile Machinery) (Emission) Regulation or are in the process of application for such approval/exemption during the relevant grace period.	P	P

## Noise – Recommended Mitigation Measures

Noise Mitigation Measures during construction	Implementation Status	
	KTSP	H/O
• Adopt good site practice, such as throttle down or switch off equipment unused or intermittently used between works	✓	✓
• Regular maintenance of equipment to prevent noise emission due to impair	✓	✓
• Position mobile noisy equipment in locations away from NSRs and point the noise sources to directions away from NSRs	✓	✓
• Use silencer or muffler for equipment	✓	✓
• Make good use structures for noise screening	✓	✓
• Use Quality Powered Mechanical Equipment (QPME) and quiet equipment which produces lower noise level.	✓	✓
• Erect movable noise barrier of 3m height to shed large plant equipment (e.g. breaker, backhoe & mobile crane) or hand-held items (e.g. poker, wood saw, power rammer & compactor) near low-rise NSR. Where necessary, special design (e.g. with noise absorbing material or bend top) should be adopted. The barrier's length should be at least five times greater than its height, and the minimum surface density is 10 kg/m <sup>2</sup> . Alternatively, acoustic shed, enclosure or silencer (for generator, air compressor and concrete pump) or acoustic mat (for piling) can be adopted.	N/A	N/A
• Carry out regular site inspection to audit the implementation of mitigation measures	✓	✓
• Carry out noise monitoring throughout the construction period	✓	✓



## Water Quality – Recommended Mitigation Measures

Water Quality Mitigation Measures during construction	Implementation Status	
	KTSP	H/O
• Practices outlined in ProPECC PN 1/94 Construction Site Drainage should be adopted.	✓	✓
• Install perimeter channels in the works areas to intercept runoff from boundary prior to the commencement of any earthwork	✓	✓
• To prevent storm runoff from washing across exposed soil surfaces, intercepting channels should be provided.	✓	✓
• Drainage channels are required to convey site runoff to sand/silt traps and oil interceptors. Provision of regular cleaning and maintenance to ensure the normal operation of these facilities throughout the construction period.	✓	✓
• Any practical options for the diversion and realignment of drainage should comply with both engineering and environmental requirements	✓	✓
• Minimum distances of 100 m should be maintained between the discharge points of construction site runoff and the existing WSD saltwater intake and EMSD cooling water intake.	✓	✓
• The following good site measures should be adopted for the use of the existing barging facilities being operated by the MTR SCL Project: - All vessels should be sized so that adequate clearance is maintained between vessels and the seabed in all tide conditions, to ensure that undue turbidity is not generated by turbulence from vessel movement or propeller wash. - All hopper barges should be fitted with tight fitting seals to their bottom openings to prevent leakage of material. - Construction activities should not cause foam, oil, grease, scum, litter or other objectionable matter to be present on the water within the site. - Loading of barges and hoppers should be controlled to prevent splashing of material into the surrounding water. - Barges or hoppers should not be filled to a level that will cause the overflow of materials or polluted water during loading or transportation.	N/A	N/A
• The runoff and wastewater generated from the works areas should be treated so that it satisfies all the standards listed in the TM-DSS.	✓	✓
• Reuse and recycling of the treated effluent from construction site runoff.	✓	✓
• Weekly site audit should be carried out to check the implementation status of the recommended water quality impact mitigation measures throughout construction period.	✓	✓
• The construction programme should be properly planned to minimise soil excavation, if any, in rainy seasons.	✓	✓
• Any exposed soil surfaces should be properly protected to minimise dust emission.	✓	✓
• In areas where a large amount of exposed soils exist, earth bunds or sand bags should be provided.	✓	✓
• Exposed stockpiles should be covered with tarpaulin or impervious sheets at all times.	✓	✓
• The stockpiles of materials should be placed at locations away from any stream courses so as to avoid releasing materials into the water bodies.	✓	✓
• Final surfaces of earthworks should be compacted and protected by permanent work.	✓	✓
• Haul roads should be paved with concrete and the temporary access roads protected using crushed stone or gravel, wherever practicable.	✓	✓
• Wheel washing facilities should be provided at all site exits to ensure that earth, mud and debris would not be carried out of the works areas by vehicles.	✓	✓
• Good site practices should be adopted to keep the site dry and tidy, such as clean the rubbish and litter on the construction sites.	✓	✓
• Adequate temporary site drainage and pumping should be provided, if necessary.	P	✓
• Provide sufficient temporary toilets in the works areas. The toilet facilities should be more than 30 m from any watercourse. A licensed waste collector should be deployed to clean the temporary toilets on a regular basis.	✓	✓
• Notices should be posted at conspicuous locations to remind the workers not to discharge any sewage or wastewater into the nearby environment during the construction phase of the Project.	✓	✓

Water Quality Mitigation Measures during construction	Implementation Status	
	KTSP	H/O
<ul style="list-style-type: none"> <li>Contractor must register as a chemical waste producer if chemical wastes would be produced from the construction activities. The Waste Disposal Ordinance (Cap 354) and its subsidiary regulations in particular the Waste Disposal (Chemical Waste) (General) Regulation should be observed and complied with for control of chemical wastes.</li> </ul>	✓	✓
<ul style="list-style-type: none"> <li>Any service shop and maintenance facilities should be located on hard standings within a bunded area, and sumps and oil interceptors should be provided. Maintenance of vehicles and equipment involving activities with potential for leakage and spillage should only be undertaken within the areas appropriately equipped to control these discharges.</li> </ul>	✓	✓
<ul style="list-style-type: none"> <li>Clean the construction sites on a regular basis.</li> </ul>	✓	✓
<ul style="list-style-type: none"> <li>Oil interceptor in car parking area shall be designed and constructed according to Practice Note for Authorized Persons, Registered Structural Engineers and Registered Geotechnical Engineers, APP-46 (PNAP 124)</li> </ul>	✓	N/A
<ul style="list-style-type: none"> <li>Provide two sequential storage tanks to contain surface water with residual fertilizers and pesticides and third holding tank for incidental rainstorm</li> </ul>	N/A	N/A
<b>Sewerage and Sewage Treatment Implications</b>		
<ul style="list-style-type: none"> <li>Implementation of Sewer No. 1 and Sewer No.2 as proposed in Sections 7.2.2 - 7.2.3 of the EIA Report</li> </ul>	✓	✓

## Waste Management – Recommended Mitigation Measures

Waste Management Mitigation Measures during construction	Implementation Status	
	KTSP	H/O
<ul style="list-style-type: none"> <li>Inert C&amp;D materials (or public fills) will be used to form the ramps and other filling area as far as civil engineering design permits.</li> </ul>	✓	✓
<ul style="list-style-type: none"> <li>The contractor should formulate waste management measures on waste minimization, storage, handling and disposal in a Waste Management Plan as part of Environmental Management Plan.</li> </ul>	✓	✓
<ul style="list-style-type: none"> <li>Adopt good site practice as follows:                             <ul style="list-style-type: none"> <li>- Provide training to workers on site cleanliness, waste management (waste reduction, reuse and recycle) and chemical handling procedures</li> <li>- Provide sufficient waste collection points and regular removal</li> <li>- Cover waste materials with tarpaulin or in enclosure during transportation</li> <li>- Maintain drainage systems, sumps and oil interceptors</li> <li>- Sort out chemical waste for proper handling and treatment onsite or offsite</li> </ul> </li> </ul>	P	P
<ul style="list-style-type: none"> <li>Adopt waste reduction measures as follows:                             <ul style="list-style-type: none"> <li>- Allocate area/containers for sorting, recovering and storing waste for reuse, recycle or disposal (e.g. demolition debris and excavated materials, general refuse like aluminium cans.) Remove waste from the Site for sorting once generated if no suitable space can be identified.</li> <li>- Allocate area for proper storage of construction materials to prevent contamination</li> <li>- Minimize wastage through careful planning and avoiding over-purchase of construction materials</li> </ul> </li> </ul>	✓	✓
<ul style="list-style-type: none"> <li>Store waste materials properly as follows:                             <ul style="list-style-type: none"> <li>- Avoid contamination by proper handling and storing waste</li> <li>- Prevent erosion by covering waste</li> <li>- Apply water spray on excavated materials</li> <li>- Maintain and clean storage area regularly</li> <li>- Sort and stockpile different materials at designated location to enhance reuse</li> </ul> </li> </ul>	P	✓
<ul style="list-style-type: none"> <li>Apply for relevant waste disposal permits in accordance with the Waste Disposal Ordinance (Cap. 354), Waste Disposal (Charges for Disposal of Construction Waste) Regulation (Cap. 345) and the Land (Miscellaneous Provisions) Ordinance (Cap. 28), Dumping at Sea Ordinance (Cap. 466).</li> </ul>	✓	✓
<ul style="list-style-type: none"> <li>Hire licensed waste disposal contractors for waste collection and removal. Dispose waste at licensed waste disposal facilities.</li> </ul>	✓	✓
<ul style="list-style-type: none"> <li>Implement trip-ticket system for recording the amount of waste generated, recycled and disposed, including chemical wastes</li> </ul>	✓	✓

Waste Management Mitigation Measures during construction	Implementation Status	
	KTSP	H/O
<ul style="list-style-type: none"> <li>Reduce water content in wet spoil generated from piling work by mixing with dry materials. Only dispose treated spoil with less than 25% dry density to Public Fill Reception Facilities</li> </ul>	✓	✓
<ul style="list-style-type: none"> <li>Dispose dry waste or waste with less than 70% water content by weight to landfill</li> </ul>	✓	✓
<ul style="list-style-type: none"> <li>Follow the Code of Practice on the Packaging, Labelling and Storage of Chemical Waste as follows:                             <ul style="list-style-type: none"> <li>Store chemical wastes with suitable containers. Seal and maintain the container to avoid leakage or spillage during storage, handling and transport</li> <li>Label chemical waste containers in both English and Chinese with instructions in accordance to Schedule 2 of the Waste Disposal (Chemical Waste) (General) Regulation</li> <li>The container capacity should be smaller than 450 litres unless agreed by the EPD</li> </ul> </li> </ul>	✓	✓
<ul style="list-style-type: none"> <li>Comply with the requirement of the chemical storage area:                             <ul style="list-style-type: none"> <li>Store only chemical waste and label clearly the chemical characters of the waste</li> <li>Have at least 3 sides enclosed and protected from rainfall with cover</li> <li>Provide sufficient ventilation</li> <li>Have impermeable floor and has bunds to contain 110% of the capacity of the largest container or 20% of the total volume of the stored waste in the area, whichever is larger</li> <li>Adequately spaced incompatible materials</li> </ul> </li> </ul>	P	✓
<ul style="list-style-type: none"> <li>Transfer used lubricants, waste oils and other chemicals to oil recycling companies, if possible, and empty oil drums for reuse or refill. No direct or indirect discharge is permitted</li> </ul>	✓	✓
<ul style="list-style-type: none"> <li>Hire licensed chemical waste disposal contractors for waste collection and removal. Dispose chemical waste at the approved Chemical Waste Treatment Centre at Tsing Yi or other licensed facility</li> </ul>	✓	✓
<ul style="list-style-type: none"> <li>Hire reputable waste collector to separately collect and dispose general refuse from other wastes. Cover the waste to prevent being blown away</li> </ul>	✓	✓
<ul style="list-style-type: none"> <li>The hauling of C&amp;D materials shall follow established environmental mitigation measures as stated in Practice Note for Registered Contractors No. 17 "Control of Environmental Nuisance from Construction Sites" issued by the Buildings Department</li> </ul>	✓	✓
<ul style="list-style-type: none"> <li>Provide recycling bins for sorting out recyclables for collection by recycling companies. Non-recyclables should be removed to designated landfills every day by licensed collectors to prevent environmental and health nuisance.</li> </ul>	✓	✓
<ul style="list-style-type: none"> <li>Organize training and reminders to site staff on waste minimization through avoidance and reduction, reusing and recycling</li> </ul>	✓	✓
<ul style="list-style-type: none"> <li>Bentonite slurry which will not be reused shall be disposed of from the Site as soon as possible. Residual used dewatered bentonite slurry should be disposed to a public filling area and liquid bentonite slurry if mixed with inert fill material should be disposed to a public filling area.</li> </ul>	N/A	N/A
<ul style="list-style-type: none"> <li>If chemical wastes were to be produced at the construction site, the Contractor would be required to register with the EPD as a Chemical Waste Producer, and to follow the guidelines stated in the Code of Practice on the Packaging, Labelling and Storage of Chemical Wastes. Good quality containers compatible with the chemical wastes should be used, and incompatible chemicals should be stored separately. Appropriate labels should be securely attached on each chemical waste container indicating the corresponding chemical characteristics of the waste such as explosive, flammable, oxidizing, irritant, toxic, harmful, corrosive, etc. The Contractor shall use a licensed collector to transport the chemical wastes.</li> <li>The licensed collector shall deliver the waste to the Chemical Waste Treatment Centre at Tsing Yi, or other licensed facility, in accordance with the Waste Disposal (Chemical Waste) (General) Regulation</li> </ul>	✓	✓
<ul style="list-style-type: none"> <li>Carry out weekly site inspection to check the implementation status of the recommended waste management measures.</li> </ul>	✓	✓
<ul style="list-style-type: none"> <li>The barging of C&amp;DM for this Project shall use the existing Kai Tak Barging Facility (KTBF), or otherwise approved by the Director.</li> </ul>	N/A	N/A

## Ecology – Recommended Mitigation Measures

Ecology Mitigation Measures during construction	Implementation Status	
	KTSP	H/O
• Erection of hoarding, fencing or provision of clear demarcation of work zone	✓	✓
• Designate areas for placement of equipment, building materials and wastes away from drainage channels	✓	✓
• Carry out weekly site inspection to check the implementation status and the effectiveness of the proposed mitigation measures	✓	✓

## Landscape and Visual – Recommended Mitigation Measures

Landscape and Visual Mitigation Measures during construction	Implementation Status	
	KTSP	H/O
• Construction Lighting Control - All security floodlights for construction sites should be equipped with adjustable shields, frosted diffusers and reflective covers, and be controlled to minimize light pollution and night-time glare to the visual sensitive receivers (VSRs).	✓	✓
• Temporary Landscape Treatments - Including vertical greening, pot planting and application of green roofing to site offices, Hydroseeding of site formation areas and short term greening of site boundaries and land not immediately developed.	✓	N/A
• Decoration of Hoarding - Erection of screen hoardings should be designed appropriately to be compatible with the existing urban context, either brightly and imaginatively or with visually unobtrusive design and colours where more appropriate.	N/A	✓
• All security floodlights for construction sites shall be equipped with adjustable shield, frosted diffusers and reflective covers, and be carefully controlled to minimize light pollution and night-time glare to nearby receivers	✓	✓
• Site inspection should be undertaken once every two weeks.	✓	✓
• Compensatory Tree Planting - A new parkland area is created in the project development to be used for the implementation of compensatory tree planting to offset the net loss of key landscape resources. It is recommended that 340 trees be planted in this regard and a compensatory tree planting proposal outlining the locations of tree compensation will be submitted separately in seeking relevant government department's approval in accordance with DEVB TC No.7/2015.	✓	N/A

## Other – Recommended Mitigation Measures

• Relevant environmental permits/licences should be posted at all vehicle entrances/exits.	✓	✓
--	---	---

### Legend:

✓	Implemented
×	Not implemented
P	Partially implemented
N/A	Not applicable

# Appendix L. Statistics on Environmental Complaints, Notification of Summons and Successful Prosecutions


**Table L.1: Statistics on Environmental Complaints, Notifications of Summons and Successful Prosecutions**

Reporting Period	Complaints	Notifications of Summons	Successful Prosecutions
This reporting period (Sep 2024)	1	0	0
From commencement data of construction to end of reporting month	41	0	0

# Appendix M. Exceedance Investigation Report

### Exceedance Investigation Report

DETAIL OF EXCEEDANCE		Ref: EXC_0021
Monitoring Date:	10 September 2024	
Monitoring Time:	8:38 a.m.	
Monitoring Parameter:*	<del>Dust</del> Noise <del>Water</del> <del>Other</del>	
Monitoring Station:	NMS1-T2 (Roadside at 138 To Kwa Wan Road)	
Measured Level:	75.1 dB(A)	
Level Exceeded:	Limit Level Exceedance	
INVESTIGATION RESULT & RESPONSE		
ET, IEC and SOR notified on:	2 October 2024	
Investigation conducted on:	2 October 2024	
Result of investigation:	<p>Exceedance investigation was carried out with the contractor on 2 October 2024, the results of investigation were summarized as following:</p> <p>According to the information from subcontractor, noise monitoring was carried out at noise monitoring station NMS1-T2 at roadside 138 To Kwa Wan Road between 8:38 a.m. and 9:08 a.m. 10 September 2024. Nearby road traffic noise along Mok Cheong Street with heavy vehicles were observed during the monitoring period. (Photo 1a and 1b) No specific noisy construction activities from Kai Tak Sports Park was observed during the monitoring period at NMS1-T2.</p> <p>Regular noise mitigation measure had been implemented to prevent possible environmental nuisance included:</p> <ol style="list-style-type: none"> <li>1. Power Mechanical Equipment with Quality Power Mechanical Equipment (QPME) labels were used at site to lower the noise nuisance to the nearby residents. (Photo 2)</li> <li>2. Regular site inspection was carried out to audit the implementation of mitigation measures (Photo 3)</li> </ol> <p>In conclusion, the Limit Level noise exceedance at monitoring station NMS1-T2 is mainly due to nearby road traffic noise along Mok Cheong Street and not related to the Kai Tak Sports Park Project.</p>	

RECOMMENDATIONS / MITIGATION MEASURES / ACTIONS			
Environmental mitigation measures have been maintained as follow:			
1. Power Mechanical Equipment with Quality Power Mechanical Equipment (QPME) labels were used at site to lower the noise nuisance to the nearby residents. (Photo 2)			
2. Regular site inspection was carried out to audit the implementation of mitigation measures on site. (Photo 3)			
5. Implementation of construction noise mitigation measures recommended in EIA's Environmental Mitigation Implementation Schedule.			
Prepared by:	Sunny Chan	Title:	Environmental Team Leader
Signature:		Date:	3 October 2024

**Attachment:**

**Photo Record:**



**Photo 1a and 1b:** Nearby road traffic along Mok Cheong Street at NMS1-T2 on 10 September 2024.



**Environmental Measure Implemented:**




**Photo 2:** Power Mechanical Equipment with Quality Power Mechanical Equipment (QPME) labels were used at site to lower the noise nuisance to the nearby residents.



**Photo 3:** Regular site inspection was carried out to audit the implementation of mitigation measures on site.

### Exceedance Investigation Report

DETAIL OF EXCEEDANCE		Ref: EXC_0022
Monitoring Date:	16 September 2024	
Monitoring Time:	8:38 a.m.	
Monitoring Parameter:*	<del>Dust</del> Noise <del>Water</del> <del>Other</del>	
Monitoring Station:	NMS1-T2 (Roadside at 138 To Kwa Wan Road)	
Measured Level:	75.2 dB(A)	
Level Exceeded:	Limit Level Exceedance	
INVESTIGATION RESULT & RESPONSE		
ET, IEC and SOR notified on:	2 October 2024	
Investigation conducted on:	2 October 2024	
Result of investigation:	<p>Exceedance investigation was carried out with the contractor on 2 October 2024, the results of investigation were summarized as following:</p> <p>According to the information from subcontractor, noise monitoring was carried out at noise monitoring station NMS1-T2 at roadside 138 To Kwa Wan Road between 8:38 a.m. and 9:08 a.m. 16 September 2024. Nearby road traffic noise along Mok Cheong Street and To Kwa Wan Road with heavy vehicles were observed during the monitoring period. (Photo 1a and 1b) No specific noisy construction activities from Kai Tak Sports Park was observed during the monitoring period at NMS1-T2.</p> <p>Regular noise mitigation measure had been implemented to prevent possible environmental nuisance included:</p> <ol style="list-style-type: none"> <li>1. Power Mechanical Equipment with Quality Power Mechanical Equipment (QPME) labels were used at site to lower the noise nuisance to the nearby residents. (Photo 2)</li> <li>2. Regular site inspection was carried out to audit the implementation of mitigation measures (Photo 3)</li> </ol> <p>In conclusion, the Limit Level noise exceedance at monitoring station NMS1-T2 is mainly due to nearby road traffic noise along Mok Cheong Street and To Kwa Wan Road and not related to the Kai Tak Sports Park Project.</p>	

RECOMMENDATIONS / MITIGATION MEASURES / ACTIONS			
Environmental mitigation measures have been maintained as follow:			
1. Power Mechanical Equipment with Quality Power Mechanical Equipment (QPME) labels were used at site to lower the noise nuisance to the nearby residents. (Photo 2)			
2. Regular site inspection was carried out to audit the implementation of mitigation measures on site. (Photo 3)			
5.Implementation of construction noise mitigation measures recommended in EIA’s Environmental Mitigation Implementation Schedule.			
Prepared by:	Sunny Chan	Title:	Environmental Team Leader
Signature:		Date:	3 October 2024


**Attachment:**

**Photo Record:**




**Photo 1a and 1b:** Nearby road traffic noise along Mok Cheong Street and To Kwa Wan Road at NMS1-T2 on 16 September 2024.

**Environmental Measure Implemented:**

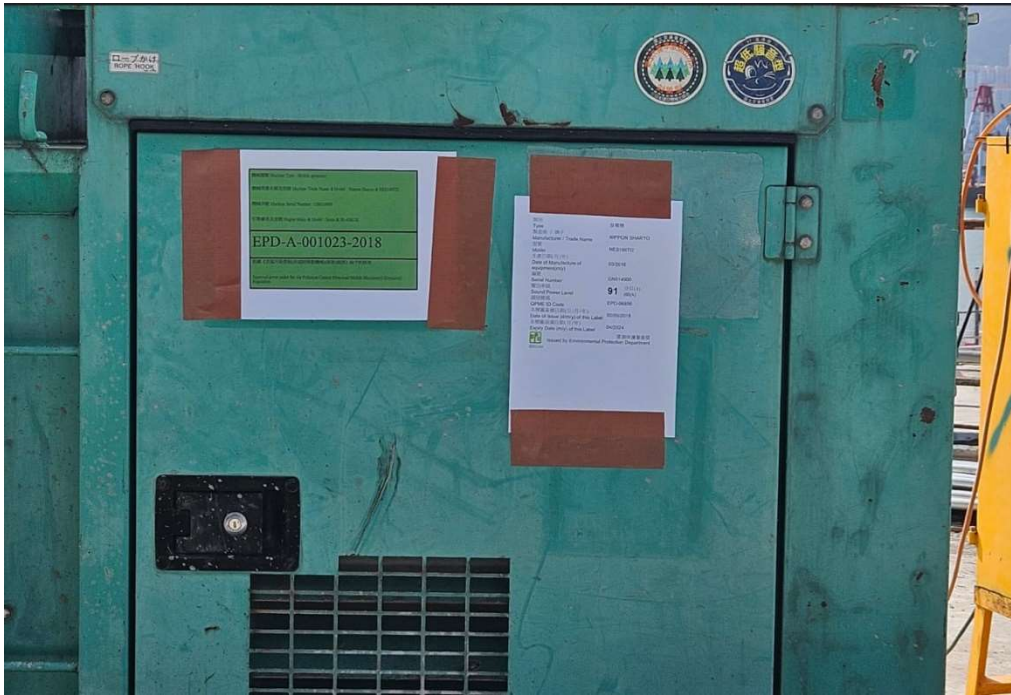


**Photo 2:** Power Mechanical Equipment with Quality Power Mechanical Equipment (QPME) labels were used at site to lower the noise nuisance to the nearby residents.

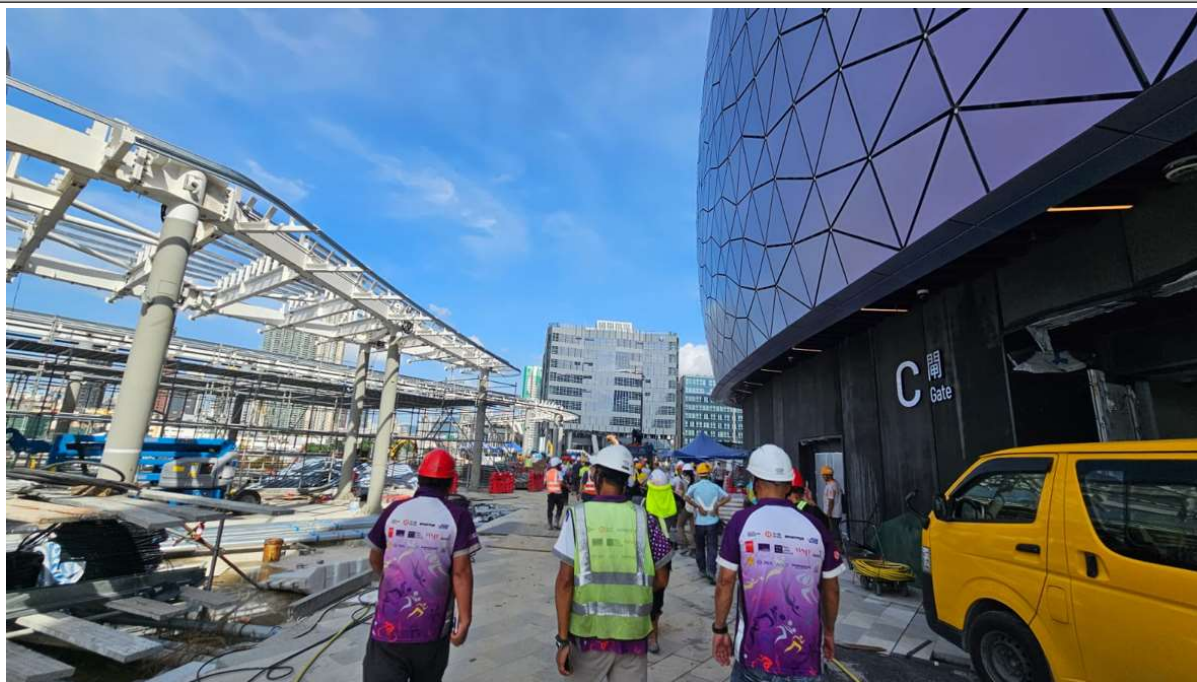

**Photo 3:** Regular site inspection was carried out to audit the implementation of mitigation measures on site.

### Exceedance Investigation Report

DETAIL OF EXCEEDANCE		Ref: EXC_0023
Monitoring Date:	26 September 2024	
Monitoring Time:	9:55 a.m.	
Monitoring Parameter:*	<del>Dust</del> Noise <del>Water</del> <del>Other</del>	
Monitoring Station:	NMS1-T2 (Roadside at 138 To Kwa Wan Road)	
Measured Level:	75.2 dB(A)	
Level Exceeded:	Limit Level Exceedance	
INVESTIGATION RESULT & RESPONSE		
ET, IEC and SOR notified on:	2 October 2024	
Investigation conducted on:	2 October 2024	
Result of investigation:	<p>Exceedance investigation was carried out with the contractor on 2 October 2024, the results of investigation were summarized as following:</p> <p>According to the information from subcontractor, noise monitoring was carried out at noise monitoring station NMS1-T2 at roadside 138 To Kwa Wan Road between 9:55 a.m. and 10:25 a.m. 26 September 2024. Nearby road traffic noise along To Kwa Wan Road with heavy vehicles were observed during the monitoring period. (Photo 1a and 1b) No specific noisy construction activities from Kai Tak Sports Park was observed during the monitoring period at NMS1-T2.</p> <p>Regular noise mitigation measure had been implemented to prevent possible environmental nuisance included:</p> <ol style="list-style-type: none"> <li>1. Power Mechanical Equipment with Quality Power Mechanical Equipment (QPME) labels were used at site to lower the noise nuisance to the nearby residents. (Photo 2)</li> <li>2. Regular site inspection was carried out to audit the implementation of mitigation measures (Photo 3)</li> </ol> <p>In conclusion, the Limit Level noise exceedance at monitoring station NMS1-T2 is mainly due to nearby road traffic noise along To Kwa Wan Road and not related to the Kai Tak Sports Park Project.</p>	

RECOMMENDATIONS / MITIGATION MEASURES / ACTIONS			
Environmental mitigation measures have been maintained as follow:			
1. Power Mechanical Equipment with Quality Power Mechanical Equipment (QPME) labels were used at site to lower the noise nuisance to the nearby residents. (Photo 2)			
2. Regular site inspection was carried out to audit the implementation of mitigation measures on site. (Photo 3)			
5. Implementation of construction noise mitigation measures recommended in EIA's Environmental Mitigation Implementation Schedule.			
Prepared by:	Sunny Chan	Title:	Environmental Team Leader
Signature:		Date:	3 October 2024

**Attachment:**

**Photo Record:**



**Photo 1a and 1b:** Nearby road traffic along To Kwa Wan Road at NMS1-T2 on 26 September 2024.

**Environmental Measure Implemented:**




**Photo 2:** Power Mechanical Equipment with Quality Power Mechanical Equipment (QPME) labels were used at site to lower the noise nuisance to the nearby residents.



**Photo 3:** Regular site inspection was carried out to audit the implementation of mitigation measures on site.

### Exceedance Investigation Report

DETAIL OF EXCEEDANCE		Ref: EXC_0024
Monitoring Date:	26 September 2024	
Monitoring Time:	10:47 a.m.	
Monitoring Parameter:*	<del>Dust</del> Noise <del>Water</del> <del>Other</del>	
Monitoring Station:	NMS4 (The Henley)	
Measured Level:	77.2 dB(A)	
Level Exceeded:	Limit Level Exceedance	
INVESTIGATION RESULT & RESPONSE		
ET, IEC and SOR notified on:	2 October 2024	
Investigation conducted on:	2 October 2024	
Result of investigation:	<p>Exceedance investigation was carried out with the contractor on 2 October 2024, the results of investigation were summarized as following:</p> <p>According to the information from subcontractor, noise monitoring was carried out at noise monitoring station NMS4 at rooftop of retail building near The Henley between 10:47 a.m. and 11:17 a.m. on 26 September 2024. Nearby ground breaking work was observed within Kai Tak Sports Park during the monitoring period. (Photo 1a and 1b).</p> <p>Follow up noise mitigation measure had been implemented to minimise possible environmental nuisance included:</p> <ol style="list-style-type: none"> <li>1. Power Mechanical Equipment with Quality Power Mechanical Equipment (QPME) labels were used at site to lower the noise nuisance to the nearby residents. (Photo 2)</li> <li>2. Noise acoustic wrapping has been provided for the breaker to reduce noise emission from the breaking work (Photo 3)</li> <li>3. Regular site inspection was carried out to audit the implementation of mitigation measures (Photo 4)</li> </ol> <p>Further noise monitoring at NMS4 has been conducted between 10:30 a.m. and 11:00 a.m. on 2 Oct 2024. A noise level of 71.6 dB(A) was recorded. No noise limit level exceedance was observed. (Photo 5a and 5b)</p> <p>In conclusion, the Limit Level noise exceedance at monitoring station NMS4 was mainly due to nearby ground breaking work within Kai Tak Sports Park Project site. Noise mitigation measure has been recommended and implemented and no further noise exceedance was observed at monitoring station NMS4.</p>	

RECOMMENDATIONS / MITIGATION MEASURES / ACTIONS			
Environmental mitigation measures have been implemented as follow:			
<ol style="list-style-type: none"> <li>1. Power Mechanical Equipment with Quality Power Mechanical Equipment (QPME) labels were used at site to lower the noise nuisance to the nearby residents. (Photo 2)</li> <li>2. Noise acoustic wrapping has been provided for the breaker to reduce noise emission from the breaking work. (Photo 3)</li> <li>4. Regular site inspection was carried out to audit the implementation of mitigation measures on site. (Photo 4)</li> <li>5. Implementation of construction noise mitigation measures recommended in EIA's Environmental Mitigation Implementation Schedule.</li> </ol>			
Prepared by:	Sunny Chan	Title:	Environmental Team Leader
Signature:		Date:	4 October 2024



**Attachment:**

**Photo Record:**



**Photo 1a and 1b:** Ground breaking work was observed within Kai Tak Sports Park area on 26 September 2024.

**Environmental Measure Implemented:**



**Photo 2:** Power Mechanical Equipment with Quality Power Mechanical Equipment (QPME) labels were used at site to lower the noise nuisance to the nearby residents.



**Photo 3:** Noise acoustic wrapping has been provided for the breaker to reduce noise emission from the breaking work.



**Photo 4:** Regular site inspection was carried out to audit the implementation of mitigation measures on site.



Noise Monitoring Record Sheet

Monitoring Location		NMS-4						
Details of Location		Building						
Date of Monitoring		2-10-24						
Measurement Start Time (hh:mm)		1030 - 1100						
Measurement Time Length (min.)		30 min						
Weather Conditions		Fine						
Wind Speed (m/s)		0-5						
Noise Meter Model/Identification		NL52 20171761						
Calibrator Model/Identification		CALW 11374						
In site Calibration	Before	94.0						
	After	94.0						
Measurement Result	L <sub>eq</sub> (dB(A))	5min	5min	5min	5min	5min	5min	30min
		65.3	73.5	74.6	64.1	72.6	70.3	71.6
	L <sub>10</sub> (dB(A))	67.1	75.9	76.9	66.0	75.1	74.2	74.1
	L <sub>90</sub> (dB(A))	63.7	63.9	64.7	62.0	65.1	64.2	64.0
Major Construction Noise Source(s) During Monitoring		Crane operation						
Other Noise Source(s) During Monitoring		Traffic noise						
Remarks		/						

Name & Designation

Signature

Date

Record by:

K.T.HO

[Signature]

2-10-24

Checked by:

K.W.Fan  
Consultant

MF


3/10/2024

Photo 5a and 5b : Noise monitoring result at NMS4 on 2 Oct 2024.

# Appendix N. Complaint Investigation Report

### Complaint Investigation Report

RECEIPT OF COMPLAINT		Ref: COM_0041	
Date:	2 September 2024		
Time:	14:22		
From:	Public complaint referred by EPD		
Via:	email by contractor representative		
Contact no.:	-		
COMPLAINANT			
Name:	-	Address:	-
Contact no.:	-		
DETAILS OF COMPLAINT			
Date:	16 August 2024		
Time:	-		
Parameter:*	<del>Dust</del>	Noise	<del>Water</del> Other
Description:	<p>- Complaint of noise nuisance from the construction site Kai Tak Sports Park at night.</p> <p>- Please be advised to implement practicable mitigation measures at your construction site to minimize the environmental nuisance arising from the construction work.</p>		
INVESTIGATION RESULT & RESPONSE			
ET, IEC and SOR notified on:	2 September 2024		
Investigation conducted on:	2 September 2024		
Result of investigation:	<p>Complaint investigation was carried out with the contractor on 4 September 2024, the results of investigation were summarized as following:</p> <p>According to the information from contractor, regular site inspection was carried out on 27 August 2024. (Photo 1) Noise mitigation measures recommended in EIA's Environmental Mitigation Implementation Schedule were generally implemented during the time of inspection. All construction works carried out on site have strictly followed the Construction Noise Permit requirement. Night time inspections were conducted to ensure all Power Mechanical Equipment were switched off at night. (Photo 5) The CNP (Ref. No.: GW-RE0913-24 and GW-RE1008-24) for the construction works effective in August 2024 are attached for information. (Photos 6a to 6d). The complaint has been replied by contractor on 2 September 2024.</p> <p>Regular noise mitigation measure had been implemented to prevent possible environmental nuisance included:</p> <ol style="list-style-type: none"> <li>1. Power Mechanical Equipment with Quality Power Mechanical Equipment (QPME) labels were used at site to lower the noise nuisance to the nearby residents. (Photo 2)</li> <li>2. Subcontractors had been reminded to observe the Construction Noise Permit for working at night during regular subcontractor meetings. (Photo 3)</li> <li>3. A memo to all subcontractors has been issued in August 2024 with the latest Construction Noise Permit attached. (Photo 4)</li> <li>4. Night time inspections were conducted to ensure all Power Mechanical Equipment were switched off. (Photo 5)</li> </ol> <p>In conclusion, construction noise mitigation measures at the Kai Tak Sports Park have been implemented and maintained. All construction works carried out have been fulfilling the relevant environmental legislations and their subsidiary regulations during the concerned period.</p>		

RECOMMENDATIONS / MITIGATION MEASURES / ACTIONS			
Environmental mitigation measures have been maintained as follow:			
1. Power Mechanical Equipment with Quality Power Mechanical Equipment (QPME) labels were used at site to lower the noise nuisance to the nearby residents. (Photo 2)			
2. Subcontractors had been reminded to observe the Construction Noise Permit for working at night during regular subcontractor meetings. (Photo 3)			
3. A memo to all subcontractors has been issued in August 2024 with the latest Construction Noise Permit attached. (Photo 4)			
4. Night time inspections were conducted to ensure all Power Mechanical Equipment were switched off. (Photo 5)			
5. Implementation of construction noise mitigation measures recommended in EIA's Environmental Mitigation Implementation Schedule.			
Prepared by:	Sunny Chan	Title:	Environmental Team Leader
Signature:		Date:	9 September 2024

**Attachment:**

**Photo Record:**

**Environmental Measure Implemented:**



**Photo 1:** Regular site inspection carried out with contractor on 27 August 2024.



**Photo 2 :** Power Mechanical Equipment with Quality Power Mechanical Equipment (QPME) labels were used at site to lower the noise nuisance to the nearby residents.





**Photo 3:** Subcontractors had been reminded to observe the Construction Noise Permit for working at night during regular subcontractor meetings.



備忘錄

致：各分判商 日期：23/08/2024  
由：陳保雄 工程編號：KT201901  
地盤：啟德體育園項目 檔案編號：S36345/KT201901-Y03/PHC/SYY


有關北區建築噪音許可證更新事宜

環境保護署已於2024年08月20日更新北區建築噪音許可證，並將於2024年08月30日晚7時正起生效，有效期至2025年02月28日晚12時正。現特提醒貴司必須嚴格遵守有關要求，尤其注意必須遵守機動設備之組合以及許可建築工程所包括之範圍（詳見附件），請貴司務必注意以下特別要求：

1. 按建築噪音許可證之要求，在公眾假期(包括星期日)時，認可之機動設備起動時間為早上9點開始至晚上11點。
2. 公眾假期以外的日子，認可之機動設備起動時間維持不變(即由下午7點至晚上11點)。
3. 如貴司需於夜間工作，請於晚上22:30起關掉所有機動設備，以確保工地能於晚上11點時關掉所有施工用機動設備(水泵及緊急發電機除外)。
4. 如需於星期日工作，必需嚴遵於星期三下班前向工地總管遞交假日工作許可證申請及列明環保進行建築噪音許可證訓練。

我可以隨本函附上最新建築噪音許可證以供參考，請貴司務必了解許可證之要求，並提醒所有工地人員切實遵守《噪音管制條例》，並確保進行的工序、所使用機動設備種類、數量及其使用位置符合建築噪音許可證內的條款。根據分判合約，在分判合約有效期間，政府所修定之新法例及分判合約所遺漏並已實行之法例，分判商亦須一律遵守。如有違反相關條例而導致總承建商遭受檢控或導致任何損失，一切費用及罰款將由分判商承擔。如我司發現貴司有違規情況，將不作另外警告而嚴懲不貸，敬希注意。

協興工程有限公司

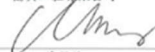  
陳保雄  
副工程項目經理

附件：北區建築噪音許可證 (GW-RE1008-24)

副本抄送：工程項目經理 / 工地總管 / 環保部 / 工料測量部

PHC/SYY/jcc

香港九龍彌敦道六號六號樓中心十一樓 11F Chevalier Commercial Centre, 6 Wang Hoi Road, Kowloon Bay, Hong Kong  
電話 Tel: (852) 2525 9251 傳真 Fax: (852) 2845 5255 電郵 Email: email@hiping.com.hk 網站 Website: www.hiping.com.hk



**Photo 4:** A memo to all subcontractors has been issued in August 2024 with the latest Construction Noise Permit attached.



**Photo 5:** Night time inspections were conducted to ensure all Power Mechanical Equipment were switched off.

FORM 3  
NOISE CONTROL ORDINANCE  
(Chapter 400)  
SECTION 8(9)

[reg.5(a)]

**CONSTRUCTION NOISE PERMIT FOR THE USE OF POWERED  
MECHANICAL EQUIPMENT FOR THE PURPOSE OF CARRYING OUT  
CONSTRUCTION WORK OTHER THAN PERCUSSIVE PILING AND/OR  
THE CARRYING OUT OF PRESCRIBED CONSTRUCTION WORK**

CONSTRUCTION NOISE PERMIT NO. GW-RE0913-24

To: HIP HING ENGINEERING COMPANY LIMITED

This construction noise permit is issued in accordance with section 8 of the Noise Control Ordinance. Permission is granted for the use of powered mechanical equipment for the purpose of carrying out construction work other than percussive piling and/or the carrying out of prescribed construction work, subject to the conditions set out below. The carrying out of construction work otherwise than in accordance with the conditions may result in the permit being cancelled and in a prosecution for an offence.

*CONDITIONS*

1. Construction site where the powered mechanical equipment and/or prescribed construction work may be employed:  
Full address: Construction Site of Kai Tak Sports Park (North) and Shing Kai Road, Kai Tak, Kowloon.  
Lot No.: ---

The site boundary, that is, the boundary of the area within which the powered mechanical equipment may be used and the prescribed construction work may be carried out is delineated on the attached plan which forms part of this construction noise permit.

2. \* PART/WHOLE of the site falls \* WITHIN/OUTSIDE a designated area.

3. Powered Mechanical Equipment

a. Items of powered mechanical equipment which may be used inside the site boundary:


<i>Identification code of item of powered mechanical equipment (if applicable)</i>	<i>Description of item of powered mechanical equipment</i>	<i>No. of units</i>
Refer to attached sheet.		

b. Validity of the construction noise permit for the use of the powered mechanical equipment:  
Date and time of commencement : 05 August 2024 at 2300 hours  
Days and hours : 0000-2400 hours on general holidays (including Sundays), 0000-0700 hours and 1900-2400 hours on any day not being a general holiday [but note condition 3.d.1. below for the operating hours within which the use of the above listed powered mechanical equipment is allowed].  
This part of the permit expires on : 30 August 2024 at 0540 hours

c. One photograph, endorsed by the Authority, of each item of powered mechanical equipment described in this construction noise permit is required to be kept on the construction site and made available for inspection by the Authority.

d. Other conditions imposed on the use of the powered mechanical equipment:  
Please refer to attached sheet for conditions imposed for this construction noise permit which is issued as a special case due to constraints on working hours to avoid causing serious interruption to road transport.

EPD76A(s) - 1 -

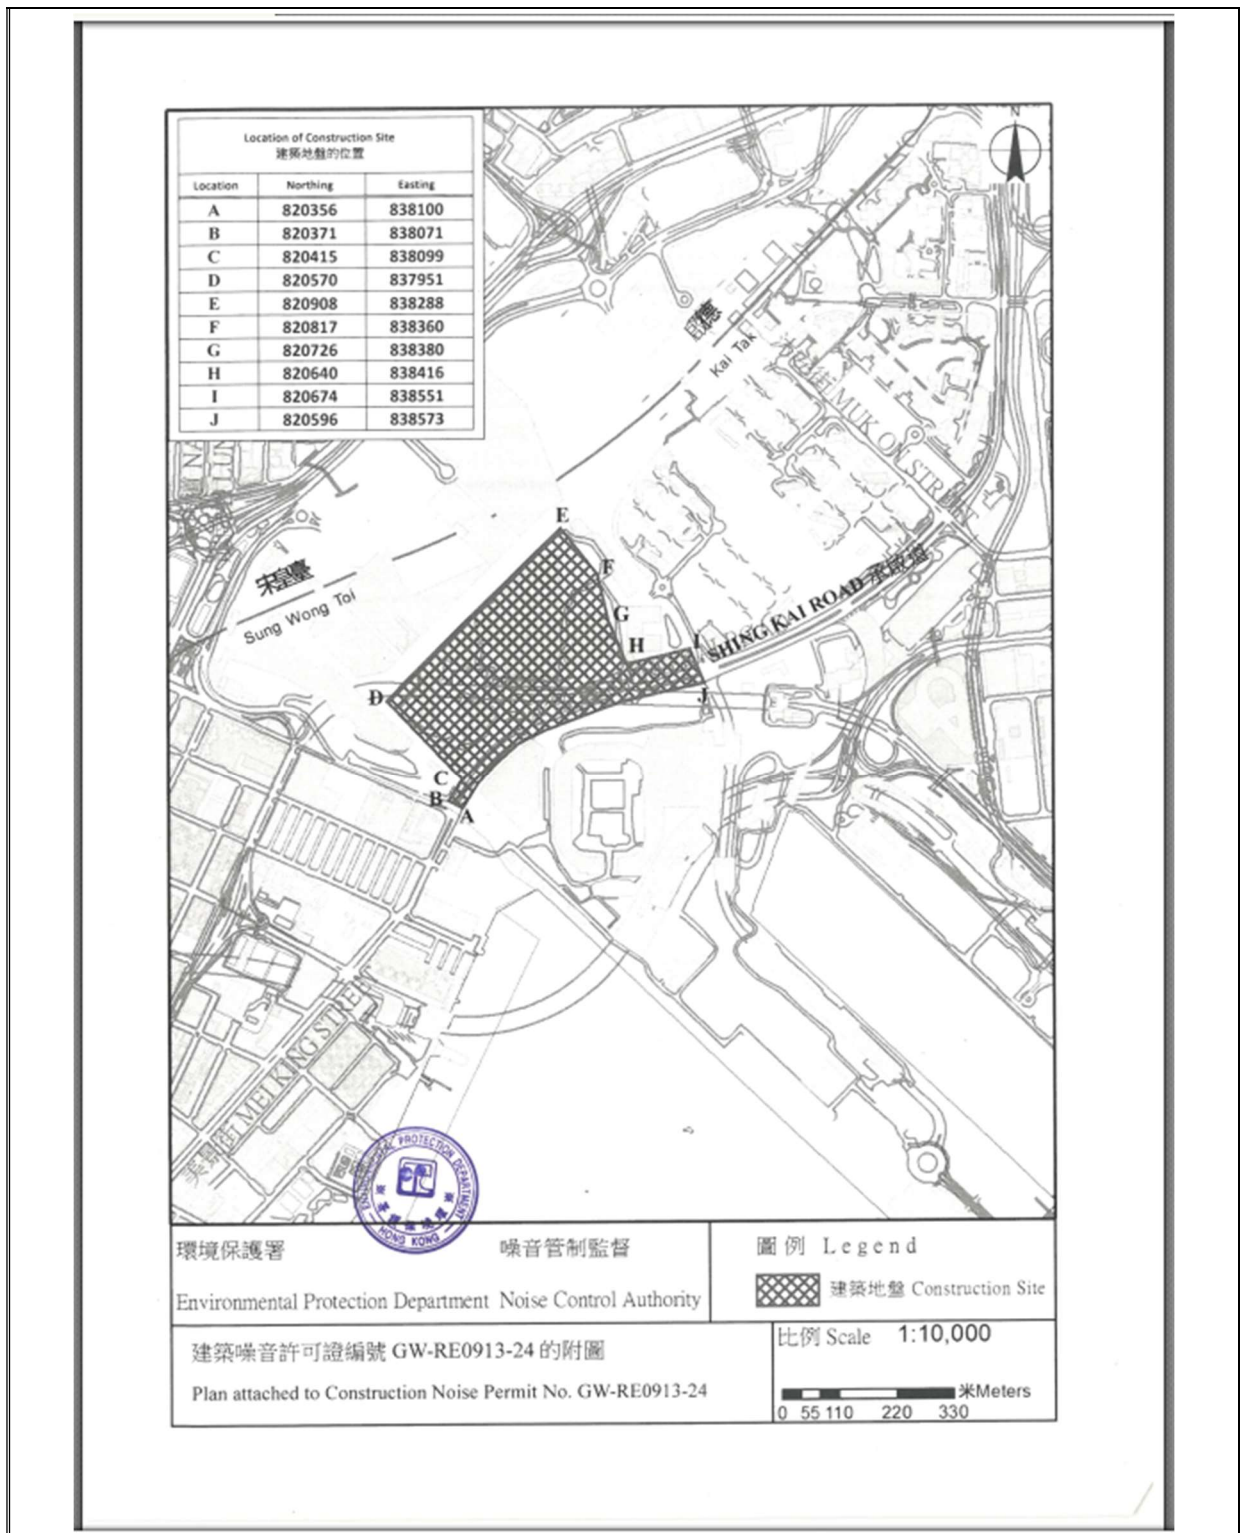

FORM 3  
NOISE CONTROL ORDINANCE  
(Chapter 400)  
SECTION 8(9)

[reg.5(a)]

**CONSTRUCTION NOISE PERMIT FOR THE USE OF POWERED  
MECHANICAL EQUIPMENT FOR THE PURPOSE OF CARRYING OUT  
CONSTRUCTION WORK OTHER THAN PERCUSSIVE PILING AND/OR  
THE CARRYING OUT OF PRESCRIBED CONSTRUCTION WORK**

CONSTRUCTION NOISE PERMIT NO. GW-RE1008-24

To : HIP HING ENGINEERING COMPANY LIMITED

This construction noise permit is issued in accordance with section 8 of the Noise Control Ordinance. Permission is granted for the use of powered mechanical equipment for the purpose of carrying out construction work other than percussive piling and/or the carrying out of prescribed construction work, subject to the conditions set out below. The carrying out of construction work otherwise than in accordance with the conditions may result in the permit being cancelled and in a prosecution for an offence.

*CONDITIONS*

1. Construction site where the powered mechanical equipment and/or prescribed construction work may be employed :

Full address : Construction site of Kai Tak Sports Park (North), Kai Tak, Kowloon.

Lot No.: ---

The site boundary, that is, the boundary of the area within which the powered mechanical equipment may be used and the prescribed construction work may be carried out is delineated on the attached plan which forms part of this construction noise permit.

2. \* PART/WHOLE of the site falls \* WITHIN/OUTSIDE a designated area.

3. Powered Mechanical Equipment

- a. Items of powered mechanical equipment which may be used inside the site boundary :

<i>Identification code of item of powered mechanical equipment (if applicable)</i>	<i>Description of item of powered mechanical equipment</i>	<i>No. of units</i>
	Refer to attached sheet	

- b. Validity of the construction noise permit for the use of the powered mechanical equipment:

Date and time of commencement : 30 August 2024 at 0000 hours

Days and hours : 0000-2400 hours on general holiday (including Sunday), 0000-0700 hours and 1900-2400 hours on any day not being a general holiday [but note condition 3.d.1. below for the operating hours within which the use of the above listed powered mechanical equipment is allowed].

This part of the permit expires on : 28 February 2025 at 2400 hours

- c. One photograph, endorsed by the Authority, of each item of powered mechanical equipment described in this construction noise permit is required to be kept on the construction site and made available for inspection by the Authority.

- d. Other conditions imposed on the use of the powered mechanical equipment:

Refer to attached sheet.

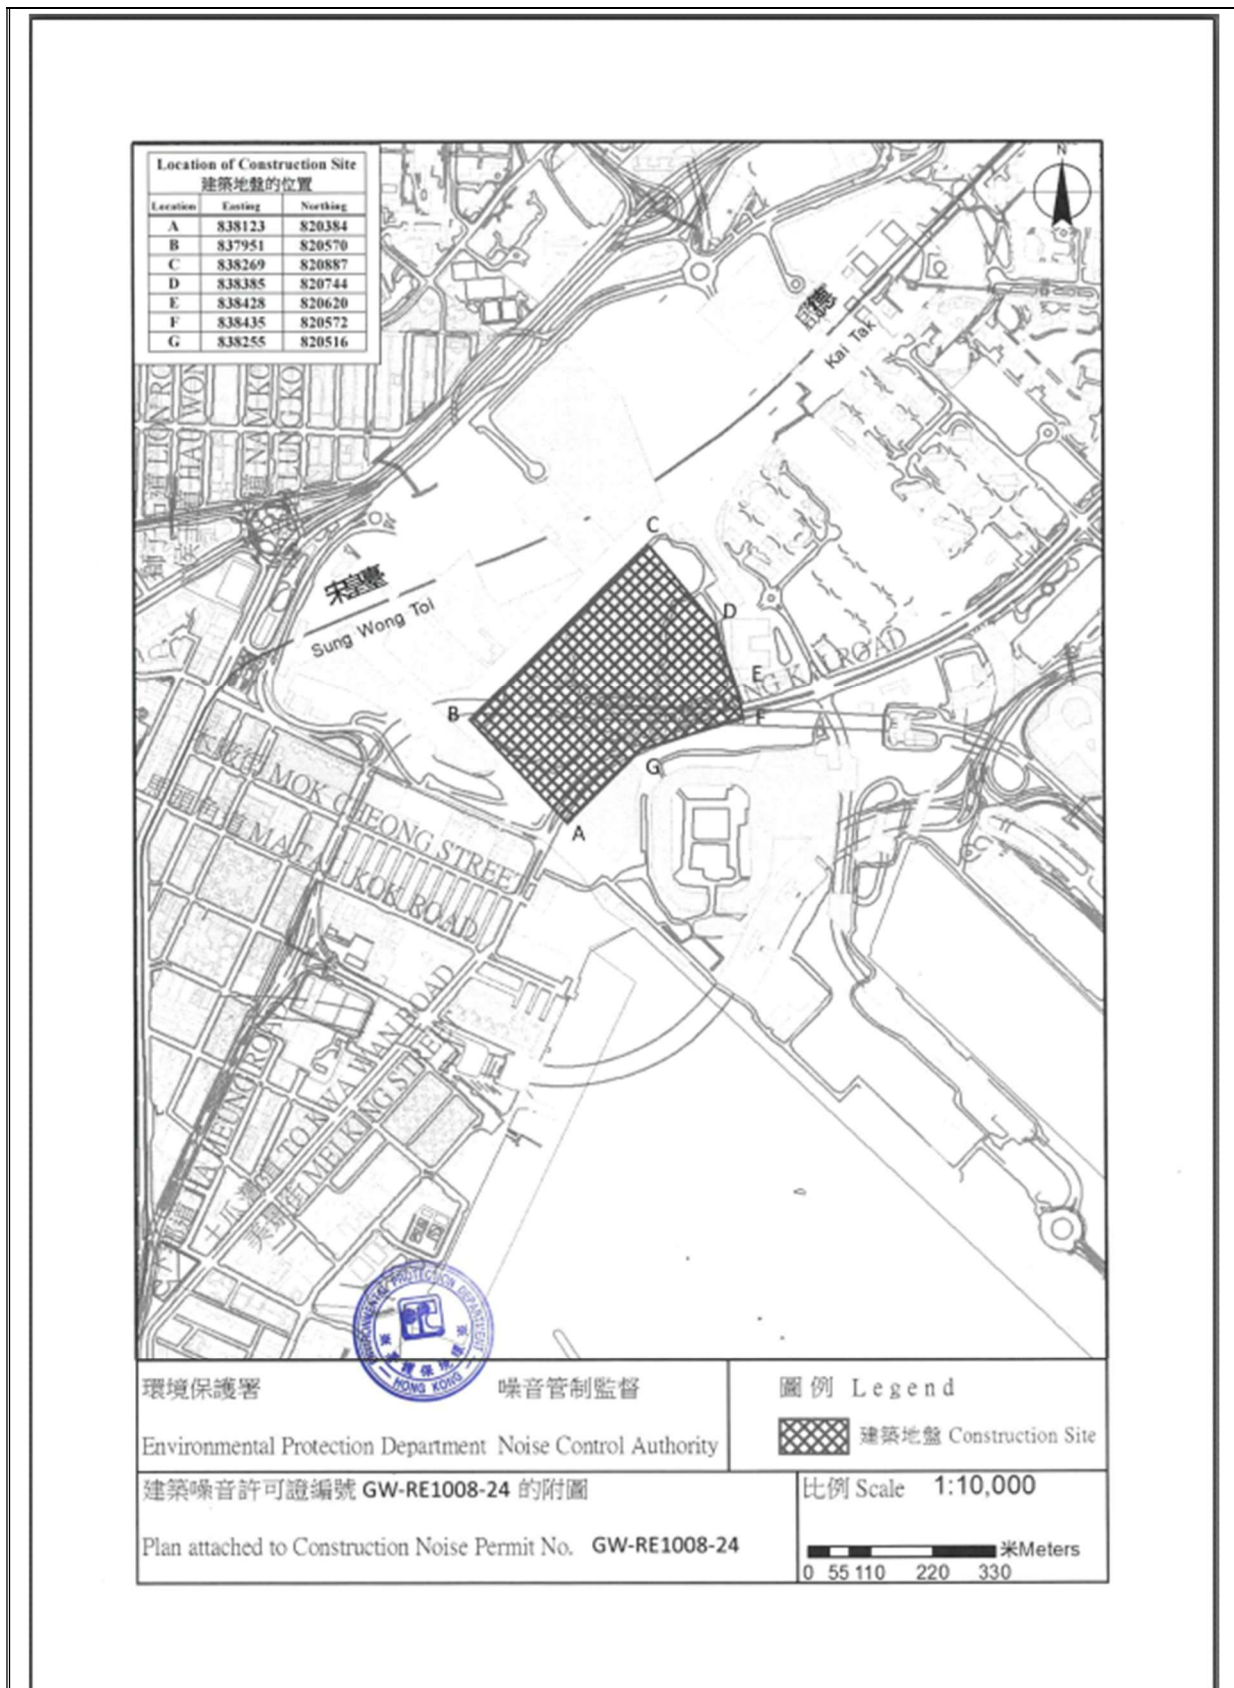


Photo 6a to 6d: Record of Construction Noise Permit - GW-RE0913-24, GW-RE1008-24